



# Retrofit Front Doors With Updated Latches

**Classification** Campaign Bulletin    **Section/Group** 11 - Closures    **Country/Region** All

**Year** 2015-2016    **Model** Model X    **Version** All

**Bulletin Classification:** *This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN range listed. These instructions assume knowledge of motor vehicle and high voltage electrical component repairs, and should only be executed by trained professionals. Tesla assumes no liability for injury or property damage due to a failure to properly follow these instructions or repairs attempted by unqualified individuals.*

*This Service Document supersedes SB-16-11-006 R1, dated 22-Aug-18. Each content change is marked by a vertical line in the left margin. Discard the previous version and replace it with this one.*

## Condition

Early front door latches are susceptible to water ingress, which might cause the touchscreen to show the door in the wrong position or prevent the door from opening and closing automatically. The door can still be opened with the inside handle.

## Correction

Direct replacement latches are no longer available. Retrofit the LH and RH front doors with updated latches.

**⚠ CAUTION:** Attempting to close a front door with the wrong striker installed could result in damage to the front door latch.

**NOTE:** To determine the vehicle door latch version, refer to Service Bulletin BR-17-11-005, "Replacing Model X Front Doors and Front Door Latches."

Correction Description	Correction	Time
SB-16-11-006 Not Applicable	S011611006	0.00
Retrofit LH And RH Front Doors With Updated Latches	S041611006	2.65

Required Part(s):	Part Number	Description	Quantity
	1446159-00-B	LATCH RETROFIT KIT LH AND RH, SERVICE	1

This part number was current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Manual.

## Procedure

Retrofit the LH and RH front doors with updated latches (refer to Service Manual procedure 11351506).

---

**Affected VIN(s)** Affected Model X vehicles built before approximately August 29, 2016.

**NOTE:** This is a simplified summary of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

For feedback on the accuracy of this document, email [ServiceBulletinFeedback@tesla.com](mailto:ServiceBulletinFeedback@tesla.com).