

MS510, MS517dn, MS610, MS617dn, M1145, and M3150 printers

4514-63x, -64x

Service Manual

- Start diagnostics
- Maintenance
- Safety and notices
- Trademarks
- Index

October 01, 2019

www.lexmark.com

Product information

Product name:

Lexmark MS510, MS517dn, MS610, MS617dn, M1145, and M3150

Machine type:

4514

Model(s):

630, 635, 636, 638, 639, 646, 649

Edition notice

October 01, 2019

The following paragraph does not apply to any country where such provisions are inconsistent with local law: LEXMARK INTERNATIONAL, INC., PROVIDES THIS PUBLICATION "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions; therefore, this statement may not apply to you.

This publication could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in later editions. Improvements or changes in the products or the programs described may be made at any time.

References in this publication to products, programs, or services do not imply that the manufacturer intends to make these available in all countries in which it operates. Any reference to a product, program, or service is not intended to state or imply that only that product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any existing intellectual property right may be used instead. Evaluation and verification of operation in conjunction with other products, programs, or services, except those expressly designated by the manufacturer, are the user's responsibility.

Trademarks

Lexmark and the Lexmark logo are trademarks of Lexmark International, Inc., registered in the United States and/or other countries. PCL® is a registered trademark of the Hewlett-Packard Company. PCL is Hewlett-Packard Company's designation of a set of printer commands (language) and functions included in its printer products. This printer is intended to be compatible with the PCL language. This means the printer recognizes PCL commands used in various application programs, and that the printer emulates the functions corresponding to the commands.

PostScript is a registered trademark of Adobe Systems Incorporated in the United States and/or other countries. All other trademarks are the property of their respective owners.

© 2017 Lexmark International, Inc.

All rights reserved.

P/N 12G2826

Table of contents

Product information	2
Edition notice	2
Notices and safety information	13
Laser notices	13
Safety information	16
Service conventions and change history	21
Change history	
General information	29
Media guidelines	29
Paper guidelines	
Using recycled paper and other office papers	
Using specialty media	32
Supported paper sizes, types, and weights	34
Data security notice	36
Tools required for service	
10013 16401160 101 361 1166	
Diagnostics and troubleshooting	39
Troubleshooting overview	
Performing the initial troubleshooting check	
Power-on Reset (POR) sequence	
Fixing print quality issues	
Initial print quality check	
Gray background or toner fog check	
Blank pages check	
Solid black pages check	
Print is too dark check	
Print is too light check	
Paper curl check	
Folded or wrinkled paper check	58
Repeating defects check	59
Skewed print check	60
Streaked vertical lines appear on prints check	62
Horizontal light bands check	63
Vertical light bands check	64
Vertical dark bands check	65

Vertical dark streaks with print missing check	66
White streaks and voided areas check	69
Fine lines are not printed correctly (specifically Chinese characters) check	71
Clipped pages or images check	72
Compressed images appear on prints check	74
Incorrect margins on prints check	75
Toner rubs off check	76
Toner specks appear on prints check	77
Paper jams	79
Avoiding jams	79
Understanding jam messages and locations	80
[x]-page jam, open front door. [20y.xx]	
[x]-page jam, clear standard bin. [20y.xx]	84
[x]-page jam, open rear door. [20y.xx]	84
[x]-page jam, remove tray 1 to clear duplex. [23y.xx]	86
[x]-page jam, open tray 1. [241.xx]	87
[x]-page jam, open tray [x]. [24y.xx]	88
[x]-page jam, clear manual feeder. [25y.xx]	89
200 paper jams	90
201 paper jams	95
202 paper jams	96
23y paper jams	98
241 paper jams	99
242–244 paper jams	103
25y paper jams	109
Understanding the printer messages	111
Cartridge, imaging unit mismatch [41.xy]	
Cartridge low [88.xy]	111
Cartridge nearly low [88.xy]	111
Cartridge very low, [x] estimated pages remain [88.xy]	111
Change [paper source] to [custom type name] load [orientation]	111
Change [paper source] to [custom string] load [paper orientation]	112
Change [paper source] to [paper size] load [orientation]	112
Change [paper source] to [paper type] [paper size] load [orientation]	112
Close front door	112
Complex page, some data may not have printed [39]	112
Configuration change, some held jobs were not restored [57]	112
Defective flash detected [51]	113
Error reading USB drive. Remove USB	113
Error reading USB hub. Remove hub	113
Imaging unit low [84.xy]	113
Imaging unit nearly low [84.xy]	113
Imaging unit very low, [x] estimated pages remain [84.xy]	113
Incorrect paper size, open [paper source] [34]	114

	Insert Tray [x]	114
	Insufficient memory to support Resource Save feature [35]	114
	Insufficient memory to collate job [37]	114
	Insufficient memory for Flash Memory Defragment operation [37]	114
	Insufficient memory, some Held Jobs were deleted [37]	114
	Insufficient memory, some held jobs will not be restored [37]	115
	Load [paper source] with [custom string] [paper orientation]	115
	Load [paper source] with [custom type name] [paper orientation]	115
	Load [paper source] with [paper size] [paper orientation]	115
	Load [paper source] with [paper type] [paper size] [paper orientation]	116
	Load manual feeder with [custom type name] [paper orientation]	116
	Load manual feeder with [custom string] [paper orientation]	116
	Load manual feeder with [paper size] [paper orientation]	116
	Load manual feeder with [paper type] [paper size] [paper orientation]	117
	Maintenance kit low [80.xy]	117
	Maintenance kit nearly low [80.xy]	117
	Maintenance kit very low, [x] estimated pages remain [80.xy]	117
	Memory full [38]	117
	Network [x] software error [54]	118
	Non-Lexmark [supply type], see User's Guide [33.xy]	118
	Not enough free space in flash memory for resources [52]	118
	Printer had to restart. Last job may be incomplete.	119
	Reinstall missing or unresponsive cartridge [31.xy]	
	Reinstall missing or unresponsive imaging unit [31.xy]	119
	Remove paper from standard output bin	119
	Replace cartridge, 0 estimated pages remain [88.xy]	
	Replace cartridge, printer region mismatch [42.xy]	
	Replace imaging unit, 0 estimated pages remain [84.xy]	
	Replace maintenance kit, 0 estimated pages remain [80.xy]	
	Replace unsupported cartridge [32.xy]	120
	Replace unsupported imaging unit [32.xy]	120
	Serial option [x] error [54]	121
	SMTP server not set up. Contact system administrator	121
	Standard network software error [54]	
	Standard parallel port disabled [56]	121
	Standard USB port disabled [56]	
	Too many flash options installed [58]	122
	Too many trays attached [58]	122
	Unformatted flash detected [53]	
	Unsupported option in slot [x] [55]	
	Weblink server not set up. Contact system administrator	122
Us	ser attendance messages (0–99.99)	123
	User attendance messages (0-99.99)	123
	Unresponsive toner cartridge service check	126
	Unsupported toner cartridge service check	126

Printer/cartridge mismatch service check	127
Unsupported imaging unit service check	127
Imaging unit smart chip contact service check	128
Toner smart chip compatibility service check	128
Imaging chip compatibility service check	129
Media size mismatch service check	129
Supplies mismatch service check	130
Insufficient memory service check	131
Flash full service check	131
Maintenance kit service check	132
Imaging unit low service check	132
Toner cartridge low service check	132
Printer hardware errors	133
111 errors	133
121 errors	137
126 errors	139
132 errors	140
133 errors	141
140 errors	142
146 errors	143
155 errors	143
171 errors	145
ACM service check	146
Procedure before starting the 9yy service checks	146
900 errors	148
912 errors	153
94y errors	153
950–958 errors	153
959 errors	156
96y errors	
97y errors	158
98y errors	159
99y errors	160
Input option hardware errors	161
3yy error messages	161
Option tray pick/lift motor service check	163
Option tray separator/pass through motor service check	163
Option tray ACM motor service check	164
Option tray controller card service check	164
Other symptoms	165
Base printer symptoms	
Dead machine service check	
Controller board service check	
Control panel button service check	167

Control panel service check	168
Toner starvation service check	168
USB print service check	169
Network service check	170
Service menus	173
Understanding the printer control panel	173
Using the printer control panel	173
Understanding the colors of the indicator and Sleep button lights	174
Menus list	175
Diagnostics menu	176
Entering the Diagnostics menu	176
Registration	176
PRINT TESTS	177
Print Quality Pages	177
Hardware Tests	178
Duplex Tests	179
Input tray tests	181
Output Bin Tests	182
BASE SENSOR TEST	183
Device Tests	184
Printer Setup	185
EP Setup	
Reports	
Event Log	
Exit Diags	190
Configuration menu	190
Entering the Configuration menu	190
Maintenance Counter Value	190
Reset Maintenance Counter	190
Print Quality Pages	
Reports	
Panel Menus	
PPDS Emulation	
Download Emuls	
Safe Mode	
Factory Defaults	
Energy Conserve	
Paper Prompts	
Envelope Prompts	
Action for Prompts	
Jobs on Disk	
Disk Encryption	
Wipe All Settings	195

Font Density	195
Font Sharpening	195
Reduced Curl	195
Require Standby	196
A5 Loading	196
UI Automation	196
Key Repeat Initial Delay	197
Key Repeat Rate	197
Clear Supply Usage History	197
Clear Custom Status	197
USB Speed	
Automatically Display Error Screens	198
USB PnP	
Restore Factory Defaults	198
Entering Invalid engine mode	199
Entering Recovery mode	199
Accessing the Network SE menu	199
Service engineer menu	200
Accessing the service engineer (SE) menu	200
Service engineer (SE) menu	200
Downto wassassas	204
Parts removal	
Removal precautions	
Data security notice	
Handling ESD-sensitive parts	
Critical information for controller board or control panel replacement	
Restoring the printer configuration after replacing the controller board	
Restoring solutions, licenses, and configuration settings	
Updating the printer firmware	
Backing up eSF solutions and settings	
Ribbon cable connectors	
Zero Insertion Force (ZIF) connectors	
Horizontal top contact connector	
Horizontal bottom contact connector	
Vertical mount contact connector	
Horizontal sliding contact connector	
Low Insertion Force (LIF) connector	
Printhead assembly adjustments	
Removal procedures	
Left side removals	226
Left cover removal	
Main drive gearbox removal	
MPF solenoid removal	229

MPF gearbox removal	232
Reverse solenoid removal	235
Cartridge gearbox removal	236
Duplex gear assembly removal	237
Right side removals	239
Right cover removal	239
Right cover removal (MS610de)	239
Tray present sensor removal	240
Cooling fan duct removal	24
Cooling fan removals	24
Cooling fan mount removal (MS610de)	243
Controller board shield removal (MS610de)	245
Controller board removals	245
Toner cartridge smart chip contact removal	249
Front removals	25
Left front mount removal	25 ²
Right front mount removal	253
Transfer roll removal	255
Cartridge plunger removal	256
Bezel removals	259
Nameplate removals	26
Control panel assembly removals	263
UICC removals	269
Control panel USB port removal (MS610dn)	272
Speaker and control panel USB port removal (MS610de)	273
MPF assembly removal	274
MPF pick roller cover removal	
MPF pick roller removal	
Bail removal	
Jam access cover removal	
Front door removal	
Front access cover removal	
Front door sensor removal	
Front input guide removal	
Separator pad removal	285
Bottom removals	287
Power supply removal	287
Power supply shield removal	288
Duplex removal	289
Duplex sensor and input sensor removal	
Index sensor removal	
Toner density sensor removal	
Media present sensor removal	
Trailing edge sensor removal	297

Media present sensor flag removal	297
ACM assembly removal	301
Pick/Lift motor gearbox removal	303
Rear side removals	305
Dust cover removal	
Rear door and cover removal	
Narrow media/bin full sensor removal	
Redrive assembly removal	
Redrive shaft removalFuser removal	
Top side removals	
Top cover removal	
Laser scanning unit (LSU) removal	
250/550-sheet option tray removals	
Pick roller removal	
Separator roll assembly removal	316
ACM assembly removal	318
Component locations	321
Exterior locations	
MS510dn and MS610dn exterior locations	
MS610de exterior locations	
Maintenance	325
Inspection guide	
Scheduled maintenance	
Maintenance kits	
Resetting the maintenance counter	327
Lubrication specification	327
Cleaning the printer	328
Cleaning the printhead lenses	328
Parts catalog	330
Legend	
Assembly 1: Covers	
Assembly 2: Electronics 1	
Assembly 3: Electronics 2	
Assembly 4: Frame	342
Assembly 5: Option trays	345
Assembly 6: Maintenance kits	347

Assembly 7: Power cords	351
Assembly 8: Miscellaneous	353
Printer specifications	355
Product power consumption	
Electrical specifications	
Operating clearances	
Acoustics	
Operating environment	
Enabling the security reset jumper	
Ontions and features	250
Options and features	
Available internal options	
Media handling options	359
Theory of operation	361
POR sequence	361
Printer control	361
Paper path information	361
Input tray	361
Multipurpose feeder (MPF)	
Simplex printing	
Duplex printing	
Media handling components	
Main drive gearbox	
Autocompensator mechanism (ACM)	
Key components Sensors	
Other key components	
Electrophotographic process (EP process)	
Acronyms	373
y	
Index	375
Part number index	383
Part name index	389

Notices and safety information

Laser notices

Laser notice

The printer is certified in the U.S. to conform to the requirements of DHHS 21 CFR, Chapter I, Subchapter J for Class I (1) laser products, and elsewhere is certified as a Class I laser product conforming to the requirements of IEC 60825-1.

Class I laser products are not considered to be hazardous. The printer contains internally a Class IIIb (3b) laser that is nominally a 7 milliwatt gallium arsenide laser operating in the wavelength of 655-675 nanometers. The laser system and printer are designed so there is never any human access to laser radiation above a Class I level during normal operation, user maintenance, or prescribed service condition.

Laser-Hinweis

Der Drucker wurde in den USA zertifiziert und entspricht den DHHS-Vorschriften 21 CFR, Kapitel I, Unterkapitel J für Laserprodukte der Klasse I (1); andernorts ist er als Laserprodukt der Klasse I zertifiziert, das den IEC 60825-1-Anforderungen entspricht.

Laserprodukte der Klasse I werden nicht als gefährlich eingestuft. Der Drucker enthält im Inneren einen Laser der Klasse IIIb (3b), und zwar einen 7-Milliwatt-Gallium-Arsenid-Laser, der im Wellenlängenbereich von 655 bis 675 Nanometern arbeitet. Das Lasersystem und der Drucker sind so konstruiert, dass unter normalen Betriebsbedingungen, bei der Wartung durch den Benutzer oder bei den vorgeschriebenen Wartungsbedingungen Menschen keiner Laserstrahlung ausgesetzt sind, die die Werte für Klasse I überschreitet.

Avis relatif à l'utilisation du laser

L'imprimante est certifiée conforme aux exigences de la réglementation des Etats-Unis relative aux produits laser (DHHS 21 CFR, Chapter I, Subchapter J for Class I (1)). Pour les autres pays, elle est certifiée conforme aux exigences des normes IEC 60825-1 relatives aux produits laser de classe I.

Les produits laser de Classe I ne sont pas considérés comme dangereux. L'imprimante contient un laser de classe IIIb (3b), laser arséniure de gallium 7 milliwatts opérant sur une longueur d'onde de l'ordre de 655 à 675 nanomètres. Le système laser ainsi que l'imprimante ont été conçus de manière à ce que personne ne soit exposé à des rayonnements laser dépassant le niveau de classe I dans le cadre d'un fonctionnement normal, de l'entretien par l'utilisateur ou de la maintenance.

Avvertenze sui prodotti laser

La stampante è certificata negli Stati Uniti come stampante conforme ai requisiti DHHS 21 CFR, Capitolo I, Sottocapitolo J per i prodotti laser di Classe I (1), mentre in altri paesi è certificata come prodotto laser di Classe I conforme ai requisiti IEC 60825-1.

I prodotti laser di Classe I non sono considerati pericolosi. La stampante contiene un laser di Classe IIIb (3b), che è nominalmente un laser ad arseniuro di gallio a 7 milliwatt funzionante a una lunghezza d'onda di 655-675 nanometri. Il sistema laser e la stampante sono stati progettati in modo da impedire l'esposizione a radiazioni laser superiori al livello previsto dalla Classe I durante le normali operazioni di stampa, manutenzione o assistenza.

Aviso de láser

Esta impresora se ha certificado en EE. UU. de conformidad con los requisitos de DHHS 21 CFR, capítulo I, subcapítulo J, para los productos láser de Clase I (1), y en otros países está certificada como un producto láser de Clase I de acuerdo con los requisitos de IEC 60825-1.

Los productos láser de Clase I no se consideran peligrosos. La impresora contiene un láser interno de Clase IIIb (3b) que nominalmente es un láser de arseniuro de galio de 7 milivatios que funciona en una longitud de onda de 655-675 nanómetros. El sistema láser y la impresora se han diseñado para que ningún individuo acceda nunca a las radiaciones láser por encima del nivel de Clase I durante su uso normal, ni en tareas de mantenimiento o intervenciones de servicio técnico prescritas.

Aviso sobre laser

A impressora foi certificada nos EUA por estar em conformidade com os requisitos do DHHS 21 CFR, capítulo I, subcapítulo J, para produtos a laser de Classe I (1) e, nos demais países, foi certificada como produto a laser de Classe I em conformidade com os requisitos da IEC 60825-1.

Os produtos a laser de Classe I não são considerados perigosos. A impressora contém, internamente, um laser de Classe IIIb (3b) que é um laser de arsenieto de gálio de 7 miliwatts operando no comprimento de onda de 655-675 nanômetros. O sistema do laser e a impressora foram projetados para que jamais haja acesso humano à radiação do laser acima do nível da Classe I durante a operação normal ou a manutenção pelo usuário ou sob as condições de manutenção prescritas.

Laserinformatie

Deze printer is in de Verenigde Staten gecertificeerd als een product dat voldoet aan de vereisten van DHHS 21 CFR, hoofdstuk 1, paragraaf J voor laserproducten van klasse I (1). Elders is de printer gecertificeerd als een laserproduct van klasse I dat voldoet aan de vereisten van IEC 60825-1.

Laserproducten van klasse I worden geacht geen gevaar op te leveren. De printer bevat intern een laser van klasse IIIb (3b), een galliumarsenide laser met een nominaal vermogen van 7 milliwatt en een golflengtebereik van 655-675 nanometer. Het lasersysteem en de printer zijn zodanig ontworpen dat gebruikers nooit blootstaan aan laserstraling die hoger is dan het toegestane niveau voor klasse I-apparaten, tijdens normaal gebruik, onderhoudswerkzaamheden door de gebruiker of voorgeschreven servicewerkzaamheden.

Lasererklæring

Denne printer er certificeret i USA i henhold til kravene i DHHS 21 CFR, afsnit I, underafsnit J, for Klasse I-laserprodukter (1) og certificeret andetsteds som et Klasse I-laserprodukt i henhold til kravene i IEC 60825-1.

Klasse I-laserprodukter anses ikke for at være farlige. Printeren indeholder internt en klasse IIIb (3b)-laser, der nominelt er en 7 milliwatt galliumarsenid-laser, som fungerer i bølgelængdeområdet 655-675 nanometer. Lasersystemet og printeren er udviklet på en sådan måde, at der ikke er en direkte laserstråling, der overskrider Klasse I-niveauet under normal brug, brugers vedligeholdelse eller de foreskrevne servicebetingelser.

Laserilmoitus

Tämä tulostin on sertifioitu Yhdysvalloissa DHHS 21 CFR, Chapter I, Subchapter J-standardin mukaiseksi luokan I (1) -lasertuotteeksi ja muualla IEC 60825-1 -standardin mukaiseksi luokan I lasertuotteeksi.

Luokan I lasertuotteita ei pidetä haitallisina. Tulostimen sisällä on luokan IIIb (3b) laser, joka on nimellisteholtaan 7 mW:n galliumarsenidilaser ja toimii 655–675 nanometrin aallonpituuksilla. Laserjärjestelmä ja tulostin ovat rakenteeltaan sellaisia, että käyttäjä ei joudu alttiiksi luokkaa 1 suuremmalle säteilylle normaalin käytön, ylläpidon tai huollon aikana.

Lasermeddelande

Skrivaren är certifierad i USA enligt kraven i DHHS 21 CFR, avsnitt I, underavsnitt J för laserprodukter av klass I (1) och i andra länder är den certifierad som en laserprodukt av klass I som uppfyller kraven i IEC 60825-1.

Laserprodukter av klass I anses inte vara skadliga. Skrivaren innehåller en klass IIIb (3b)-laser, vilket är en 7 mW galliumarseniklaser som arbetar inom en våglängd på 655–675 nm. Lasersystemet och skrivaren är utformade så att människor aldrig utsätts för laserstrålning över klass I-nivå under normala förhållanden vid användning, underhåll eller service.

Lasermerknad

Skriveren er sertifisert i USA for samsvar med kravene i DHHS 21 CFR, kapittel I, underkapittel J for laserprodukter av klasse I (1), og er andre steder sertifisert som et laserprodukt av klasse I som samsvarer med kravene i IEC 60825-1.

Laserprodukter av klasse I anses ikke som helseskadelige. Skriveren inneholder en intern laser av klasse IIIb (3b) som nominelt er en 7 milliwatt galliumarsenid-laser, og som opererer i bølgelengder på 655-675 nanometer. Lasersystemet og skriveren er utformet slik at mennesker ikke utsettes for laserstråling utover nivået i klasse I under normal drift, vedlikehold eller foreskrevet service.

Avís sobre el làser

Als EUA, la impressora està certificada de conformitat amb els requisits del capítol I, apartat J del CFR 21 del Departament de Salut i Serveis Humans per a productes làser de classe I (1) i a la resta de països està certificada com a producte làser de classe I d'acord amb els requisits de la norma IEC 60825-1.

Els productes làser de classe I no es consideren perillosos. A l'interior de la impressora hi ha un làser de classe IIIb (3b) que nominalment es un arsenur de galió de 7 mil·liwatts que funciona a una longitud d'ona de 655-675 nanòmetres. El sistema làser y la impressora s'han dissenyat amb l'objectiu d'impedir l'accés humà de la radiació làser superior al nivell de classe I durant un funcionament normal, el manteniment per part de l'usuari o les condicions de servei prescrites.

レーザーに関する通知

本機は、米国においてクラス I (1) レーザー製品に対する DHHS 21 CFR、Chapter I、Subchapter J の要件に準拠し、その他の国では IEC 60825-1 の要件に準拠するクラス I レーザー製品として認可されています。

クラス I レーザー製品は、危険性がないとみなされています。 本機には、クラス IIIb (3b) レーザーが内蔵されています。これは、655~675 ナノメートルの波長で動作する定格 7 ミリワットのガリウムヒ素レーザーです。 レーザーシステムとプリンタは、通常の操作、ユーザーによるメンテナンス、または所定のサービス条件の下で、ユーザーがクラス I レベルを超えるレーザー放射に絶対にさらされないように設計されています。

레이저 관련 공지

이 프린터는 미국에서 DHHS 21 CFR, Chapter I, Subchapter J의 요구 사항을 준수하는 클래스 I(1) 레이저 제품으로 승인되었으며 이외 지역에서 IEC 60825-1의 요구 사항을 준수하는 클래스 I 레이저 제품으로 승인되었습니다.

Class I 레이저 제품은 위험한 제품으로 간주되지 않습니다. 프린터에는 655-675 나노미터의 파장 영역에서 작동하는 공칭 7밀리와트 갈륨 비소 레이저인 클래스 IIIb(3b) 레이저가 내부에 포함되어 있습니다. 레이저 시스템과 프린터는 정상적인 작동, 사용자 유지 관리 또는 사전 설명된 서비스 조건에는 사람에게 클래스 I 수준 이상의 레이저 방사가 노출되지 않도록 설계되었습니다.

激光注意事项

本打印机在美国认证合乎 DHHS 21 CFR Chapter I, Subchapter J 对分类 I (1) 激光产品的标准,而在其他地区则被认证是合乎 IEC 60825-1 的分类 I 激光产品。

一般**认为**分类 I 激光产品不具有危险性。本打印机内部含有分类 IIIb(3b)的激光,在操作过程中会产生额定 7 毫瓦的砷化镓激光,其波长范围在 655-675nm 之间。本激光系统及打印机的设计,在一般操作、使用者维护或规定内的维修情况下,不会使人体接触分类 I 以上等级的辐射。

雷射聲明

本印表機係經過美國核可,符合 DHHS 21 CFR, Chapter I, Subchapter J 規定的 I (1) 級雷射產品激光注意事项;在美國以外的地區,為符合 IEC 60825-1 規定的 I 級雷射產品。

根據 I 級雷射產品的規定,這類產品不會對人體造成傷害。本機所採用之 IIIb (3b) 級雷射只會產生 7 百萬分之一瓦特 (milliwatt)、波長 655 至 675 億分之一米 (nanometer) 的鎵砷放射線 (gallium arsenide laser)。使用者只要以正確的方法操作及維護保養,並依照先前所述之維修方式進行修護,此印表機與其雷射系統絕不會產生 I 級以上的放射線,而對人體造成傷害。

Safety information

Safety information

- The safety of this product is based on testing and approvals of the original design and specific components. The manufacturer is not responsible for safety in the event of use of unauthorized replacement parts.
- The maintenance information for this product has been prepared for use by a professional service person and is not intended to be used by others.
- There may be an increased risk of electric shock and personal injury during disassembly and servicing of this product. Professional service personnel should understand this and take necessary precautions.



CAUTION—POTENTIAL INJURY

The lithium battery in this product is not intended to be replaced. There is a danger of explosion if a lithium battery is incorrectly replaced. Do not recharge, disassemble, or incinerate a lithium battery. Discard used lithium batteries according to the manufacturer's instructions and local regulations.

Consignes de sécurité

- La sécurité de ce produit repose sur des tests et des agréations portant sur sa conception d'origine et sur des composants particuliers. Le fabricant n'assume aucune responsabilité concernant la sécurité en cas d'utilisation de pièces de rechange non agréées.
- Les consignes d'entretien et de réparation de ce produit s'adressent uniquement à un personnel de maintenance qualifié.
- Le démontage et l'entretien de ce produit pouvant présenter certains risques électriques, le personnel d'entretien qualifié devra prendre toutes les précautions nécessaires.

AVERTISSEMENT—RISQUE DE BLESSURE



La batterie lithium de ce produit n'est pas destinée à être remplacée. Il existe un risque d'explosion si une batterie lithium est placée de façon incorrecte. Ne rechargez pas, ne démontez pas et n'incinérez pas une batterie lithium. Mettez les batteries lithium usagées au rebut selon les instructions du fabricant et les réglementations locales.

Norme di sicurezza

- La sicurezza del prodotto si basa sui test e sull'approvazione del progetto originale e dei componenti specifici. Il produttore non è responsabile per la sicurezza in caso di sostituzione non autorizzata delle parti.
- Le informazioni riguardanti la manutenzione di questo prodotto sono indirizzate soltanto al personale di assistenza autorizzato.
- Durante lo smontaggio e la manutenzione di questo prodotto, il rischio di subire scosse elettriche e danni alla persona è più elevato. Il personale di assistenza autorizzato deve, quindi, adottare le precauzioni necessarie.



ATTENZIONE — PERICOLO DI LESIONI

La batteria al litio presente del prodotto non deve essere sostituita. In caso di sostituzione errata della batteria al litio, potrebbe verificarsi un'esplosione. Non ricaricare, smontare o bruciare batterie al litio. Smaltire le batterie al litio usate seguendo le istruzioni del produttore e le norme locali.

Sicherheitshinweise

- Die Sicherheit dieses Produkts basiert auf Tests und Zulassungen des ursprünglichen Modells und bestimmter Bauteile. Bei Verwendung nicht genehmigter Ersatzteile wird vom Hersteller keine Verantwortung oder Haftung für die Sicherheit übernommen.
- Die Wartungsinformationen für dieses Produkt sind ausschließlich für die Verwendung durch einen Wartungsfachmann bestimmt.
- Während des Auseinandernehmens und der Wartung des Geräts besteht ein zusätzliches Risiko eines elektrischen Schlags und körperlicher Verletzung. Das zuständige Fachpersonal sollte entsprechende Vorsichtsmaßnahmen treffen.

VORSICHT - VERLETZUNGSGEFAHR



Die Lithiumbatterie in diesem Produkt darf nicht ausgetauscht werden. Wird eine Lithiumbatterie nicht ordnungsgemäß ausgetauscht, besteht Explosionsgefahr. Lithiumbatterien dürfen auf keinen Fall wieder aufgeladen, auseinander genommen oder verbrannt werden. Befolgen Sie zum Entsorgen verbrauchter Lithiumbatterien die Anweisungen des Herstellers und die örtlichen Bestimmungen.

Pautas de Seguridad

- La seguridad de este producto se basa en pruebas y aprobaciones del diseño original y componentes específicos. El fabricante no es responsable de la seguridad en caso de uso de piezas de repuesto no autorizadas.
- La información sobre el mantenimiento de este producto está dirigida exclusivamente al personal cualificado de mantenimiento.
- Existe mayor riesgo de descarga eléctrica y de daños personales durante el desmontaje y la reparación de la máquina. El personal cualificado debe ser consciente de este peligro y tomar las precauciones necesarias.



PRECAUCIÓN: POSIBLES DAÑOS PERSONALES

La batería de litio de este producto no debe reemplazarse. Existe riesgo de explosión si se sustituye incorrectamente una batería de litio. No recargue, desmonte ni incinere una batería de litio. Deseche las baterías de litio según las instrucciones del fabricante y las normativas locales.

Informações de Segurança

- A segurança deste produto baseia-se em testes e aprovações do modelo original e de componentes específicos. O fabricante não é responsável pela segunrança, no caso de uso de peças de substituição não autorizadas.
- As informações de segurança relativas a este produto destinam-se a profissionais destes serviços e não devem ser utilizadas por outras pessoas.
- Risco de choques eléctricos e ferimentos graves durante a desmontagem e manutenção deste produto. Os profissionais destes serviços devem estar avisados deste facto e tomar os cuidados necessários.



ATENÇÃO — RISCO DE FERIMENTO

A bateria de lítio neste produto não deve ser substituída. Existe o risco de explosão se uma bateria de lítio for substituída incorretamente. Não recarregue, desmonte ou incinere uma bateria de lítio. Descarte as baterias de lítio usadas de acordo com as instruções do fabricante e regulamentos locais.

Informació de Seguretat

- La seguretat d'aquest producte es basa en l'avaluació i aprovació del disseny original i els components específics. El fabricant no es fa responsable de les qüestions de seguretat si s'utilitzen peces de recanvi no autoritzades.
- La informació pel manteniment d'aquest producte està orientada exclusivament a professionals i no està destinada a ningú que no ho sigui.
- El risc de xoc elèctric i de danys personals pot augmentar durant el procés de desmuntatge i de servei d'aquest producte. El personal professional ha d'estar-ne assabentat i prendre les mesures convenients.



ATENCIÓ

La bateria de liti d'aquest producte no ha estat dissenyada perquè es substitueixi. Hi ha perill d'explosió si no es substitueix correctament la bateria de liti. No recarregueu, desmunteu o incinereu una bateria de liti. Desfeu-vos de les bateries de liti usades d'acord amb les instruccions del fabricant i les regulacions locals.

안전 사항

- 본 제품은 원래 설계및특정 구성에 대한 테스트 결과로 안정 성이 입증된 것입니다. 따라서 무허가 교체부품을 사용하는 경 우 에는 제조업체에서 안전에 대한 책임을 지지 않습니다.
- 본 제품에 관한 유지 보수 설명 서는 전문 서비스 기술자 용으로 작성된 것이므로, 비 전문가는 사용할 수 없습니다.
- 본 제품을 해체하거나 정비할 경우, 전 기전 인 충 경 을 받거나 상 처를 입을 위험이 커집니다. 전문 서비스 기술자는 이 사실을 숙지하고, 필요한 예방조치를 취하도록 하십시오.



주의 _ 부상 위험

이 제품에 들어 있는 리튬 배터리는 교체할 수 없습니다. 리튬 배터리를 잘못 교체하면 폭발할 위험이 있습니다. 리튬 배터리를 재충전하거나, 분해하거나, 태우지 마십시오. 제조업체의 지침과 지역규정에 따라 다 쓴 리튬 배터리를 폐기하십시오.

安全信息

- 本**产**品的安全性以原来**设计**和特定**产**品的**测试结**果和**认证为基础**。万一使用来**经许**可的替**换**部件,制造商不**对**安全性**负责**。
- 本产品的维护信息**仅**供专业服务人员使用,并不打算证其他人使用。
- 本**产**品在拆卸、**维修时**,遭受**电击**或人**员**受**伤**的危**险**性会增高,**专业**服**务**人**员对这**点必**须**有所了触,并采取必要的**预**防措施。



当心一可能的伤害:

本产品中的**锂电**池不可更**换**。如果不正确更**换锂电**池,可能会有爆炸危**险**。不要再 充电、拆解或 焚烧锂电池。丢弃旧的锂电池时应按照制造商的指导及当地法规进行处理。

Service conventions and change history

Change history

September 30, 2019

• Removed 40X8527 in the topic "Miscellaneous" in the "Parts catalog" chapter.

July 1, 2019

- Changed the machine type/ model number of the Bolt model MS617dn to 4514-635
- Updated the description of the affected part numbers regarding missing Bolt models.
 - Added MS517dn to the following parts:
 - Rear door and cover (40X8054)
 - Right cover (40X8052)
 - Front access cover (40X8056)
 - Nameplate (40X8051)
 - Left cover (40X8053)
 - Top cover (40X8055)
 - Galvo LSU (40X8080)
 - Cooling fan (40X8276)
 - Controller board(41X0366)
 - Controller board(40X8029)
 - Control panel assembly (40X8292)
 - Redrive assembly (40X8298)
 - Maintenance kit, 100 V (40X8439)
 - Maintenance kit, 110 V (40X8281)
 - Maintenance kit, 200 V (40X8282)
 - Forms and Barcode Card (41X0855)
 - Forms and Barcode + Simplified Chinese Font (41X0857)
 - Forms and Barcode + Japanese Font (41X0859)
 - Prescribe Card (41X0840)
 - IPDS card (41X0838)
 - Relocation kit (40X8695)
 - Added MS617dn to the following parts:
 - Rear door and cover (40X8270)
 - Right cover (40X8087)
 - Front access cover (40X8056)
 - Nameplate (41X0005)
 - Left cover (40X8269)
 - Top cover (40X8271)
 - Galvo LSU (40X8079)

- Cooling fan (40X8276)
- Controller board (41X0367)
- Controller board (40X8030)
- Control panel assembly (40X8284)
- Redrive assembly (40X8437)
- Maintenance kit, 100 V (40X8440)
- Maintenance kit, 110 V (40X8433)
- Maintenance kit, 220 V (40X8435)
- Forms and Barcode Card (41X0855)
- Forms and Barcode + Simplified Chinese Font (41X0857)
- Forms and Barcode + Japanese Font (41X0859)
- Prescribe Card (41X0840)
- IPDS card (41X0838)
- Relocation kit (40X8696)

April 5, 2019

- MarkNet Wireless Print Server FRU PN was changed from 40X8330 to 40X9939.
- Critical information for controller board or control panel replacement was added.
 - Controller board removal was updated.
 - Control panel assembly removal was updated.
 - UICC removal was updated.

July 12, 2018

- For Performing the initial troubleshooting check, relative humidity values were updated (now 8 to 80%).
- A note for ambient temperature and relative humidity information was added to the Fuser service check.

April 27, 2018

- Updated the 24x error code tables in the Diagnostics and troubleshooting chapter.
- Updated the 24x.06 service check topic in the Diagnostics and troubleshooting chapter.

March 9, 2018

Updated the Main drive gearbox service check under the Diagnostics and troubleshooting chapter.

December 19, 2017

- Updated the graphic for PN 40X9131 to include the MPF links in the assembly.
- Added PN 41X2300 for the access cover link under the Covers assembly in the Parts Catalog chapter.
- Added PN 40X9939 under Miscellaneous in the Parts Catalog chapter.

August 23, 2017

- Updated "Blank pages check" on page 43.
- Updated "Solid black pages check" on page 49.

May 31, 2017

• Updated 40X4827 to 40X9652 in the topic "Miscellaneous" in the "Parts catalog" chapter.

May 24, 2017

• Updated the "912 error messages" topic of the "912 errors" subgroup of the "Printer hardware errors" group of the "Diagnostics and troubleshooting" chapter.

May 16, 2017

Updated the entire group, <u>"Fixing print quality issues" on page 40</u>, which includes replacement of the
existing print quality icons with actual print defect outputs. Contents from the Service Manuals, KB and UG
articles are merged to come up with the new PQ checks.

April 24, 2017

- Added "MS517dn" and "MS617dn" in the cover.
- Added "MS517dn" and "MS617dn" in the introduction to the "General information" chapter.
- Added 41X2013 and 41X2017 to the revised topic "Control panel" in the "Parts catalog" chapter.

December 9, 2016

- Revised a graphic in the "Printhead assembly adjustments" topic in the "Repair information" chapter.
- Revised the "Laser scanning unit (LSU) removal" topic in the "Repair information" chapter.
- Added 41X1025 to the "Electronics 2" topic in the "Parts catalog" chapter.

November 21, 2016

• Changed 41X0005 to 40X8051 in the topic "Covers" in the "Parts catalog" chapter.

October 21, 2016

• Updated the topics "Unresponsive imaging unit service check" and "Blank pages check" in the "Diagnostic information" chapter.

September 30, 2016

• Deleted the first two steps of the "Blank pages check" topic in the "Fixing print quality issues" group in the "Diagnostic information" chapter.

August 17, 2016

- Moved topics on clearing jams under the topic "Understanding jam messages and locations" in the "Diagnostic information" chapter.
- Updated the topic "Unresponsive imaging unit service check" in the "Diagnostic information" chapter.
- Updated the topic "Miscellaneous" in the "Parts catalog" chapter.
 - Changed 40X8603 to 41X0855.
 - Changed 40X8606 to 41X0856.
 - Changed 40X8836 to 41X0857.
 - Changed 40X8837 to 41X0859.
 - Changed 40X8605 to 41X0840.

- Changed 40X8608 to 41X0860.
- Changed 40X8607 to 41X0858.

July 14, 2016

Added the separator roll assembly in the "Covers" topic in the "Parts catalog" chapter.

June 2, 2016

- Updated the "Miscellaneous" topic in the "Parts catalog" chapter.
 - Updated the description for 40X8526.
 - Added 41X0568.
- Updated the graphic of the "Electronics 2" topic in the "Parts catalog" chapter.

March 23, 2016

- Revised the topic "Covers" in the "Parts catalog" chapter.
- Revised the following topics in the "Diagnostic information" chapter:
 - Performing the initial troubleshooting check
 - Initial print quality check
 - User attendance messages (0-99.99)
 - Imaging unit smart chip contact service check
 - Toner smart chip compatibility service check
 - Imaging chip compatibility service check
 - Toner starvation service check
 - Unresponsive imaging unit service check (formerly "CTLS service check")
 - Unresponsive toner cartridge service check (formerly "Toner cartridge smart chip contact service check")
- Created the following topics in the "Diagnostic information" chapter:
 - Printer cartridge mismatch service check
 - Unsupported toner cartridge service check
 - Unsupported imaging unit service check
 - Supplies mismatch service check

February 18, 2016

• Added the topic "Enabling the security reset jumper" in "Appendix A: Printer specifications" chapter.

February 10, 2016

• Removed 41X0003 in the topic "Electronics 2" in the "Parts catalog" chapter.

January 26, 2016

• Added 41X0988 in the topic "Electronics 1" in the "Parts catalog" chapter.

December 1, 2015

• Updated the topic "Toner density sensor removal" in the "Bottom removals" group in the "Repair information" chapter to add installation notes.

October 29, 2015

• Updated the topic "Option trays" in the "Parts catalog" chapter to revise its art.

August 19, 2015

- Replaced the part number for pick tires and ACM pick roll from 40X8297 to 41X0958.
- Replaced the part number for the ACM assembly (standard tray only) from 40X8261 to 41X0959.
- Updated <u>"Laser scanning unit (LSU) removal" on page 313</u> to add a note regarding the sequence of tightening the screws when reinstalling the polygon LSU.

August 7, 2015

• Updated <u>"Electronics 1" on page 335</u> to add video cable with part number 41X0913, which is applicable only to models with galvo LSU. Also added a description for PN 41X0362.

July 28, 2015

• Updated the wiring diagrams.

June 8, 2015

• Updated the parts catalog graphic (Assembly 1: Covers) and table to remove the control panels and their corresponding part numbers.

May 13, 2015

- Updated <u>"200 paper jam messages" on page 90</u> to add error codes specific to polygon laser scanning unit (LSU).
- Updated <u>"111 error messages" on page 133</u> to add error messages specific to polygon LSU. Added notes to identify the type of LSU (polygon or galvo) and controller board the printer supports.
- Updated <u>"Laser scanning unit (LSU) service check" on page 135</u> to include other ways to resolve LSUrelated issues. Added notes to identify the type of LSU (polygon or galvo) and controller board the printer supports.
- Updated <u>"Laser scanning unit (LSU) removal" on page 313</u> to add information on how to identify the type of LSU (polygon or galvo) and controller board the printer supports.
- Updated <u>"Electronics 1" on page 335</u> to specify whether the LSU that the printer supports is a polygon or galvo. Added in the table these two FRUs: Polygon LSU frame (PN 41X0363) and Polygon LSU cable (41X0759).

April 23, 2015

- Updated the 97y error code table and created <u>"Network port error service check" on page 158</u> for the 97y error codes.
- Updated the 98y error code table and created "Option communication error service check" on page 159 for the 98y error codes.
- Updated the 99y error code table and created "Option communication error service check" on page 159 for the 99y error codes.

March 19, 2015

- 40X8305 FRU was renamed to '250-sheet tray insert'
- 40X8261 FRU was renamed to 'ACM assembly (standard tray only)'

40X8262 FRU was renamed to 'ACM assembly (option tray only)'

December 4, 2014

• Updated the LSU removal procedure.

November 12, 2014

• Parts catalog Covers assembly—Added part number 41X0239.

October 9, 2014

• Updated the illustration of Electronics 2 parts catalog assembly to show the correct toner cartridge smart chip contact.

September 22, 2014

Replaced part number 40X8274 with 40X9181.

August 15, 2014

Updated the following service checks:

- Toner cartridge smart chip contact service check
- Cartridge gearbox service check
- Toner starvation service check
- LSU service check
- Tray 1 jam service check

July 2, 2014

 Parts catalog frame assembly illustration—Removed the spring from 40X8295, and removed the cable from 40X8083.

June 10, 2014

Parts catalog—Added Latin America power supply part number 41X0003.

May 23, 2014

• Added part number 40X0289 to the power cords parts catalog assembly.

April 3, 2014

- Added part number 41X0005 to Assembly 1 of the Parts catalog.
- Updated the description of part number 40X8051 in Assembly 1 of the Parts catalog.

March 3, 2014

- Added the Restoring solutions, licenses, and configuration settings topic under Removal precautions.
- Updated the Restoring the printer configuration after replacing the controller board topic.
- Changed the title from eSF backup to Backing up eSF solutions and settings, and updated the topic.
- Updated the Controller board removal topic.

January 15, 2013

- Removed the Updating the printer firmware topic from the Service menus chapter.
- Added Updating the printer firmware section to the Repair information chapter.
- Updated the Service menu options to reflect firmware changes.

December 9, 2013

- Added the redrive shaft removal procedure in the Repair information chapter.
- Added PN 40X8850 in Assembly 4: Frame for the redrive shaft.
- Updated the error code mapping for the paper jams.

October 22, 2013

- Added part number 40X9654.
- Deleted part numbers 40X8525 and 40X8526.

September 19, 2013

• Added part number 40X9651.

August 13, 2013

- Added "Restoring the printer configuration after replacing the controller board" under Removal precautions.
- Controller board removal procedure linked to above item.
- Added 201.20, 201.21, and 201.22 error codes.
- Updated Cartridge gearbox service check.

General information

The LexmarkTM MS510, MS610, M1145, and M3150 are network-capable, multi-function laser printers that print monochrome print jobs. All information in this service manual pertains to all models unless explicitly noted.

The printers are available in the following models:

Model	Configurations	Machine type / model
MS510dn	Network 10/100, Duplex printer	4514-630
MS517dn		
MS610dn	Network (Gigabit), Duplex printer	4514-635
MS617dn		
MS610dtn	Network (Gigabit), Duplex printer with additional 550-sheet tray	4514-635
MS610de	Network (Gigabit), e-Task, Duplex printer	4514-646
MS610dte	Network (Gigabit), e-Task, Duplex printer with additional 550-sheet tray	4514-646
M1145	Network 10/100, Duplex printer	4514-639
M3150dn	Network (Gigabit), Duplex printer	4514-638
M3150	Network (Gigabit), e-Task, Duplex printer	4514-649

The diagnostic information in this manual leads you to the correct field replaceable unit (FRU) or part. Use the error code charts, symptom index, and service checks to determine the symptom and then repair the failure. After you complete the repair, perform tests as needed to verify the repair.

To begin diagnosing a problem, go to <u>"Diagnostics and troubleshooting" on page 39</u>. See <u>"Parts removal"</u> <u>on page 201</u> for information about removing and reinstalling parts. See <u>"Parts catalog" on page 330</u> to help identify parts.

Media guidelines

Paper guidelines

Selecting the correct paper or specialty media reduces printing problems. For the best print quality, try a sample of the paper or specialty media before buying large quantities.

Paper characteristics

The following paper characteristics affect print quality and reliability. Consider these characteristics when evaluating new paper stock.

Weight

The printer trays can automatically feed paper weights up to 120-g/m^2 (32-lb) bond grain long paper. The multipurpose feeder can automatically feed paper weights up to 163-g/m^2 (43-lb) bond grain long paper. Paper lighter than 60 g/m^2 (16 lb) might not be stiff enough to feed properly, causing jams. For best performance, use 75-g/m^2 (20-lb) bond grain long paper. For paper smaller than $182 \times 257\text{ mm}$ (7.2 x 10.1 inches), we recommended to use 90 g/m^2 (24 lb) or heavier paper.

Note: Two-sided printing is supported only for 60–90-g/m² (16–24-lb) bond paper.

Curl

Curl is the tendency for paper to curl at its edges. Excessive curl can cause paper feeding problems. Curl can occur after the paper passes through the printer, where it is exposed to high temperatures. Storing paper unwrapped in hot, humid, cold, or dry conditions, even in the trays, can contribute to paper curling prior to printing and can cause feeding problems.

Smoothness

Paper smoothness directly affects print quality. If paper is too rough, then toner cannot fuse to it properly. If paper is too smooth, then it can cause paper feeding or print quality issues. Always use paper between 100 and 300 Sheffield points; however, smoothness between 150 and 250 Sheffield points produces the best print quality.

Moisture content

The amount of moisture in paper affects both print quality and the ability of the printer to feed the paper correctly. Leave paper in its original wrapper until it is time to use it. This limits the exposure of paper to moisture changes that can degrade its performance.

Store paper in its original wrapper in the same environment as the printer for 24 to 48 hours before printing. Extend the time to several days if the storage or transportation environment is very different from the printer environment. Thick paper may also require a longer conditioning period.

Grain direction

Grain refers to the alignment of the paper fibers in a sheet of paper. Grain is either *grain long*, running the length of the paper, or *grain short*, running the width of the paper.

For $60-90-g/m^2$ (16-24-lb) bond paper, grain long paper is recommended.

Fiber content

Most high-quality xerographic paper is made from 100% chemically treated pulped wood. This content provides the paper with a high degree of stability resulting in fewer paper feeding problems and better print quality. Paper containing fibers such as cotton can negatively affect paper handling.

Unacceptable paper

The following paper types are not recommended for use with the printer:

- Chemically treated papers used to make copies without carbon paper, also known as carbonless papers, carbonless copy paper (CCP), or no carbon required (NCR) paper
- Preprinted papers with chemicals that may contaminate the printer
- Preprinted papers that can be affected by the temperature in the printer fuser

• Preprinted papers that require a registration (the precise print location on the page) greater or lesser than +/-2.5 mm (+/-0.10 inch), such as optical character recognition (OCR) forms

In some cases, registration can be adjusted with a software application to successfully print on these forms:

- Coated papers (erasable bond), synthetic papers, thermal papers
- Rough-edged, rough or heavily textured surface papers, or curled papers
- Recycled papers that fail EN12281:2002 (European)
- Paper weighing less than 60 g/m² (16 lb)
- Multiple-part forms or documents

Selecting paper

Using the appropriate paper prevents jams and helps ensure trouble-free printing.

To help avoid paper jams and poor print quality:

- Always use new, undamaged paper.
- Before loading paper, know the recommended printable side of the paper. This information is usually indicated on the paper package.
- Do not use paper that has been cut or trimmed by hand.
- Do not mix paper sizes, types, or weights in the same tray; mixing results in jams.
- Do not use coated papers unless they are specifically designed for electrophotographic printing.

Selecting preprinted forms and letterhead

Use these guidelines when selecting preprinted forms and letterhead:

- Use grain long for 60 to 90 g/m² (16 to 24 lb) weight paper.
- Use only forms and letterhead printed using an offset lithographic or engraved printing process.
- Avoid papers with rough or heavily textured surfaces.

Use papers printed with heat-resistant inks designed for use in xerographic copiers. The ink must be able to withstand temperatures up to 230°C (446°F) without melting or releasing hazardous emissions. Use inks that are not affected by the resin in toner. Inks that are oxidation-set or oil-based generally meet these requirements; latex inks might not. When in doubt, contact the paper supplier.

Preprinted papers such as letterhead must be able to withstand temperatures up to 230°C (446°F) without melting or releasing hazardous emissions.

Storing paper

Use these paper storage guidelines to help avoid jams and uneven print quality:

- For best results, store paper where the temperature is 21°C (70°F) and the relative humidity is 40 percent. Most label manufacturers recommend printing in a temperature range of 18–24°C (65–75°F) with relative humidity between 40 and 60 percent.
- Store paper in cartons, on a pallet or shelf, rather than on the floor.
- Store individual packages on a flat surface.
- Do not store anything on top of individual paper packages.
- Take paper out of the carton or wrapper only when you are ready to load it in the printer. The carton and wrapper help keep the paper clean, dry, and flat.

Using recycled paper and other office papers

As an environmentally conscious company, Lexmark supports the use of recycled office paper produced specifically for use in laser (electrophotographic) printers. In 1998, Lexmark presented to the US government a study demonstrating that recycled paper produced by major mills in the US fed as well as non-recycled paper. However, no blanket statement can be made that *all* recycled paper will feed well.

Lexmark consistently tests its printers with recycled paper (20–100% post-consumer waste) and a variety of test paper from around the world, using chamber tests for different temperature and humidity conditions. Lexmark has found no reason to discourage the use of today's recycled office papers, but generally the following property guidelines apply to recycled paper.

- Low moisture content (4–5%)
- Suitable smoothness (100-200 Sheffield units, or 140-350 Bendtsen units, European)

Note: Some much smoother papers (such as premium 24 lb laser papers, 50–90 Sheffield units) and much rougher papers (such as premium cotton papers, 200–300 Sheffield units) have been engineered to work very well in laser printers, despite surface texture. Before using these types of paper, consult your paper supplier.

- Suitable sheet-to-sheet coefficient of friction (0.4-0.6)
- Sufficient bending resistance in the direction of feed

Recycled paper, paper of lower weight (<60 g/m² [16 lb bond]) and/or lower caliper (<3.8 mils [0.1 mm]), and paper that is cut grain-short for portrait (or short-edge) fed printers may have lower bending resistance than is required for reliable paper feeding. Before using these types of paper for laser (electrophotographic) printing, consult your paper supplier. Remember that these are general guidelines only and that paper meeting these guidelines may still cause paper feeding problems in any laser printer (for example, if the paper curls excessively under normal printing conditions).

Using specialty media

Tips on using card stock

Card stock is heavy, single-ply specialty media. Many of its variable characteristics, such as moisture content, thickness, and texture, can significantly impact print quality. Print samples on the card stock being considered for use before buying large quantities.

When printing on card stock:

- Make sure the Paper Type is Card Stock.
- Select the appropriate Paper Texture setting.
- Be aware that preprinting, perforation, and creasing may significantly affect the print quality and cause jams or other paper handling problems.
- Check with the manufacturer or vendor to ensure that the card stock can withstand temperatures up to 240°C (464°F) without releasing hazardous emissions.
- Do not use preprinted card stock manufactured with chemicals that may contaminate the printer. Preprinting introduces semi-liquid and volatile components into the printer.
- Use grain short card stock when possible.

Tips on using envelopes

Print samples on the envelopes being considered for use before buying large quantities.

- Use envelopes designed specifically for laser printers. Check with the manufacturer or vendor to ensure that the envelopes can withstand temperatures up to 230°C (446°F) without sealing, wrinkling, curling excessively, or releasing hazardous emissions.
- For best performance, use envelopes made from 90-g/m² (24-lb bond) paper or 25% cotton. All-cotton envelopes must not exceed 70-g/m² (20-lb bond) weight.
- Use only new envelopes from undamaged packages.
- To optimize performance and minimize jams, do not use envelopes that:
 - Have excessive curl or twist
 - Are stuck together or damaged in any way
 - Have windows, holes, perforations, cutouts, or embossing
 - Have metal clasps, string ties, or folding bars
 - Have an interlocking design
 - Have postage stamps attached
 - Have any exposed adhesive when the flap is in the sealed or closed position
 - Have bent corners
 - Have rough, cockle, or laid finishes
- Adjust the width guides to fit the width of the envelopes.

Note: A combination of high humidity (over 60%) and high printing temperature may wrinkle or seal envelopes.

Tips on using labels

Print samples on the labels being considered for use before buying large quantities.

Note: Use only paper label sheets. Vinyl, pharmacy, and two-sided labels are not supported.

For more information on label printing, characteristics, and design, see the *Card Stock & Label Guide* available at **http://support.lexmark.com**.

When printing on labels:

- Use labels designed specifically for laser printers. Check with the manufacturer or vendor to verify that:
 - The labels can withstand temperatures up to 240°C (464°F) without sealing, excessive curling, wrinkling, or releasing hazardous emissions.
 - Label adhesives, face sheet (printable stock), and topcoats can withstand up to 172-kPa (25-psi) pressure without delaminating, oozing around the edges, or releasing hazardous fumes.
- Do not use labels with slick backing material.
- Use full label sheets. Partial sheets may cause labels to peel off during printing, resulting in a jam. Partial sheets also contaminate the printer and the cartridge with adhesive, and could void the printer and toner cartridge warranties.
- Do not use labels with exposed adhesive.
- Do not print within 1 mm (0.04 inch) of the edge of the label, of the perforations, or between die-cuts of the label.

- Make sure the adhesive backing does not reach to the edge of the sheet. Zone coating of the adhesive should be at least 1 mm (0.04 inch) away from edges. Adhesive material contaminates the printer and could void the warranty.
- If zone coating of the adhesive is not possible, then remove a 2-mm (0.08-inch) strip on the leading and driver edge, and then use a non-oozing adhesive.
- Portrait orientation is recommended, especially when printing bar codes.

Tips on using transparencies

- Print a test page on the transparencies being considered for use before buying large quantities.
- Feed transparencies from the standard tray, or the multipurpose feeder.
- Use transparencies designed specifically for laser printers. Transparencies must be able to withstand temperatures up to 185°C (365°F) without melting, discoloring, offsetting, or releasing hazardous emissions.

Note: If the transparency weight is set to Heavy and the transparency texture is set to Rough in the Paper menu, then transparencies can be printed at a temperature up to 195°C (383°F).

- Avoid getting fingerprints on the transparencies to prevent print quality problems.
- Before loading transparencies, flex, fan, and straighten the stack to prevent sheets from sticking together.

Supported paper sizes, types, and weights

Supported paper sizes

Note: For an unlisted paper size, select the closest *larger* listed size. For information on card stock and labels, see the *Card Stock & Label Guide*.

Paper size	Standard tray	Optional 250- or 550-sheet tray	Multipurpose feeder	Duplex mode
A4 210 x 297 mm (8.3 x 11.7 in.)	✓	✓	✓	\
A5 148 x 210 mm (5.8 x 8.3 in.)	✓	√	√	х
A6 105 x 148 mm (4.1 x 5.8 in.)	✓	x	√	x
JIS B5 182 x 257 mm (7.2 x 10.1 in.)	✓	√	√	х
Letter 216 x 279 mm (8.5 x 11 in.)	✓	√	√	✓

 $^{^{1}}$ This size setting formats the page for 216 x 356 mm (8.5 x 14 in.) unless the size is specified by the software application.

 $^{^2}$ Universal is supported only in the standard tray if the paper size is at least 105 x 148 mm (4.1 x 5.8 in.). Universal is supported only in the optional 250- or 550-sheet tray if the paper size is at least 148 x 210 mm (5.8 x 8.3 in.). Universal is only supported in duplex mode if the width is at least 210 mm (8.3 in.) and length is at least 279 mm (11 in.). The smallest supported Universal size is only supported in the multipurpose feeder.

Paper size	Standard tray	Optional 250- or 550-sheet tray	Multipurpose feeder	Duplex mode
Legal 216 x 356 mm (8.5 x 14 in.)	√	✓	✓	✓
Executive 184 x 267 mm (7.3 x 10.5 in.)	✓	✓	✓	x
Oficio (Mexico) ¹ 216 x 340 mm (8.5 x 13.4 in.)	✓	✓	✓	✓
Folio 216 x 330 mm (8.5 x 13 in.)	√	√	✓	✓
Statement 140 x 216 mm (5.5 x 8.5 in.)	√	√	✓	x
Universal ² 76.2 x 127 mm (3 x 5 in.) up to 216 x 356 mm (8.5 x 14 in.)	√	✓	✓	√
7 3/4 Envelope (Monarch) 98 x 191 mm (3.9 x 7.5 in.)	х	х	✓	х
9 Envelope 98 x 225 mm (3.9 x 8.9 in.)	х	х	✓	x
10 Envelope 105 x 241 mm (4.1 x 9.5 in.)	х	х	✓	x
DL Envelope 110 x 220 mm (4.3 x 8.7 in.)	х	х	✓	x
C5 Envelope 162 x 229 mm (6.4 x 9 in.)	х	х	✓	×
B5 Envelope 176 x 250 mm (6.9 x 9.8 in.)	x	х	✓	×
Other Envelope 229 x 356 mm (9 x 14 in.)	х	х	✓	X

 $^{^{1}}$ This size setting formats the page for 216 x 356 mm (8.5 x 14 in.) unless the size is specified by the software application.

Supported paper types and weights

The standard tray supports $60-90-g/m^2$ (16-24-lb) paper weights. The optional tray supports $60-120-g/m^2$ (16-32-lb) paper weights. The multipurpose feeder supports $60-163-g/m^2$ (16-43-lb) paper weights.

 $^{^2}$ Universal is supported only in the standard tray if the paper size is at least 105 x 148 mm (4.1 x 5.8 in.). Universal is supported only in the optional 250- or 550-sheet tray if the paper size is at least 148 x 210 mm (5.8 x 8.3 in.). Universal is only supported in duplex mode if the width is at least 210 mm (8.3 in.) and length is at least 279 mm (11 in.). The smallest supported Universal size is only supported in the multipurpose feeder.

Paper type	250- or 550-sheet tray	Multipurpose feeder	Duplex mode
Plain paper	✓	✓	✓
Card stock	х	✓	x
Transparencies	√	/	x
Recycled	√	✓	√
Glossy paper	x	х	х
Paper labels ¹	√	✓	х
Vinyl labels	x	х	x
Bond ²	√	✓	√
Envelope	х	✓	x
Rough envelope	х	/	x
Letterhead	✓	✓	√
Preprinted	✓	✓	√
Colored Paper	√	✓	✓
Light Paper	✓	✓	✓
Heavy Paper ²	✓	✓	✓
Rough/Cotton	✓	✓	х

¹ One-sided paper labels designed for laser printers are supported for occasional use. It is recommended to print 20 or fewer pages of paper labels per month. Vinyl, pharmacy, and two-sided labels are not supported.

Data security notice

1 The printer contains various types of memory that store printer and network settings, information from embedded solutions, and user data.

The following are the types of memory and data that they store.

- **Volatile memory**—The printer uses standard random access memory (RAM) to buffer user data temporarily during simple print and copy jobs.
- **Non-volatile memory**—The printer may use two forms of non-volatile memory: EEPROM and NAND (flash memory). Both types are used to store the operating system, printer settings, network information, scanner and bookmark settings, and embedded solutions.

² Bond and Heavy Paper are supported in duplex mode up to 90-g/m² (24-lb) paper weight.

• Hard disk memory—The printer hard disk is designed for printer-specific functionality and cannot be used for the long-term storage of data that is not print-related. The hard disk can retain buffered user data from complex print jobs, form data, and font data.

To erase volatile memory, turn off the printer.

To erase the non-volatile and printer hard disk memory, see "Configuration menu" on page 190.

The following parts are capable of storing memory:

- Printer control panel
- User interface controller card (UICC)
- Controller board
- Optional hard disk

Note: The control panel and controller board contain NVRAM.

2 After removing the old part, return it to your next level of support.

Tools required for service

- Flat-blade screwdrivers, various sizes
- #0 Phillips screwdriver, magnetic
- #1 Phillips screwdriver, magnetic
- #2 Phillips screwdriver, magnetic
- #2 Phillips screwdriver, magnetic short-blade
- Needle-nose pliers
- Diagonal side cutters
- Spring hook
- · Feeler gauges
- Analog or digital multimeter
- Flashlight (optional)

Diagnostics and troubleshooting



CAUTION—SHOCK HAZARD: For personal safety and to prevent damage to the printer, remove the power cord from the electrical outlet before you connect or disconnect any cable, electronic board or assembly.



CAUTION—HOT SURFACE: The inside of the printer might be hot. To reduce the risk of injury from a hot component, allow the surface to cool before touching it.

Troubleshooting overview

Performing the initial troubleshooting check

Before you start the troubleshooting procedures, perform the following checks:

- Use genuine Lexmark supplies and parts for the best results. Third-party supplies or parts may affect the performance, reliability, or life of the printer and its imaging components.
- With the power cord unplugged from the electrical outlet, check that the cord is free from the breakage, short circuits, disconnected wires, or incorrect connections.
- Make sure the printer is properly grounded. Check the power cord ground terminal.
- Make sure the power supply line voltage is within 10% of the rated line voltage.
- Make sure the machine is securely installed on a level surface in a well-ventilated area.
- Make sure the room temperature is between 16 and 32°C (60 and 90°F) and that the relative humidity is between 8 and 80%.
- Avoid sites generating ammonia gas, high temperature, high humidity (near water faucets, kettles, humidifiers), cold spaces, near open flames, and dusty areas.
- Avoid sites exposed to direct sunlight.
- Make sure the paper is the recommended paper for this printer.
- · Make a trial print with paper from a newly opened package, and check the result.

Power-on Reset (POR) sequence

When you turn the printer on, it performs a POR sequence.

When the printer is turned on, it performs a POR sequence. Check for the correct sequence by observing the following:

- **1** The control panel indicator light turns on.
- **2** The control panel display turns on.
- **3** A splash screen appears on the display.

- **4** The cooling fan turns on.
- **5** The fuser heater turns on.

Note: The fuser takes longer to warm up from a cold start than a warm start.

- **6** The main drive motor turns on.
- 7 The EP drive assembly drives the developer shaft located in the imaging unit.
- **8** The exit rollers turn.
- **9** The control panel indicator light blinks (MS610de only).
- 10 Ready appears on the display.

If no error code is displayed, but a symptom is present, go to "Base printer symptoms" on page 165.

Fixing print quality issues

The symptoms described in this chapter might require replacement of one or more CRUs (Customer Replaceable Units) designated as supplies or maintenance items, which are the responsibility of the customer. With the customer's permission, you might need to install a toner cartridge.

Initial print quality check

Before troubleshooting specific print problems, complete the following initial print quality check:

- Use only genuine Lexmark supplies. Third-party supplies may cause print quality problems.
- The printer must be in a location that follows the recommended operating environment specifications. See "Operating environment" on page 357.
- Check the life status of all supplies. Any supply that is low should be replaced.
- Load 20-lb plain letter or A4 paper. Make sure the paper guides are properly set and locked. From the control panel, set the paper size and type to match the paper loaded in the tray.
- Print a menu settings page. Be sure to keep the original menu settings page to restore the customer's custom settings if needed.
- Verify on the menu settings page if the following are set to their default values:
 - Print resolution: 600 dpi
 - Toner darkness: 8
- Check the transfer roll for damage. Replace if damaged.
- · Check the toner cartridge and imaging unit for damage. Replace if damaged.
- Print the print quality pages to see if the problem remains. Use Tray 1 to test print quality problems.
- Print a print quality test page, and then look for variations in the print from what is expected. Verify if the settings under EP Setup are set to their default values. See <u>"EP Defaults" on page 186</u>.

• Check to ensure the correct printer driver for the installed software is being used. An incorrect printer driver for the installed software can cause problems. Incorrect characters could print, and the copy may not fit the page correctly.

Gray background or toner fog check

 


Actions	Yes	No
 Step 1 a Turn off the printer, wait for 10 seconds, and then turn on the printer. b From the control panel: 1 Increase the toner darkness in the Quality menu. Note: 8 is the factory default setting. 2 Set the paper type, texture, and weight in the Paper menu to match the paper loaded. 	Go to step 2.	The problem is solved.
Does the problem remain?	_	
Step 2 Check if the printer is using a genuine and supported Lexmark toner cartridge.	Go to step 4.	Go to step 3.
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier. Is the printer using a genuine and supported toner cartridge?		
Step 3 Install a genuine and supported toner cartridge.	Go to step 4.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 4	Go to step 5.	Go to step 6.
a Remove any packing material left on the imaging unit, including the red separator plastic (A).		
A		
Note: You may need a pair of pliers to remove a piece of		
broken plastic inside the imaging unit.		
b Check the charge roller contact (B) on the right side of the imaging unit for damage and contamination.		
B		
Is the charge roller contact damaged and contaminated?		
Step 5 Repair or replace the charge roller contact on the imaging unit.	Go to step 6.	The problem is solved.
Does the problem remain?		
Step 6	Go to step 7.	The problem is
Replace the imaging unit.		solved.
Does the problem remain?		
Step 7	Go to step 9.	Go to step 8.
Make sure that connection JPS1 on the controller board and the connections on the power supply are properly connected.		
Are the connections properly connected?		

Actions	Yes	No
Step 8 Reseat the connections.	Go to step 9.	The problem is solved.
Does the problem remain?		
Note: Poor electrical contact to the photoconductor is the most likely source of a full page background defect. a Remove any contamination from the photoconductor charge contact (C) on the right side of the frame.	Go to step 10.	The problem is solved.
b Perform a print test.		
Does the problem remain?		
Step 10 Check if the photoconductor charge contact is bent, damaged, or not in proper contact with the imaging unit.	Go to step 11.	Contact the next level of support.
Is the contact free from damage and in proper contact with the imaging unit?		
Step 11 Replace the power supply. See <u>"Power supply removal" on page 287</u> .	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Blank pages check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2	Go to step 3.	The problem is
Install a genuine and supported toner cartridge.		solved.
Does the problem remain?		
Step 3	Go to step 4.	The problem is
a Check and remove any packing material left on the imaging unit.		solved.
b Firmly shake the imaging unit to redistribute the toner, and then reinstall it.		
Does the problem remain?		
Step 4	Go to step 5.	The problem is
Check the imaging unit for damage and proper installation, and replace if necessary.		solved.
Does the problem remain?		


Actions	Yes	No
Step 5	Go to step 6.	Go to step 7.
Check the coupler to make sure that it is not stuck in the retracted position. While slowly closing the door, observe the coupler to see if it moves inward.		
Note: With the imaging unit removed, the coupler should retract with the door open and move inward when the front door is closed.		
Is the coupler stuck, and not moving inward, while closing the front door?		

Actions	Yes	No
Step 6 Reach inside the printer and manually reposition the coupler in the direction of the red arrow as shown.	Go to step 7.	The problem is solved.
Does the problem remain?		
Step 7 Check if the imaging unit contact (A) is bent, damaged, or not in proper contact with the imaging unit.	Go to step 8.	Contact the next level of support.
Are the contacts free from damage, not bent and in proper contact with the imaging unit?		
Step 8 Check all connections in the power supply. If necessary, replace the power supply. Does the problem remain?	Go to step 9.	The problem is solved.
Step 9 Reseat cable JPS1 on the controller board.	Go to step 10.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 10 Replace the cable.	Go to step 11.	The problem is solved.
Does the problem remain?		
a Check the transfer roller for proper installation. If necessary, remove and then reinstall the transfer roller. b. Check the transfer roller for proper installation and classes.	Go to step 13.	Go to step 12.
b Check the transfer roller for contamination and damage. Is the transfer roller free of contamination and damage?		
Step 12 Replace the transfer roller. See <u>"Transfer roll removal" on page 255</u> .	Go to step 13.	The problem is solved.
Does the problem remain?		
Step 13 Check the transfer roller left contact spring on the transfer roller left arm for damage.	Go to step 15.	Go to step 14.
Is the contact spring free of damage?		
Step 14 Replace the transfer roller left arm with cable.	Go to step 15.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 15	Go to step 16.	The problem is
 a Check the coupler for signs of damage. The coupler is located on the main drive motor. Good condition 		solved.
• Bad condition		
b If the coupler is damaged, then replace the main drive motor.		
Does the problem remain?		
 Step 16 Depending on the printer model, reseat the following cables on the controller board: JVIDEO and JGLV1 (MS31x, MS41x, MS51x, and MS61x) J6 and JLSU1 (MS610de and MX61xde) JMM1 and JLSU1 (MX31x, MX41x, MX51x, and MX61x) 	Go to step 17.	The problem is solved.
Does the problem remain?		
Step 17 Replace the laser printhead. See <u>"Laser scanning unit (LSU) removal" on page 313</u> .	Contact the next level of support.	The problem is solved.
Does the problem remain?		

 Solid black pages check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2 Install a genuine and supported toner cartridge.	Go to step 3.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 3 a Remove any packing material left on the imaging unit, including the red separator plastic (A). Note: You may need a pair of pliers to remove a piece of broken plastic inside the imaging unit. b Check the charge roller contact (B) on the right side of the imaging unit for damage and contamination. B	Go to step 4.	Go to step 5.
Is the charge roller contact damaged and contaminated?		
Step 4 Repair or replace the charge roller contact on the imaging unit.	Go to step 5.	The problem is solved.
Does the problem remain?		
Step 5 Replace the imaging unit.	Go to step 6.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 6	Go to step 7.	Go to step 8.
Check if the imaging unit contact (C) is contaminated, broken, or bent out of proper position.		
C		
Is the contact contaminated, broken, or bent out of proper position?		
Step 7 Clean or repair the imaging unit contacts.	Contact the next level of support.	The problem is solved.
Does the problem remain?		
Step 8	Go to step 9.	The problem is
Check the high voltage metal contacts on the imaging unit for damage. If necessary, replace the imaging unit.		solved.
Does the problem remain?		
Step 9 Check cable JPS1 from the controller board to the power supply for proper connection.	Go to step 11.	Go to step 10.
Is the cable properly connected?		
Step 10 Reseat the cable.	Go to step 11.	The problem is solved.
Does the problem remain?		
Step 11 Replace the cable.	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Print is too dark check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2	Go to step 3.	The problem is
Install a genuine and supported toner cartridge.		solved.
Does the problem remain?		
Step 3	Go to step 4.	The problem is
a Turn off the printer, wait for 10 seconds, and then turn on the printer.		solved.
b From the control panel, reduce the toner darkness in the Quality menu.		
Note: 8 is the factory default setting.		
Does the problem remain?		
Step 4	Go to step 5.	The problem is
From the control panel, set the paper type, texture, and weight in the Paper menu to match the paper loaded.		solved.
Does the problem remain?		
Step 5	Go to step 6.	The problem is
Depending on the operating system, specify the paper type, texture, and weight from Printing Preferences or Print dialog.		solved.
Does the problem remain?		
Step 6	Go to step 7.	The problem is
a Check if the paper loaded has texture or rough finishes.		solved.
b From the control panel, set the paper texture in the Paper menu to match the texture of the paper loaded.		
Does the problem remain?		

Actions	Yes	No
Step 7 Make sure that the paper loaded is from a fresh package. Note: Paper absorbs moisture due to high humidity. Store paper in its original wrapper until you use it. Does the problem remain?	Go to step 8.	The problem is solved.
	Go to step 9.	The problem is
Step 8 Replace the imaging unit.	Go to step a.	The problem is solved.
Does the problem remain?		
Step 9 Check if the imaging unit contacts (A) are bent, damaged, or not in proper contact with the imaging unit. A Are the contacts free from damage, not bent and in proper contact	Go to step 10.	Contact the next level of support.
with the imaging unit?		0
Step 10 Check all connections on the power supply for proper connection.	Contact the next level of support.	Go to step 11.
Is the power supply properly connected?		
Step 11	Go to step 12.	The problem is
Replace the connections.		solved.
Does the problem remain?		
Step 12	Contact the next	The problem is
Replace the power supply. See <u>"Power supply removal" on page 287</u> .	level of support.	solved.
Does the problem remain?		

Print is too light check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2 Install a genuine and supported toner cartridge.	Go to step 3.	The problem is solved.
Does the problem remain?		
Step 3 a Turn off the printer, wait for 10 seconds, and then turn on the printer.	Go to step 4.	The problem is solved.
b From the control panel:		
1 Increase the toner darkness in the Quality menu.Note: 8 is the factory default setting.		
2 Set the paper type, texture, and weight in the Paper menu to match the paper loaded.		
Does the problem remain?		
Step 4	Go to step 5.	The problem is
a Remove the toner cartridge and imaging unit.		solved.
b Push either side of the transfer roller, located below the imaging unit, to check if it depresses and bounces back into place.		
c If the transfer roller does not depress and bounce back into place, then reinstall it by pulling up the blue gear and pulling it out from the right side to the left.		
d Firmly shake the imaging unit to redistribute the toner, and then reinstall it.		
e Reinstall the toner cartridge.		
f Turn off the printer, wait for 10 seconds, and then turn on the printer.		
Does the problem remain?		

Actions	Yes	No
Step 5	Go to step 6.	Go to step 7.
Check the shutter on the imaging unit for signs of damage.		
Note: The shutter opens to receive toner from the toner cartridge.		
Is the shutter on the imaging unit working properly?		
Step 6	Go to step 7.	Go to step 8.
a Check the status of the imaging unit.		
1 From the home screen, select Status/supplies .		
2 Select View Supplies.		
b Check the condition of the imaging unit.		
Is the imaging unit near end of life and/or showing signs toner leakage?		
Step 7	Go to step 8.	The problem is
Replace the imaging unit.		solved.
Does the problem remain?		
Step 8	Go to step 9.	The problem is
Replace the transfer roller. See <u>"Transfer roll removal" on page 255</u> .		solved.
Does the problem remain?		
Step 9	Go to step 10.	The problem is
Clean the printhead lens. See "Cleaning the printhead lenses" on page 328.		solved.
Note: This is applicable only to models installed with a galvo LSU. To determine whether the LSU is galvo, check the serial number of the printer. The sixth digit character assigned should be in the 0–9 or B–N range (Example: 4514 20HH 007CR).		
Does the problem remain?		
Step 10	Go to step 11.	The problem is
Replace the power supply. See <u>"Power supply removal" on page 287</u> .		solved.
Does the problem remain?		
Step 11	Go to step 13.	Go to step 12.
Check the cartridge gearbox for damage.		
Is the cartridge gearbox free from damage?		

Actions	Yes	No
Step 12 Replace the cartridge gearbox. See "Cartridge gearbox removal" on page 236.	Go to step 13.	The problem is solved.
Does the problem remain?		
Step 13 Check connection JCART1 on the controller board and the connection on the cartridge gearbox.	Go to step 15.	Go to step 14.
Are the connections properly connected?		
Step 14 Replace the connections.	Go to step 15.	The problem is solved.
Does the problem remain?		
Step 15 Replace the cartridge gearbox. See <u>"Cartridge gearbox removal"</u> on page 236.	Go to step 16.	The problem is solved.
Does the problem remain?		
Step 16 Replace the controller board. See "Controller board removals" on page 245.	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Paper curl check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2	Go to step 3.	The problem is
Install a genuine and supported toner cartridge.		solved.
Does the problem remain?		
Step 3	Go to step 4.	The problem is
Adjust the guides in the tray to the correct position for the paper loaded.		solved.
Does the problem remain?		
Step 4	Go to step 5.	The problem is
From the control panel, set the paper size, type, and weight in the Paper menu to match the paper loaded.		solved.
Does the problem remain?		
Step 5	Go to step 6.	The problem is
Depending on the operating system, specify the paper size from Printing Preferences or Print dialog.		solved.
Does the problem remain?		
Step 6	Go to step 7.	The problem is
Remove paper from the tray, and then turn it over.		solved.
Does the problem remain?		
Step 7	Go to step 8.	The problem is
Make sure that the paper loaded is from a fresh package.		solved.
Note: Paper absorbs moisture due to high humidity. Store paper in its original wrapper until you use it.		
Does the problem remain?		
Step 8	Contact the next	Go to step 9.
Make sure that the printer supports the paper loaded.	level of support.	
Is the paper supported?		

Actions	Yes	No
Step 9 Load a supported paper.	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Folded or wrinkled paper check



Actions	Yes	No
 Step 1 a Check if the printer is using a non-Lexmark toner cartridge. Note: If the printer is using a third-party cartridge, then do not replace the imaging unit. Refer the users to their cartridge supplier. b Make sure that the toner cartridge is compatible with the imaging unit. 	Go to step 2.	The problem is solved.
Step 2 a Check if the paper loaded is from a fresh package. Note: The amount of moisture in paper affects both print quality and printer ability to feed paper correctly. b Make sure that the printer supports the paper loaded. For a complete list of supported paper, see the printer User's Guide. Does the problem remain?	Go to step 3.	The problem is solved.
Step 3 Make sure that the fuser entry guide is free of waste toner and dust. Warning—Potential Damage: Clean the fuser entry guide with a toner vacuum and cloth. Do not use compressed air. Does the problem remain? Step 4	Go to step 4. Contact the next	The problem is solved. The problem is
If the fuser has reached end of life, then replace the maintenance kit. Does the problem remain?	level of support.	solved.

Repeating defects check



Actions	Yes	No
Step 1	Go to step 2.	Go to step 3.
a From the control panel, navigate to:	·	
Menu > Help > Print Defects Guide		
b Using the Print Defects Guide, check if the distance between the defects is equal to any of the following:		
• 3.82 in. (97 mm)		
• 1.85 in. (47 mm)		
• 1.5 in. (38 mm)		
Note: Make sure to measure the defect interval accurately.		
Does the distance measured match any of the items listed?		
Step 2	Go to step 3.	The problem is
Replace the imaging unit.		solved.
Does the problem remain?		
Step 3	Go to step 4.	Contact the next
Check if the distance between repeating defects is equal to 3.15 inches (85 mm).		level of support.
Does the distance between repeating defects equal to 3.15 inches (85 mm)?		
Step 4	Go to step 5.	The problem is
Replace the fuser. See <u>"Fuser removal" on page 311</u> .		solved.
Does the problem remain?		
Step 5	Contact the next	The problem is
Replace the transfer roller. See <u>"Transfer roll removal" on page 255</u> .	level of support.	solved.
Does the problem remain?		

Skewed print check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check the guides in the tray where the skewed prints are sourced from.		
Note: If paper is sourced from the MPF, then proceed to <u>step 9</u> .		
Does the position of the guides match the paper loaded?		
Step 2	Go to step 3.	The problem is
Adjust the guides to match the paper loaded.		solved.
Does the problem remain?		
Step 3	Go to step 5.	Go to step 4.
Check if the printer supports the paper loaded.		
Note: For a complete list of supported paper, see the printer <i>User's Guide</i> .		
Is the paper supported?		
Step 4	Go to step 5.	The problem is
Remove the paper, and then load a supported one.		solved.
Does the problem remain?		
Step 5	Go to step 7.	Go to step 6.
Check the tray pick roller for excess wear and contamination.		
Is the pick roller free from excess wear and contamination?		
Step 6	Go to step 7.	The problem is
Replace the pick roller. See <u>"Pick roller removal" on page 315</u> .		solved.
Does the problem remain?		

Actions	Yes	No
Step 7 Perform a print test. From the Diagnostics menu, select PRINT TESTS > Tray [x]. Note: [x] refers to the tray where the skewed prints are sourced from.	Go to step 8.	The problem is solved.
Does the problem remain?		
Step 8 Adjust the margins. From the Diagnostic menu, select REGISTRATION.	Go to step 15.	The problem is solved.
Does the problem remain?		
Step 9 Check the guides in the MPF tray. Does the position of the guides match the paper loaded?	Go to step 11.	Go to step 10.
Step 10	Go to step 11.	The problem is
Adjust the guides to match the paper loaded.	·	solved.
Does the problem remain?		
Step 11 Check if the printer supports the paper loaded. Note: For a complete list of supported paper, see the printer User's Guide.	Go to step 13.	Go to step 12.
Is the paper supported?		
Step 12 Remove the paper, and then load a supported one. Does the problem remain?	Go to step 13.	The problem is solved.
Step 13	Go to step 15.	Go to step 14.
Check the MPF pick roller for excess wear and contamination.	·	·
Is the MPF pick roller free from excess wear and contamination?		
Step 14 Replace the MPF pick roller. See <u>"MPF pick roller removal" on page 277</u> .	Go to step 15.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 15 Perform the paper skew adjustment. See <u>"Printhead assembly adjustments" on page 223</u> .	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Streaked vertical lines appear on prints check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2	Go to step 3.	The problem is
Install a genuine and supported toner cartridge.		solved.
Does the problem remain?		
Step 3	Go to step 4.	The problem is
Remove, and then reinstall the imaging unit.		solved.
Does the problem remain?		
Step 4	Go to step 5.	The problem is
Replace the imaging unit.		solved.
Does the problem remain?		
Step 5	Contact the next	Go to step 6.
Remove the fuser, and check for damage or debris on the rollers and belts.	level of support.	
Are the rollers and belts free of damage or debris?		

Actions	Yes	No
Step 6 Replace the fuser.	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Horizontal light bands check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2 Install a genuine and supported toner cartridge.	Go to step 3.	The problem is solved.
Does the problem remain?		
Step 3 Turn off the printer, wait for 10 seconds, and then turn on the printer.	Go to step 4.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 4 Check the imaging unit contact block (A), including the white and red wires, for damage or improper installation.	Go to step 5.	Contact the next level of support.
A		
Is the imaging unit contact block free of damage and properly installed?		
Step 5	Contact the next	The problem is
Replace the power supply. See <u>"Power supply removal" on page 287</u> .	level of support.	solved.
Does the problem remain?		

Vertical light bands check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2 Install a genuine and supported toner cartridge.	Go to step 3.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 3 Clean the printhead lens. See "Cleaning the printhead lenses" on page 328.	Go to step 4.	The problem is solved.
Note: This is applicable only to models installed with a galvo LSU. To determine whether the LSU is galvo, check the serial number of the printer. The sixth digit character assigned should be in the 0–9 or B–N range (Example: 4514 20HH 007CR).		
Does the problem remain?		
Step 4	Go to step 5.	The problem is
Replace the printhead. See "Laser scanning unit (LSU) removal" on page 313.		solved.
Does the problem remain?		
Step 5	Contact the next	The problem is
Replace the imaging unit.	level of support.	solved.
Does the problem remain?		


Vertical dark bands check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2	Go to step 3.	The problem is
Install a genuine and supported toner cartridge.		solved.
Does the problem remain?		

Actions	Yes	No
Step 3 Remove, and then reinstall the toner cartridge and imaging unit.	Go to step 4.	The problem is solved.
Does the problem remain?		
Step 4 If a bright light enters the right side of the printer, then move the printer to avoid the bright light.	Go to step 5.	The problem is solved.
Note: In cases where the printer cannot be moved or relocated, add a cover to the fan inlet vent to block the light from entering the printer, or contact the next level of support.		
Does the problem remain?		
Step 5 If a separator plastic (A) is stuck inside the imaging unit or if there are other obstructions between the charge roller and photoconductor drum, then remove them.	Contact the next level of support.	The problem is solved.
A		
Does the problem remain?		

 Vertical dark streaks with print missing check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2 Install a genuine and supported toner cartridge.	Go to step 3.	The problem is solved.
Does the problem remain?		
Step 3 a Remove any packing material left on the imaging unit, including the red separator plastic (A).	Go to step 4.	Go to step 5.
 Note: You may need a pair of pliers to remove a piece of broken plastic inside the imaging unit. b Check the charge roller contact (B) on the right side of the imaging unit for damage and proper installation. 		
B		
Is the charge roller contact damaged and contaminated?		
Step 4 Repair or replace the charge roller contact on the imaging unit.	Go to step 5.	The problem is solved.
Does the problem remain?		

Actions	Yes	No
Step 5 Replace the imaging unit.	Go to step 6.	The problem is solved.
Does the problem remain?		
Step 6 Check if the imaging unit contacts (C) are contaminated or bent out of proper position.	Go to step 7.	Go to step 8.
C		
Are the contacts contaminated and bent out of proper position?		
Step 7 Clean or repair the imaging unit contacts.	Go to step 8.	The problem is solved.
Does the problem remain?		
Step 8 Check connection JPS1 on the controller board and the connections on the power supply.	Go to step 10.	Go to step 9.
Are the connections properly connected?		
Step 9 Reconnect the cables.	Go to step 10.	The problem is solved.
Does the problem remain?		
Step 10 Replace the power supply. See <u>"Power supply removal" on page 287</u> .	Contact the next level of support.	The problem is solved.
Does the problem remain?		

White streaks and voided areas check



is
is
is

	.,	1
Actions	Yes	No
Step 5 Check the shutter tab (A) on the toner cartridge for signs of damage.	Go to step 6.	Go to step 7.
Is the shutter tab damaged?		
Step 6	Go to step 7.	The problem is
Replace the imaging unit and the toner cartridge.	GO to step 7.	solved.
Does the problem remain?		
Step 7 Clean the printhead lens. See <u>"Cleaning the printhead lenses" on page 328</u> .	Go to step 8.	The problem is solved.
Note: This is applicable only to models installed with a galvo LSU. To determine whether the LSU is galvo, check the serial number of the printer. The sixth digit character assigned should be in the 0–9 or B–N range (Example: 4514 20HH 007CR).		
Does the problem remain?		
Step 8 Check if the imaging unit contacts (B) are contaminated or bent out of proper position.	Go to step 9.	Go to step 10.
B		
Are the contacts contaminated or bent out of proper position?		

Actions	Yes	No
Step 9 Clean or repair the imaging unit contacts.	Contact the next level of support.	The problem is solved.
Does the problem remain?		
Step 10 Check connection JPS1 on the controller board and all the connections on the power supply.	Go to step 12.	Go to step 11.
Are the connections properly connected?		
Step 11 Replace the connections.	Go to step 12.	The problem is solved.
Does the problem remain?	0 1 10	-
Step 12 Replace the power supply. See <u>"Power supply removal" on page 287</u> .	Go to step 13.	The problem is solved.
Does the problem remain?		
Step 13 Replace the printhead. See "Laser scanning unit (LSU) removal" on page 313.	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Fine lines are not printed correctly (specifically Chinese characters) check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2	Go to step 3.	The problem is
Install a genuine and supported toner cartridge.		solved.
Does the problem remain?		
Step 3	Contact the next	The problem is
From the control panel, adjust the Toner Darkness setting to 7.	level of support.	solved.
a From the Settings menu, navigate to:		
Print Settings > Quality menu > Pixel Boost > Fonts > Submit		
b From the Quality menu, select Toner Darkness , and then adjust the setting to 7.		
c Submit the changes.		
Note: Adjusting the Toner Darkness setting to 7 results in a slightly lighter print. You may leave the Toner Darkness value at 8 in order to maintain the darkness that you have grown accustomed to, but this will result in reduced toner yield.		
Does the problem remain?		

Clipped pages or images check



Actions	Yes	No
Step 1 Check if the printer is using a genuine and supported Lexmark toner cartridge. Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier. Is the printer using a genuine and supported toner cartridge?	Go to step 3.	Go to step 2.
Step 2 Install a genuine and supported toner cartridge. Does the problem remain?	Go to step 3.	The problem is solved.
Step 3 Remove, and then reinstall the imaging unit. Does the problem remain?	Go to step 4.	The problem is solved.
Step 4 Check if a separator plastic (A), or a piece of it, is stuck inside the imaging unit or if there are any other obstructions between the charge roller and photoconductor drum.	Go to step 6.	Go to step 5.
Is the imaging unit free from any separator plastic fragments or other obstructions? Step 5 Using a pair of pliers, remove the separator plastic fragments and other obstructions. Does the problem remain?	Go to step 6.	The problem is solved.
Step 6 Replace the imaging unit. Does the problem remain?	Go to step 7.	The problem is solved.

Actions	Yes	No
Step 7 Check the imaging unit contact block (B) for damage or improper installation.	Go to step 8.	Contact the next level of support.
Is the imaging unit contact block damaged or improperly installed?		
Step 8	Contact the next	The problem is
Reinstall or replace the imaging unit contact block.	level of support.	solved.
Does the problem remain?		

Compressed images appear on prints check



Actions	Vos	No
Step 1 Remove the imaging unit, and then inspect the white photoconductor coupler (A). The coupler should be firmly connected to the imaging unit and should not freely rotate.	Yes Go to step 2.	No Go to step 3.
Does the coupler move freely or appear damaged?		
Step 2	Go to step 3.	The problem is
Replace the imaging unit.		solved.
Does the problem remain?		
Step 3 Replace the main drive gearbox. See "Main drive gearbox removal" on page 227.	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Incorrect margins on prints check



Actions	Yes	No
Step 1 Adjust the guides in the tray according to the size of the paper loaded.	Go to step 2.	The problem is solved.
Does the problem remain?		
 Step 2 Do one of the following: From the printer control panel, set the paper size in the Paper menu to match the paper loaded in the tray. Change the paper loaded in the tray to match the paper size specified in the tray settings. Does the problem remain?	Go to step 3.	The problem is solved.
Step 3	Go to step 4 or	The problem is
Depending on your operating system, specify the paper size from Printing Preferences or from the Print dialog. Does the problem remain?	contact the next level of support.	solved.
Step 4	Contact the next	The problem is
 a Enter the Diagnostics menu, and then select Registration. b Adjust the margins as necessary. 	level of support.	solved.
Does the problem remain?		

Toner rubs off check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2	Go to step 3.	The problem is
Install a genuine and supported toner cartridge.		solved.
Does the problem remain?		
Step 3	Go to step 4.	The problem is
From the control panel, set the paper type, texture, and weight in the Paper menu to match the paper loaded.		solved.
Does the problem remain?		
Step 4	Go to step 5.	The problem is
Remove, and then reinstall the fuser.		solved.
Does the problem remain?		
Step 5	Go to step 6.	The problem is
Replace the fuser. See <u>"Fuser removal" on page 311</u> .		solved.
Does the problem remain?		
Step 6	Go to step 7.	The problem is
Reseat the connections on the power supply.		solved.
Does the problem remain?		
Step 7 Replace the power supply. See <u>"Power supply removal" on page 287</u> .	Contact the next level of support.	The problem is solved.
Does the problem remain?		

Toner specks appear on prints check



Actions	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check if the printer is using a genuine and supported Lexmark toner cartridge.		
Note: If the printer is using a third-party cartridge, then refer the users to their cartridge supplier.		
Is the printer using a genuine and supported toner cartridge?		
Step 2 Install a genuine and supported toner cartridge.	Go to step 3.	The problem is solved.
Does the problem remain?		
 Step 3 a Check the status of the imaging unit. 1 From the home screen, select Status/supplies. 2 Select View Supplies . b Check the condition of the imaging unit. 	Go to step 4.	Go to step 5.
leakage?		
Step 4 Replace the imaging unit. Does the problem remain?	Go to step 5.	The problem is solved.
Step 5	Go to step 6.	Go to step 7.
Check if toner specks appear only on the edges or back side of the pages.	or to disp of	00 10 0100
Do toner specks appear only on the edges or back side of the pages?		
Step 6	Go to step 7.	The problem is
Replace the transfer roller. See <u>"Transfer roll removal" on page 255</u> .		solved.
Does the problem remain?		
Step 7	Go to step 8.	Contact the next
Check the printer for stray toner contamination.		level of support.
Is the printer contaminated with stray toner?		
Step 8	Contact the next	The problem is
Using an approved toner vaccum cleaner, completely clean the printer, toner cartridge, and imaging unit of toner contamination.	level of support.	solved.
Does the problem remain?		

Paper jams

Avoiding jams

Load paper properly

- Make sure that the paper lies flat in the tray.
- Do not remove a tray while the printer is printing.
- Do not load a tray while the printer is printing. Load it before printing, or wait for a prompt to load it.
- Do not load too much paper. Make sure that the stack height is below the maximum paper fill indicator.
- Do not slide paper into the tray. Load paper as shown in the illustration.



- Make sure that the paper guides are properly positioned.
- Push the tray firmly into the printer after loading paper.

Use recommended paper

- Use only recommended paper or specialty media.
- Do not load wrinkled, creased, damp, bent, or curled paper.
- Flex, fan, and straighten paper before loading it.



- Do not use paper that has been cut or trimmed by hand.
- Do not mix paper sizes, weights, or types in the same tray.

• Make sure that the paper size and type are set correctly on the Embedded Web Server or the computer.

Note: Depending on your operating system, access the Paper menu using Local Printer Settings Utility or Printer Settings.


• Store paper according to manufacturer recommendations.

Understanding jam messages and locations

When a jam occurs, a message indicating the jam location and information to clear the jam appears on the printer display. Open the doors, covers, and trays indicated on the display to remove the jam.

Notes:

- When Jam Assist is set to On, the printer automatically flushes blank pages or pages with partial prints to the standard bin after a jammed page has been cleared. Check your printed output stack for discarded pages.
- When Jam Recovery is set to On or Auto, the printer reprints jammed pages. However, the Auto setting does not guarantee that the page will print.

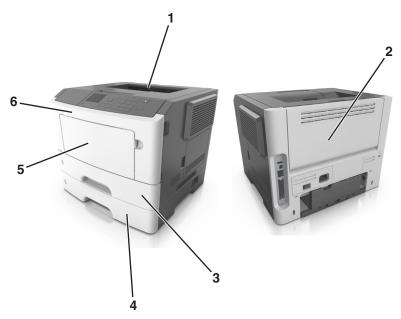

#	Area	Printer control panel message	What to do
1	Standard bin	[x]-page jam, clear standard bin. [20y.xx]	Remove the jammed paper.
2	Rear door	[x]-page jam, open rear door. [20y.xx]	Open the rear door, and then remove the jammed paper.
3	Tray 1	[x]-page jam, remove tray 1 to clear duplex. [23y.xx]	Pull tray 1 completely out, then push the front duplex flap down, and then remove the jammed paper.
			Note: You may need to open the rear door to clear some 23y.xx paper jams.
4	Tray [x]	[x]-page jam, remove tray [x]. [24y.xx]	Pull the indicated tray out, and then remove the jammed paper.


#	Area	Printer control panel message	What to do
5	Multipurpose feeder	[x]-page jam, clear manual feeder. [250.xx]	Remove all paper from the multipurpose feeder, and then remove the jammed paper.
6	Front door	[x]-page jam, open front door. [20y.xx]	Open the front door, then remove the toner cartridge, imaging unit, and jammed paper.

[x]-page jam, open front door. [20y.xx]



CAUTION—HOT SURFACE: The inside of the printer might be hot. To reduce the risk of injury from a hot component, allow the surface to cool before touching it.

1 Press the button on the right side of the printer, and then open the front door.

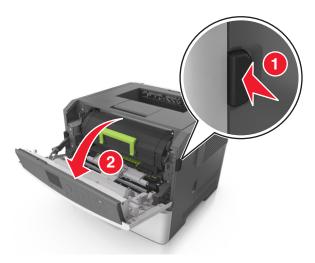


2 Pull the toner cartridge out using the handle.




3 Lift the green handle, and then pull the imaging unit out of the printer.



Warning—Potential Damage: Do not touch the shiny blue photoconductor drum under the imaging unit. Doing so may affect the quality of future print jobs.

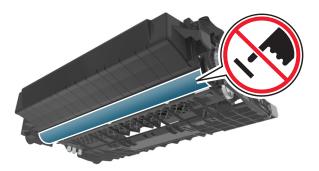


4 Lift the green flap in front of the printer.

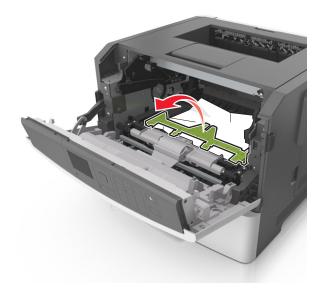


5 Place the imaging unit aside on a flat, smooth surface.

Warning—Potential Damage: Do not expose the imaging unit to direct light for more than 10 minutes. Extended exposure to light may cause print quality problems.


6 Firmly grasp the jammed paper on each side, and then gently pull it out.

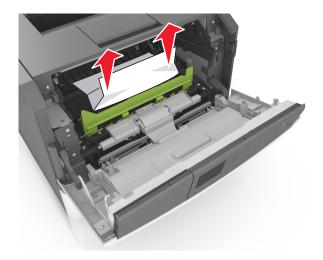

7 Insert the imaging unit by aligning the arrows on the side rails of the unit with the arrows on the side rails inside the printer, and then insert the imaging unit into the printer.

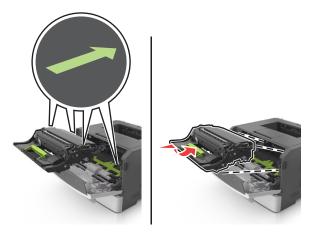

8 Insert the toner cartridge by aligning the side rails of the cartridge with the arrows on the side rails inside the printer, and then insert the cartridge into the printer.

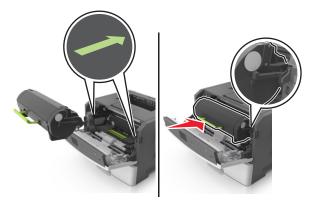

- **9** Close the front door.
- 10 From the printer control panel, touch to clear the message and continue printing. For non-touch-screen printer models, select Next > OK > Clear the jam, press OK > OK.

[x]-page jam, clear standard bin. [20y.xx]

1 Firmly grasp the jammed paper on each side, and then gently pull it out.


Note: Make sure all paper fragments are removed.



2 From the printer control panel, press oK to clear the message and continue printing.

[x]-page jam, open rear door. [20y.xx]

1 Press the button on the right side of the printer, and then open the front door.

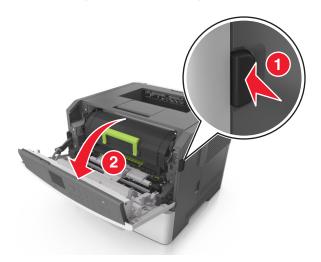

2 Gently pull down the rear door.



CAUTION—HOT SURFACE: The inside of the printer might be hot. To reduce the risk of injury from a hot component, allow the surface to cool before touching it.



3 Firmly grasp the jammed paper on each side, and then gently pull it out.




- **4** Close the rear and front doors.
- **5** From the printer control panel, press OK to clear the message and continue printing.


[x]-page jam, remove tray 1 to clear duplex. [23y.xx]

CAUTION—HOT SURFACE: The inside of the printer might be hot. To reduce the risk of injury from a hot component, allow the surface to cool before touching it.

1 Pull the tray completely out of the printer.

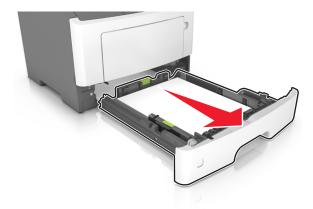

2 Locate the blue lever, and then pull it down to release the jam.

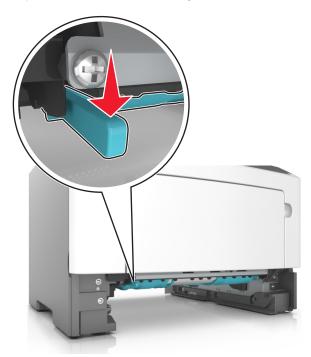

3 Firmly grasp the jammed paper on each side, and then gently pull it out.




- 4 Insert the tray.
- **5** From the printer control panel, touch to clear the message and continue printing. For non-touch-screen printer models, select **Next** > **OK** > **Clear the jam, press OK** > **OK**.


[x]-page jam, open tray 1. [241.xx]

1 Pull the tray completely out of the printer.

Note: The message on the printer display indicates the tray where the jammed paper is located.

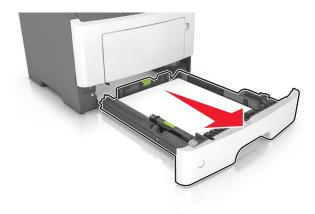

2 Firmly grasp the jammed paper on each side, and then gently pull it out.

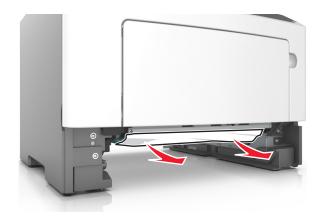


- **3** Insert the tray.
- 4 From the printer control panel, select Next > OK > Clear the jam, press OK > OK

[x]-page jam, open tray [x]. [24y.xx]

1 Pull the tray completely out of the printer.

Note: The message on the printer display indicates the tray where the jammed paper is located.

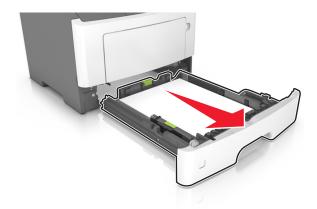

2 Firmly grasp the jammed paper on each side, and then gently pull it out.




Diagnostics and troubleshooting

- 3 Insert the tray.
- 4 From the printer control panel, touch to clear the message and continue printing. For non-touch-screen printer models, select Next > OK > Clear the jam, press OK > OK.

[x]-page jam, clear manual feeder. [25y.xx]

1 From the multipurpose feeder, firmly grasp the jammed paper on each side, and then gently pull it out.

Note: Make sure all paper fragments are removed.

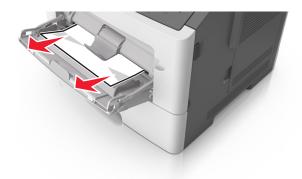

2 Flex the sheets of paper back and forth to loosen them, and then fan them. Do not fold or crease the paper. Straighten the edges on a level surface.



3 Reload paper into the multipurpose feeder.



Note: Make sure the paper guide lightly rests against the edge of the paper.

4 From the printer control panel, touch

to clear the message and continue printing. For non-touch-screen printer models, select Next > OK > Clear the jam, press OK > OK.

200 paper jams

200 paper jam messages

Notes:

- Some error messages are applicable only to printer models with a polygon LSU (laser scanning unit).
- If the sixth digit character assigned to the serial number of the printer is in the P–Z range, then the printer is installed with a polygon LSU (example: 4514 2ZHH 007CR).

Error code	Description	Action
200.01	Input sensor covered during warm-up sequence.	Go to <u>"Sensor (input) static jam service check"</u> on page 92.
200.02	Input sensor covered too quickly.	Go to "Sensor (input) early/late arriving service check" on page 92.
200.03	Page did not reach input sensor or was late reaching input sensor, but was successfully picked from the source.	Go to "Sensor (input) early/late arriving service check" on page 92.
200.05	Input sensor covered too long. Source = [x].	Go to "Sensor (input) early/late arriving service check" on page 92.
200.08	Page arrive at input senor at unexpected time.	Go to "Sensor (input) early/late arriving service check" on page 92.
200.09	Printhead did not receive proper motor feedback to start laser servo.	Go to "Sensor (input) image jam service check" on page 94.
200.10	Printhead motor not locked when media reaches the input sensor.	Go to "Sensor (input) image jam service check" on page 94.
200.11	Printhead motor fell out of lock after page reaches the input sensor.	Go to "Sensor (input) image jam service check" on page 94.
	Mirror motor got locked, and then lost it again before the initial lock timeout.	Go to "Laser scanning unit (LSU) service check" on page 135.
200.12	Printhead was not ready for media.	Go to "Sensor (input) image jam service check" on page 94.
200.13	Media at input sensor is not the next media to be imaged.	Go to "Sensor (input) image jam service check" on page 94.
200.14	Media reached the input sensor before EP was ready.	Go to "Sensor (input) image jam service check" on page 94.
200.15	Input sensor covered too long. Source = [x].	Go to "Sensor (input) early/late arriving service check" on page 92.
200.16	Fuser motor stalled.	Go to "Main drive motor control jam service check" on page 95.
200.21	No response from paper port driver while waiting for the source to deactivate the Input Source Ready flag to indicate it has initiated picking.	Go to <u>"Sensor (input) early/late arriving service check" on page 92</u> .
200.23	Laser servo never started due to potential conflict with the transfer servo.	Go to "Sensor (input) image jam service check" on page 94.

Error code	Description	Action
200.24	Measured gap at input sensor too small to meet video delivery requirements. (Not enough time since prior image finished to start new image).	Go to <u>"Sensor (input) image jam service check"</u> on page 94.
200.25	Input sensor covered too long. Source = [x].	Go to <u>"Sensor (input) early/late arriving service</u> check" on page 92.
200.29	Printhead drive control out of range due to an external event beyond what the control is designed to handle.	Go to <u>"Sensor (input) image jam service check"</u> on page 94.
200.30	Invalid printhead NVRAM.	Go to "Sensor (input) image jam service check" on page 94.
200.31	Paper, in the middle of a job, at input sensor before interrupt occurred.	Go to "Sensor (input) early/late arriving service check" on page 92.
200.32	Detected cover switch bounce.	Go to "Sensor (input) early/late arriving service check" on page 92.
	Printhead lost HSYNCs due to a glitch with the laser safety interlock, for example, bouncy cover switch.	Go to "Laser scanning unit (LSU) service check" on page 135.
200.33	Input sensor covered too quickly.	Go to "Sensor (input) early/late arriving service check" on page 92.
200.35	Input sensor covered too long. Source = [x].	Go to "Sensor (input) early/late arriving service check" on page 92.
200.38	Interpage servo gap smaller than expected for galvo offset target evaluation.	Go to "Sensor (input) early/late arriving service check" on page 92.
200.42	Rogue sheet at ACM sensor while flushing the paper path prior to declaring tray 1 source empty.	Go to "Sensor (input) early/late arriving service check" on page 92.
200.44	Page from tray 1 did not reach the input sensor (or the manual feed sensor, if present) after multiple pick attempts. Page did make it out of the tray at least as far as the ACM sensor.	Go to <u>"Sensor (input) early/late arriving service</u> check" on page 92.
200.84	Image data did not start on time.	Go to "Sensor (input) image jam service check" on page 94.
200.87	During warm up flush, sheet detected too long over input sensor.	Go to "Sensor (input) early/late arriving service check" on page 92.

Sensor (input) static jam service check

Action	Yes	No
Step 1 Check the input sensor area for jammed media fragments.	Go to step 2.	Clear the paper path of any media fragments.
Is the paper path free of partially fed or jammed media?		
Step 2 Check the jam access cover if it is blocking the input sensor. Is it blocking the input sensor?	Replace the jam access cover. See "Jam access cover removal" on page 278.	Go to step 3.
Step 3	Go to step 4.	Reseat the cable.
Check the input sensor cable for proper connection.		
Is it properly connected?		
Step 4 POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Base Sensor Test > Input. Does the sensor state on the control panel display change when it is toggled?	Go to step 5.	Replace the input sensor. See "Duplex sensor and input sensor removal" on page 290.
Step 5 Does the error remain?	Contact the next level of support.	The problem is solved.

Sensor (input) early/late arriving service check

Action	Yes	No
Step 1	Go to step 2.	Go to step 5.
Check the paper source.		
Is the paper from the MPF?		
Step 2	Go to step 3.	Replace the MPF
Check the MPF pick roller and separator pad for damage and contamination.		pick roller and separator pad. See
Contamination.		"MPF pick roller
Are they free of damage and contamination?		removal" on page 277 and
		"Separator pad
		removal" on
		<u>page 285</u> .

Action	Yes	No
Step 3 Check the MPF solenoid for proper operation: a Remove the left cover. b POR into the Diagnostics menu and perform a feed test: Diagnostics Menu > Input Tray Tests > Feed Test > Multipurpose feeder c Check if the MPF solenoid moves when doing the feed test. Does it move when doing the feed test?	Go to step 4.	Replace the MPF solenoid. See "MPF solenoid removal" on page 229.
Step 4 Make sure the MPF gearbox spring is properly installed and free of damage. Check the MPF gearbox for wear or damage. Are they free of wear or damage?	Go to step 5.	Replace the MPF gearbox. See "MPF gearbox removal" on page 232.
Step 5 Check the input sensor area for jammed media fragments. Is the paper path free of partially fed or jammed media?	Go to step 6.	Clear the paper path of any media fragments.
Step 6 Check the media present sensor and media present sensor flag for: • Proper operation • Wear or damage Do they properly operate, and are they free of wear or damage?	Go to step 7.	Replace either the media present sensor or media present sensor flag, or both. See: • "Media present sensor removal" on page 295 • "Media present sensor flag removal" on page 297
Step 7 Check the jam access cover if it is blocking the input sensor. Is it blocking the input sensor?	Replace the jam access cover. See "Jam access cover removal" on page 278.	Go to step 8.
Step 8 Check the input sensor cable for proper connection.	Go to step 9.	Reseat the cable.
Is it properly connected?		

Action	Yes	No
Step 9 POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Base Sensor Test > Input Does the sensor state on the control panel display change when it is toggled?	Go to step 10.	Replace the input sensor. See "Duplex sensor and input sensor removal" on page 290.
Step 10 Does the error remain?	Contact the next level of support.	The problem is solved.

Sensor (input) image jam service check

Action	Yes	No
Step 1 Check the LSU cables for proper connection.	Go to step 2.	Reseat the cables.
Are they properly connected?		
Step 2 Inspect the LSU cables and connectors.	Go to step 3.	Replace the LSU. See "Laser scanning unit (LSU) removal" on page 313.
Are they free of damage?		
Step 3 Check the input sensor cable for proper connection.	Go to step 4.	Reseat the cable.
Is it properly connected?		
Step 4 POR into the Diagnostics menu and perform a feed test: Diagnostics Menu > Input Tray Tests > Feed Tests > Tray 1	Go to step 5.	Replace the LSU. See "Laser scanning unit (LSU) removal" on page 313.
Does it pass the test?		
Step 5 POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Base Sensor Test > Input Does the sensor state on the control panel display change when it is toggled?	Go to step 6.	Replace the input sensor. See "Duplex sensor and input sensor removal" on page 290.
Step 6 Check the controller board for any damage. Is it free of damage?	Go to step 7.	Replace the controller board. See "Controller board removals" on page 245.
Step 7 Does the error remain?	Contact the next level of support.	The problem is solved.

Main drive motor control jam service check

Action	Yes	No
 Step 1 a Remove the main drive gearbox. b Check the main drive gearbox cable for proper connection. 	Go to step 2.	Reseat the cable.
Is it properly connected?		
 Step 2 a Remove the main drive gearbox. b Check the gears of main drive gearbox for wear or damage. Are they free of wear or damage?	Go to step 3.	Replace the main drive gearbox. See "Main drive gearbox removal" on page 227.
Step 3	Go to step 4.	Replace the main
 Check the main drive motor for proper operation: a Remove the main drive gearbox. Note: Do not disconnect the main drive gearbox cable. b POR into the Diagnostics menu and perform a feed test: Diagnostics menu > Input Tray Tests > Feed Test > Select any input source c Check if the main drive motor rotates when doing the feed test. 		drive gearbox. See "Main drive gearbox removal" on page 227.
Does it rotate when doing the feed test?		
Step 4 Check the fuser gear for damage or toner contamination. Is it free of damage and contamination?	Replace the controller board. See "Controller board removals" on page 245.	Replace the fuser. See "Fuser removal" on page 311.

201 paper jams

Error code	Description	Action
201.01	Narrow media sensor is covered during warm up. Input sensor is not covered.	Go to "Sensor (narrow media) jam service check" on page 96.
201.20	Took too long to ramp up auger motor.	Go to "Cartridge gearbox service check" on page 144.
201.21	Stopped detecting pulses from auger motor's encoder system.	Go to "Cartridge gearbox service check" on page 144.
201.22	Auger motor underspeed error.	Go to "Cartridge gearbox service check" on page 144.

Sensor (narrow media) jam service check

Action	Yes	No
Step 1 Check the narrow media sensor cable JNRW1 for proper connection.	Go to step 2.	Reseat the cable.
Is it properly connected?		
Step 2 POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Base Sensor Test > Narrow Media Does the sensor state on the control panel display change when it is toggled?	Go to step 3.	Replace the narrow media sensor. See "Narrow media/bin full sensor removal" on page 306.
Step 3 Check the redrive rollers for damage. Are they free of damage?	Go to step 4.	Replace the redrive assembly. See "Redrive assembly removal" on page 308.
Step 4 Does the error remain?	Contact the next level of support.	The problem is solved.

202 paper jams

Error code	Description	Action
202.01	Exit sensor is covered during warm up.	Go to "Sensor (fuser exit) jam service check" on page 97.
202.03	Media did not reach the fuser exit sensor.	Go to "Sensor (fuser exit) jam service check" on page 97.
202.05	Exit sensor covered too long or exit sensor did not clear ahead of a sheet.	Go to "Sensor (fuser exit) jam service check" on page 97.
202.13	Restart attempted after an internal jam without cover open. Close event. Likely that the jam was not actually cleared.	Go to <u>"Sensor (fuser exit) jam service check" on page 97</u> .
202.14	Expected banner sheet (assumed wide) not detected by narrow media sensor, possible accordion jam, unsupported narrow banner media, or missing signal.	Go to <u>"Sensor (fuser exit) jam service check" on page 97.</u>
202.16	Page at fuser nip before fuser started ramping toward desired. Indicates code may be receiving more hall interrupts than intended.	Go to <u>"Sensor (fuser exit) jam service check" on page 97</u> .

Error code	Description	Action
202.17	Page at fuser nip before fuser reached acceptable operating temperature. Page arrived at fuser earlier than expected, so it was probably staged.	Go to <u>"Sensor (fuser exit) jam service check" on page 97</u> .
202.22	Cartridge Motor - Motor Underspeed Error. Motor made it to closed loop steady state, but then detected speed was below threshold.	Go to <u>"Sensor (fuser exit) jam service check" on page 97</u> .
202.28	Exit sensor bounce issue.	Go to "Sensor (fuser exit) jam service check" on page 97.
202.32	The sheet is too long to be duplexed. The blow through is enabled.	Go to "Duplex service check" on page 98.
202.36	Long paper or shingled multi feed stopped before sending to duplex.	Go to "Duplex service check" on page 98.
202.43	During warm up flush, media that passed the input sensor failed to reach the exit sensor.	Go to "Sensor (fuser exit) jam service check" on page 97.
202.45	During warm up flush, sheet detected too long over exit sensor.	Go to "Sensor (fuser exit) jam service check" on page 97.

Sensor (fuser exit) jam service check

Action	Yes	No
Step 1 Check the input sensor area for jammed media fragments.	Go to step 2.	Clear the paper path of any media fragments.
Is the paper path free of partially fed or jammed media?		
Step 2 Check the fuser exit sensor cable JEXIT1 for proper connection.	Go to step 3.	Reseat the cable.
Is it properly connected?		
Step 3 POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Base Sensor Test > Exit	Go to step 4.	Replace the fuser. See <u>"Fuser</u> removal" on page 311.
Does the sensor state on the control panel display change when it is toggled?		
Step 4 Check the fuser gears and rollers for damage. Are they free of damage?	Go to step 5.	Replace the fuser. See <u>"Fuser</u> removal" on page 311.
Step 5 Does the error remain?	Contact the next level of support.	The problem is solved.

23y paper jams

23y paper jam messages

Error code	Description	Action
230.01	Sheet covering internal duplex sensor during warm up.	Go to "Duplex service check" on page 98.
230.02	Paper jam around internal duplex.	Go to "Duplex service check" on page 98.
230.03	Internal duplex sensor never made by leading edge of page.	Go to "Duplex service check" on page 98.
230.04	Page in duplexer ahead of current reversing page never staged.	Go to "Duplex service check" on page 98.
230.05	Internal duplex sensor never broke on the trailing edge of the sheet.	Go to "Duplex service check" on page 98.
230.07	Internal duplex sensor never broke from sheet ahead of page.	Go to "Duplex service check" on page 98.
230.09	Page in duplexer never picked.	Go to "Duplex service check" on page 98.
230.10	Narrow page reversing into duplexer.	Go to "Duplex service check" on page 98.
230.28	Bouncy duplex sensor never made.	Go to "Duplex service check" on page 98.
232.03	Input sensor never detected sheet from internal duplex path.	Go to "Duplex service check" on page 98.
232.10	Feed error picking from the duplexer.	Go to "Duplex service check" on page 98.

Duplex service check

Action	Yes	No
Step 1 a Remove the rear cover. See "Rear door and cover removal" on page 305. b Check the redrive rollers for wear or damage.	Go to step 2.	Replace the redrive assembly. See "Redrive assembly removal" on page 308.
Are they free of wear or damage?		
a Remove the left cover. See "Left cover removal" on page 226. b POR into the Diagnostics menu and perform a duplex feed test: Diagnostics Menu > Duplex Tests > Duplex Feed 1 c Check the reverse solenoid for proper operation.	Go to step 3.	Replace the reverse solenoid. See "Reverse solenoid removal" on page 235.
Does it function properly?		

Action	Yes	No
Step 3 a Remove the input tray. b From under the printer, check the duplex gear assembly and duplex link for wear and damage. Are the they free of wear and damage?	Go to step 4.	Replace the duplex gear assembly. See "Duplex gear assembly removal" on page 237.
Step 4 From under the printer, check the duplex, belt, and roller for wear and damage. Are they free of wear and damage?	Go to step 5.	Replace the duplex. See "Duplex removal" on page 289.
Step 5 a Remove the input tray. b POR into the Diagnostics menu and perform a duplex sensor test: Diagnostics Menu > Duplex Tests > Sensor Test c Lower the duplex jam door, and toggle the duplex sensor. Does the sensor state on the control panel display change when it is toggled?	Go to step 6.	Replace the duplex sensor. See "Duplex sensor and input sensor removal" on page 290.
Step 6 Does the error remain?	Contact the next level of support.	The problem is solved.

241 paper jams

Error code	Description	Action
241.01	Paper over tray 1 pass through sensor on warmup.	Go to "Tray 1 jam service check" on page 101.
241.02	Sensor (input) early arriving jam.	Go to "Tray 1 jam service check" on page 101.
241.03	Tray 1 pass through sensor never became covered when feeding a sheet from an option below.	Go to "Tray 1 jam service check" on page 101.
241.05	Option tray 1 pass through sensor never became uncovered when feeding a sheet from an option below.	Go to "Tray 1 jam service check" on page 101.
241.06	Failed to pick from tray 1. Exhausted all pick retries. Paper present sensing indicated media is in the tray.	Go to <u>"24x.06 service check" on page 102</u> .
241.14	The media is late reaching the sensor (input) within the specified time from tray 1.	Go to "Tray 1 jam service check" on page 101.
241.15	Media tray 1, tray pulled jam.	Go to "Tray 1 jam service check" on page 101.

Error code	Description	Action
241.16	The engine timed out waiting for the tray 1 to report 'ready' before the 1st pick attempt.	Go to "Tray 1 jam service check" on page 101.
241.17	Page was not properly picked from tray 1. Have not exhausted all pick retry attempts as there are sheets committed to the paper path from below.	Go to <u>"Tray 1 jam service check" on page 101</u> .
241.20	Took too long to ramp up media feeder motor in tray 1.	Go to <u>"Tray 1 jam service check" on page 101</u> .
241.21	Media feeder motor stall in tray 1.	Go to "Tray 1 jam service check" on page 101.
241.22	Media feeder motor pick motor underspeed in tray 1.	Go to "Tray 1 jam service check" on page 101.
241.24	Media feeder motor stalled on the last pick attempt in tray 1.	Go to "Tray 1 jam service check" on page 101.
241.29	Tray 1 lift plate failed to make the index sensor while elevating.	Go to <u>"Tray 1 jam service check" on page 101</u> .
241.32	Media tray not ready.	Go to "Tray 1 jam service check" on page 101.
241.33	The media tray was pulled during the media pick process.	Go to "Tray 1 jam service check" on page 101.
241.41	Media feeder motor stall in tray 1.	Go to "Tray 1 jam service check" on page 101.
241.42	Media feeder motor pick motor under-speed in tray 1.	Go to "Tray 1 jam service check" on page 101.
241.43	Media feeder motor stalled on the last pick attempt in tray 1.	Go to "Tray 1 jam service check" on page 101.
241.44	Motor 2 (Separator/Passthrough) motor stalled.	Go to "Tray 1 jam service check" on page 101.
241.45	Motor 2 (Separator/Passthrough) motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to <u>"Tray 1 jam service check" on page 101</u> .
241.46	Motor 2 (Separator/Passthrough) motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Tray 1 jam service check" on page 101.
241.47	Motor 3 motor stalled.	Go to "Tray 1 jam service check" on page 101.
241.48	Motor 3 motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Tray 1 jam service check" on page 101.
241.49	Motor 3 motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Tray 1 jam service check" on page 101.

Tray 1 jam service check

Action	Yes	No
Step 1	Replace the index	Go to step 2.
Restart the printer.	sensor.	
Does it fail to complete the POST sequence and display a 241.xx error?		
Step 2	Go to step 3.	Replace the pick
Check the pick tires.		tires.
Are they free of wear or damage?		
Step 3	Go to step 4.	Replace the
Check the separator roll assembly.		separator roll assembly. See
Is it free of wear or damage?		"Separator roll
		assembly removal" on page 316.
Step 4	Go to step 5.	Replace the tray
Check the tray guides and lift plate gear.		insert.
Are they free of wear or damage?		
Step 5	Go to step 6.	Replace the front
Check the front input guide.		input guide. See "Front input guide
Is it free of damage?		removal" on
		page 283.
Step 6	Go to step 8.	Go to step 7.
 a POR into the Diagnostics menu and perform a feed test: Diagnostics Menu > Input Tray Tests > Feed Test > Tray 1 > 		
Continuous		
b Cancel the test after five pages.		
Does the printer successfully feed the five pages into the output		
bin?		
Step 7	Go to step 8.	Replace the trailing
Observe the location of the jammed paper.		edge sensor. See <u>"Trailing edge</u>
Are the first page fed to the output bin, the second page jammed		sensor removal" on page 297.
in the rear door, and the third page jammed in the input tray?		
Step 8	Go to step 9.	The problem is solved.
Perform a tray 1 pick/lift motor gearbox service check. See <u>"Tray 1 pick/lift motor gearbox service check" on page 143</u> .		Joived.
Does the error remain?		

Action	Yes	No
Step 9 Check the ACM assembly. Is it free of wear or damage?	Go to step 10.	Replace the ACM assembly. See <u>"ACM assembly removal"</u> on page 301.
Step 10	Go to step 11.	Replace the MPF
Check the MPF gearbox.	Oo to step 11.	gearbox. See <u>"MPF</u> gearbox removal"
Is it free of wear or damage?		<u>on page 232</u> .
Step 11 Check the main drive gearbox.	Go to step 12.	Replace the main drive gearbox. See "Main drive gearbox
Is it free of wear or damage?		removal" on page 227.
 Step 12 a Make sure that the media present sensor and flag are properly installed. b Check the sensor and flag. Are they free of damage?	Go to step 13.	Replace the media present sensor or flag. See "Media present sensor removal" on page 295 or "Media present sensor flag removal" on page 297.
Step 13	Contact the next	The problem is
Does the error remain?	level of support.	solved.

24x.06 service check

Action	Yes	No
Step 1 Check the paper for damage, moisture, or waviness. Replace with new paper if necessary.	Go to step 2.	The problem is solved.
Does the problem remain?		
Step 2 Make sure that the paper tray guides are properly set, and adjust if necessary. Does the problem remain?	Go to step 3.	The problem is solved.
Step 3 Check the pick tires for debris or wear, and replace if necessary. Does the problem remain?	Go to step 4.	The problem is solved.

Action	Yes	No
Step 4 Check the media present flag for damage, and replace if necessary.	Go to step 5.	The problem is solved.
Does the problem remain?		
Step 5 Check the ACM cable at the JACM1 connector on the controller board for proper connection.	See <u>"Tray 1 jam</u> <u>service check" on</u> <u>page 101</u> .	The problem is solved.
Does the problem remain?		

242–244 paper jams

Error code	Description	Action
242.01	Paper over tray 2 pass through sensor on warmup.	Go to "Option tray jam service check" on page 108.
242.02	Input sensor detected late feed during a pick retry from tray 2.	Go to "Option tray jam service check" on page 108.
242.03	Tray 2 pass through sensor never became covered when feeding a sheet from an option below.	Go to "Option tray jam service check" on page 108.
242.05	Option tray 2 pass through sensor never became uncovered when feeding a sheet from an option below.	Go to "Option tray jam service check" on page 108.
242.06	Failed to feed from Tray 2. Paper present sensing indicates media is in the tray.	Go to <u>"24x.06 service check" on page 102</u> .
242.09	Tray 2 pick motor lost encoder.	Go to "Option tray jam service check" on page 108.
242.11	Autocomp Pick/Lift Motor—Encoder Never Detected in tray 2.	Go to "Option tray jam service check" on page 108.
242.12	Motor ramp up error in tray 2.	Go to "Option tray jam service check" on page 108.
242.14	Sheets flushed from paper path either due to feed error or cartridge error.	Go to "Option tray jam service check" on page 108.
242.15	One or more trays located above the source tray 2 has been pulled.	Go to "Option tray jam service check" on page 108.
242.16	The engine timed out waiting for the tray 2 to report ready before the 1st pick attempt.	Go to "Option tray jam service check" on page 108.

Error code	Description	Action
242.17	Page was not properly picked from tray 2. Have not exhausted all pick retry attempts as there are sheets committed to the paper path from below.	Go to "Option tray jam service check" on page 108.
242.19	Tray 2 fail to feed error. Detected while trying to pick a sheet, and that leading edge was not detected by tray sensor.	Go to "Option tray jam service check" on page 108.
242.20	Took too long to ramp up dc feed motor in tray 2.	Go to "Option tray jam service check" on page 108.
242.21	Pick motor stall in tray 2.	Go to "Option tray jam service check" on page 108.
242.22	Tray 2 pick motor underspeed.	Go to "Option tray jam service check" on page 108.
242.24	DC Feed autocompensator stalled on the last pick attempt in tray 2.	Go to "Option tray jam service check" on page 108.
242.32	Tray not ready.	Go to "Option tray jam service check" on page 108.
242.33	Pick received but detected a tray pulled.	Go to "Option tray jam service check" on page 108.
242.41	Motor 1 (Pick/Lift) Elevator motor stalled.	Go to "Option tray jam service check" on page 108.
242.42	Motor 1 (Pick/Lift) Elevator motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Option tray jam service check" on page 108.
242.43	Motor 1 (Pick/Lift) motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.
242.44	Motor 2 (Separator/Passthrough) motor stalled.	Go to "Option tray jam service check" on page 108.
242.45	Motor 2 (Separator/Passthrough) motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to <u>"Option tray jam service check" on page 108</u> .
242.46	Motor 2 (Separator/Passthrough) motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.
242.47	Motor 3 motor stalled.	Go to "Option tray jam service check" on page 108.
242.48	Motor 3 motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Option tray jam service check" on page 108.
242.49	Motor 3 motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.

Error code	Description	Action
243.01	Paper over tray 3 pass through sensor on warmup.	Go to "Option tray jam service check" on page 108.
243.02	Input sensor detected late feed during a pick retry from tray 3.	Go to "Option tray jam service check" on page 108.
243.03	Tray 3 pass through sensor never became covered when feeding a sheet from an option below.	Go to <u>"Option tray jam service check" on page 108</u> .
243.05	Option tray 3 pass through sensor never became uncovered when feeding a sheet from an option below.	Go to <u>"Option tray jam service check" on page 108</u> .
243.06	Failed to feed from tray. Paper present sensing supported and indicates media still in tray.	Go to <u>"24x.06 service check" on page 102</u> .
243.07	Option tray 3 pass through sensor never became uncovered when feeding a sheet from an option below.	Go to <u>"Option tray jam service check" on page 108</u> .
243.09	Tray 3 pick motor lost encoder.	Go to <u>"Option tray jam service check" on page 108</u> .
243.11	Autocomp Pick / Lift Motor - Encoder never detected in tray 3.	Go to "Option tray jam service check" on page 108.
243.12	Motor ramp up error in tray 3.	Go to "Option tray jam service check" on page 108.
243.14	Sheets flushed from paper path either due to feed error or cartridge error.	Go to "Option tray jam service check" on page 108.
243.15	One or more trays located above the source tray 3 has been pulled.	Go to "Option tray jam service check" on page 108.
243.16	The engine timed out waiting for the tray 3 to report 'ready' before the 1st pick attempt.	Go to "Option tray jam service check" on page 108.
243.17	Page was not properly picked from tray 3. Have not exhausted all pick retry attempts as there are sheets committed to the paper path from below.	Go to <u>"Option tray jam service check" on page 108</u> .
243.19	Tray 3 fail to feed error. Detected while trying to pick a sheet, and that leading edge was not detected by tray sensor.	Go to "Option tray jam service check" on page 108.
243.20	Took too long to ramp up dc feed motor in tray 3.	Go to "Option tray jam service check" on page 108.
243.21	Pick motor stall in tray 3.	Go to "Option tray jam service check" on page 108.
243.22	Tray 3 pick motor underspeed.	Go to "Option tray jam service check" on page 108.
243.24	DC Feed autocompensator stalled on the last pick attempt in tray 3.	Go to "Option tray jam service check" on page 108.

Error code	Description	Action
243.32	Tray not ready.	Go to "Option tray jam service check" on page 108.
243.33	Pick received but detected a tray pulled.	Go to "Option tray jam service check" on page 108.
243.41	Motor 1 (Pick/Lift) Elevator motor stalled.	Go to "Option tray jam service check" on page 108.
243.42	Motor 1 (Pick/Lift) Elevator motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Option tray jam service check" on page 108.
243.43	Motor 1 (Pick/Lift) motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.
243.44	Motor 2 (Separator/Passthrough) motor stalled.	Go to "Option tray jam service check" on page 108.
243.45	Motor 2 (Separator/Passthrough) motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Option tray jam service check" on page 108.
243.46	Motor 2 (Separator/Passthrough) motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.
243.47	Motor 3 motor stalled.	Go to "Option tray jam service check" on page 108.
243.48	Motor 3 motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Option tray jam service check" on page 108.
243.49	Motor 3 motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.

Error code	Description	Action
244.01	Paper over tray 4 pass thru sensor on warmup.	Go to "Option tray jam service check" on page 108.
244.02	Input sensor detected late feed during a pick retry from tray 4.	Go to "Option tray jam service check" on page 108.
244.03	Tray 4 pass thru sensor never became covered when feeding a sheet from an option below.	Go to "Option tray jam service check" on page 108.
244.06	Failed to feed from tray. Paper present sensing supported and indicates media still in tray.	Go to "24x.06 service check" on page 102.
244.07	Option tray 4 pass thru sensor never became uncovered when feeding a sheet from an option below.	Go to "Option tray jam service check" on page 108.

Error code	Description	Action
244.09	Tray 4 pick motor lost encoder.	Go to "Option tray jam service check" on page 108.
244.11	Autocomp Pick / Lift Motor - Encoder Never Detected in tray 4.	Go to "Option tray jam service check" on page 108.
244.12	Motor ramp up error in tray 4.	Go to "Option tray jam service check" on page 108.
244.13	Page to be stapled failed to feed from tray.	Go to "Option tray jam service check" on page 108.
244.14	Sheets flushed from paper path either due to feed error or cartridge error.	Go to "Option tray jam service check" on page 108.
244.15	One or more trays located above the source tray 4 has been pulled.	Go to "Option tray jam service check" on page 108.
244.16	The engine timed out waiting for the tray 4 to report 'ready' before the 1st pick attempt.	Go to "Option tray jam service check" on page 108.
244.17	Page was not properly picked from tray 4. Have not exhausted all pick retry attempts as there are sheets committed to the paper path from below.	Go to "Option tray jam service check" on page 108.
244.19	Tray 4 fail to feed error. Detected while trying to pick a sheet, and that leading edge was not detected by tray sensor.	Go to "Option tray jam service check" on page 108.
244.20	Took too long to ramp up dc feed motor in tray 4.	Go to "Option tray jam service check" on page 108.
244.21	Pick motor stall in tray 4.	Go to "Option tray jam service check" on page 108.
244.22	Tray 4 pick motor underspeed.	Go to "Option tray jam service check" on page 108.
244.24	DC Feed autocompensator stalled on the last pick attempt in tray 4.	Go to "Option tray jam service check" on page 108.
244.32	Tray not ready.	Go to "Option tray jam service check" on page 108.
244.33	Pick received but detected a tray pulled.	Go to "Option tray jam service check" on page 108.
244.41	Motor 1 (Pick/Lift) Elevator motor stalled.	Go to "Option tray jam service check" on page 108.
244.42	Motor 1 (Pick/Lift) Elevator motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to <u>"Option tray jam service check" on page 108</u> .
244.43	Motor 1 (Pick/Lift) motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to <u>"Option tray jam service check" on</u> page 108.
244.44	Motor 2 (Separator/Passthru) motor stalled.	Go to "Option tray jam service check" on page 108.

Error code	Description	Action
244.45	Motor 2 (Separator/Passthru) motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Option tray jam service check" on page 108.
244.46	Motor 2 (Separator/Passthru) motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.
244.47	Motor 3 motor stalled.	Go to "Option tray jam service check" on page 108.
244.48	Motor 3 motor PWM overflow error (underspeed). Motor underspeed (max PWM and motor underspeed, typical accordion jam).	Go to "Option tray jam service check" on page 108.
244.49	Motor 3 motor ramp (end ramp - did not reach speed, typical pack feed paper jam).	Go to "Option tray jam service check" on page 108.

Option tray jam service check

Action	Yes	No
Step 1 Restart the printer.	Replace the option tray.	Go to step 2.
Does it fail to complete the POST sequence and display a 242.01 error?		
a POR into the Diagnostics menu and perform a feed test: Diagnostics Menu > Input Tray Tests > Feed Test > Select an option tray > Continuous Cancel the test after five pages. Does the printer successfully feed the five pages into the output bin?	The problem is solved.	Go to step 3.
Step 3 Does the printer display a 242.06 error?	Replace the ACM assembly. See <u>"ACM assembly removal"</u> on page 318.	Go to step 4.
Step 4 Check the pick roller assembly. Is it free of wear or damage?	Go to step 5.	Replace the pick roller assembly. See "Pick roller removal" on page 315.

Action	Yes	No
Step 5 Check the separator roll assembly. Is it free of wear or damage?	Go to step 6.	Replace the separator roll assembly. See "Separator roll
, and the second		assembly removal" on page 316.
Step 6	Go to step 7.	Replace the tray
Check the tray guides, lift plate, and lift plate gears.		insert.
Are they free of wear or damage?		
Step 7	Go to step 8.	Replace the ACM
Check the ACM assembly.		assembly. See <u>"ACM</u> assembly removal"
Is it free of wear or damage?		on page 318.
Step 8	Go to step 9.	Replace the option
POR into the Diagnostics menu and perform a feed test:		tray.
Diagnostics Menu > Input Tray Tests > Feed Test > Select an option tray		
Does the pick/lift motor gearbox pass the test?		
Step 9	Contact the next	The problem is
Does the error remain?	level of support.	solved.

25y paper jams

250 paper jam messages

Error code	Description	Action
250.06	Input sensor did not detect sheet picked from MPF. No other sheets should be in the path.	Go to "MPF service check" on page 110.

MPF service check

Action	Yes	No
Step 1 Check the springs, links, and tray guides on the MPF assembly for damage. Are they free of damage?	Go to step 2.	Replace the MPF assembly. See "MPF assembly removal" on page 274.
Step 2 a Make sure the MPF sensor cable is properly connected to the controller board. b POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Input Tray Tests > Sensor Tests > Multi-Purpose Feeder Does the sensor state on the control panel display change when it is toggled?	Go to step 3.	Replace the front input guide. See "Front input guide removal" on page 283.
Step 3 Make sure the MPF pick roller and separator pad are free of debris. Check both for wear or damage. Are they free of damage?	Go to step 4.	Replace the MPF pick roller and separator pad. See "MPF pick roller removal" on page 277 and "Separator pad removal" on page 285.
Step 4 a Remove the left cover. b POR into the Diagnostics menu and perform a feed test: Diagnostics Menu > Input Tray Tests > Feed Tests > Multi-Purpose Feeder c Check the MPF solenoid for proper operation. Does it function properly?	Go to step 5.	Replace the MPF solenoid. See "MPF solenoid removal" on page 229.
Step 5 a Make sure the MPF gearbox is free of debris. b Check the gears and spring of the MPF gearbox for wear or damage. Are they free of damage?	Go to step 6.	Replace the MPF gearbox. See "MPF gearbox removal" on page 232.
Step 6 Does the error remain?	Contact the next level of support.	The problem is solved.

Understanding the printer messages

Cartridge, imaging unit mismatch [41.xy]

1 Check if the toner cartridge and imaging unit are both *MICR* (Magnetic Imaging Content Recording) or non-MICR supplies.

Note: For a list of supported supplies, see the "Ordering supplies" section of the *User's Guide* or visit **www.lexmark.com**.

2 Change the toner cartridge or imaging unit so that both are MICR or non-MICR supplies.

Notes:

- Use MICR toner cartridge and imaging unit for printing checks and other similar documents.
- Use non-MICR toner cartridge and imaging unit for regular print jobs.

Cartridge low [88.xy]

You may need to order a toner cartridge. If necessary, select **Continue** on the printer control panel to clear the message and continue printing. For non-touch-screen printer models, press or to confirm.

Cartridge nearly low [88.xy]

If necessary, select **Continue** on the printer control panel to clear the message and continue printing. For non-touch-screen printer models, press ot confirm.

Cartridge very low, [x] estimated pages remain [88.xy]

You may need to replace the toner cartridge very soon. For more information, see the "Replacing supplies" section of the *User's Guide*.

If necessary, select **Continue** on the printer control panel to clear the message and continue printing. For non-touch-screen printer models, press or to confirm.

Change [paper source] to [custom type name] load [orientation]

Try one or more of the following

- Load the correct paper size and type in the tray, verify the paper size and type settings are specified in the Paper menu on the printer control panel, and then select Finished changing paper. For non-touch-screen printer models, press of to confirm.
- Cancel the print job.

Change [paper source] to [custom string] load [paper orientation]

Try one or more of the following:

- Load the correct size and type of paper in the tray, then verify that the paper size and type settings are specified in the Paper menu on the printer control panel, and then select **Finished changing paper**.
 - For non-touch-screen printer models, press oK to confirm
- Cancel the print job.

Change [paper source] to [paper size] load [orientation]

Try one or more of the following:

- Load the correct paper size and type in the tray, verify the paper size and type settings are specified
 in the Paper menu on the printer control panel, and then select **Finished changing paper**. For
 non-touch-screen printer models, press or to confirm.
- Cancel the print job.

Change [paper source] to [paper type] [paper size] load [orientation]

Try one or more of the following:

- Load the correct paper size and type in the tray, verify the paper size and type settings are specified
 in the Paper menu on the printer control panel, and then select **Finished changing paper**. For
 non-touch-screen printer models, press or to confirm.
- Cancel the print job.

Close front door

Close the front door of the printer.

Complex page, some data may not have printed [39]

Try one or more of the following:

- From the printer control panel, select **Continue** to ignore the message and continue printing. For non-touch-screen printer models, press oK to confirm.
- Cancel the current print job. For non-touch-screen printer models, press ok to confirm.
- Install additional printer memory.

Configuration change, some held jobs were not restored [57]

Held jobs are invalidated because of any of the following possible changes in the printer:

- The printer firmware has been updated.
- The tray for the print job is removed.

- The print job is sent from a flash drive that is no longer attached to the USB port.
- The printer hard disk contains print jobs that were stored when the hard disk was installed in a different printer model.

From the printer control panel, select **Continue** to clear the message. For non-touch-screen printer models, press of to confirm.

Defective flash detected [51]

Try one or more of the following:

- Replace the defective flash memory card.
- From the printer control panel, select **Continue** to ignore the message and continue printing. For non-touch-screen printer models, press of to confirm.
- Cancel the current print job.

Error reading USB drive. Remove USB.

An unsupported USB device is inserted. Remove the USB device, and then insert a supported one.

Error reading USB hub. Remove hub.

An unsupported USB hub has been inserted. Remove the USB hub, and then install a supported one.

Imaging unit low [84.xy]

You may need to order an imaging unit. If necessary, select **Continue** on the printer control panel to clear the message and continue printing. For non-touch-screen printer models, press OK to confirm.

Imaging unit nearly low [84.xy]

If necessary, select **Continue** on the printer control panel to clear the message and continue printing. For non-touch-screen printer models, press ot confirm.

Imaging unit very low, [x] estimated pages remain [84.xy]

You may need to replace the imaging unit very soon. For more information, see the "Replacing supplies" section of the *User's Guide*.

If necessary, select **Continue** on the printer control panel to clear the message and continue printing. For non-touch-screen printer models, press ot confirm.

Incorrect paper size, open [paper source] [34]

Try one or more of the following:

- Load the correct size of paper in the tray.
- From the printer control panel, select **Continue** to clear the message and print using a different tray.

 For non-touch-screen printer models, press of to confirm.
- Check the tray length and width guides and make sure the paper is loaded properly in the tray.
- Make sure the correct paper size and type are specified in the Printing Preferences or in the Print dialog.
- Make sure the paper size and type are specified in the Paper menu on the printer control panel.
- Make sure that the paper size is correctly set. For example, if MP Feeder Size is set to Universal, then make sure the paper is large enough for the data being printed.
- Cancel the print job.

Insert Tray [x]

Insert the indicated tray into the printer.

Insufficient memory to support Resource Save feature [35]

Install additional printer memory or select **Continue** on the printer control panel to disable Resource Save, clear the message, and continue printing. For non-touch-screen printer models, press or to confirm.

Insufficient memory to collate job [37]

Try one or more of the following:

- From the printer control panel, select **Continue** to print the part of the job already stored and begin collating the rest of the print job. For non-touch-screen printer models, press of to confirm.
- Cancel the current print job.

Insufficient memory for Flash Memory Defragment operation [37]

Try one or more of the following:

- From the printer control panel, select **Continue** to stop the defragmentation and continue printing. For non-touch-screen printer models, press or to confirm.
- Delete fonts, macros, and other data from the printer memory.
- Install additional printer memory.

Insufficient memory, some Held Jobs were deleted [37]

The printer deleted some held jobs in order to process current jobs.

Select **Continue** to clear the message. For non-touch-screen printer models, press ot ocnfirm.

Insufficient memory, some held jobs will not be restored [37]

Try one or more of the following:

- From the printer control panel, select Continue to clear the message. For non-touch-screen printer models, press ok to confirm.
- Delete other held jobs to free up additional printer memory.

Load [paper source] with [custom string] [paper orientation]

Try one or more of the following:

- Load the tray or feeder with the correct size and type of paper.
- To use the tray that has the correct size or type of paper, select Finished loading paper on the printer control panel. For non-touch-screen printer models, press ok to confirm.

Note: If the printer finds a tray that has the correct size and type of paper, then it feeds from that tray. If the printer cannot find a tray that has the correct size and type of paper, then it prints from the default paper source.

Cancel the current job.

Load [paper source] with [custom type name] [paper orientation]

Try one or more of the following:

- Load the tray or feeder with the correct size and type of paper.
- To use the tray that has the correct size or type of paper, select **Finished loading paper** on the printer control panel. For non-touch-screen printer models, press oK to confirm.

Note: If the printer finds a tray that has the correct size and type of paper, then it feeds from that tray. If the printer cannot find a tray that has the correct size and type of paper, then it prints from the default paper source.

• Cancel the current job.

Load [paper source] with [paper size] [paper orientation]

Try one or more of the following:

- Load the tray or feeder with the correct size of paper.
- To use the tray or feeder that has the correct size of paper, select Finished loading paper on the printer control panel. For non-touch-screen printer models, press of to confirm.

Note: If the printer finds a tray that has the correct size and type of paper, then it feeds from that tray. If the printer cannot find a tray that has the correct size and type of paper, then it prints from the default paper source.

Cancel the current job.

Load [paper source] with [paper type] [paper size] [paper orientation]

Try one or more of the following:

- Load the tray or feeder with the correct size and type of paper.
- To use the tray or feeder that has the correct size and type of paper, select **Finished loading paper** on the printer control panel. For non-touch-screen printer models, press oK to confirm.

Note: If the printer finds a tray that has the correct size and type of paper, then it feeds from that tray. If the printer cannot find a tray that has the correct size and type of paper, then it prints from the default paper source.

• Cancel the current job.

Load manual feeder with [custom type name] [paper orientation]

Try one or more of the following:

- Load the multipurpose feeder with the correct size and type of paper.
- Depending on your printer model, touch **Continue** or press of to clear the message and continue printing.

Note: If no paper is loaded in the feeder when **Continue** or is selected, then the printer manually overrides the request, and then prints from an automatically selected tray.

• Cancel the current job.

Load manual feeder with [custom string] [paper orientation]

Try one or more of the following:

- Load the feeder with the correct size and type of paper.
- Depending on your printer model, touch **Continue** or press of to clear the message and continue printing.

Note: If no paper is loaded in the feeder when **Continue** or is selected, then the printer automatically overrides the request, and then prints from an automatically selected tray.

Cancel the current job.

Load manual feeder with [paper size] [paper orientation]

Try one or more of the following:

- Load the multipurpose feeder with the correct size of paper.
- Depending on your printer model, touch **Continue** or press of to clear the message and continue printing.

Note: If no paper is loaded in the feeder when **Continue** or is selected, then the printer manually overrides the request, and then prints from an automatically selected tray.

• Cancel the current job.

Load manual feeder with [paper type] [paper size] [paper orientation]

Try one or more of the following:

- Load the multipurpose feeder with the correct size and type of paper.
- Depending on your printer model, touch **Continue** or press of to clear the message and continue printing.

Note: If no paper is loaded in the feeder when **Continue** or is selected, then the printer manually overrides the request, and then prints from an automatically selected tray.

• Cancel the current job.

Maintenance kit low [80.xy]

You may need to order a maintenance kit. For more information, contact customer support at http://support.lexmark.com or your service representative. If necessary, select **Continue** to clear the message and continue printing. For non-touch-screen printer models, press to confirm.

Maintenance kit nearly low [80.xy]

For more information, contact customer support at http://support.lexmark.com or your service representative. If necessary, select **Continue** to clear the message and continue printing. For non-touch-screen printer models, press to confirm.

Maintenance kit very low, [x] estimated pages remain [80.xy]

You may need to replace the maintenance kit very soon. For more information, contact customer support at http://support.lexmark.com or your service representative.

If necessary, select **Continue** on the printer control panel to clear the message and continue printing. For non-touch-screen printer models, press or to confirm.

Memory full [38]

Try one or more of the following:

- From the printer control panel, select Cancel job to clear the message. For non-touch-screen printer models, press OK to confirm.
- Install additional printer memory.

Network [x] software error [54]

Try one or more of the following:

- From the printer control panel, select Continue to continue printing. For non-touch-screen printer models, press OK to confirm.
- Turn off the printer, wait for about 10 seconds, and then turn the printer back on.
- Update the network firmware in the printer or print server. For more information, contact customer support.

Non-Lexmark [supply type], see User's Guide [33.xy]

Note: The supply type can be toner cartridge or imaging unit.

The printer has detected a non-Lexmark supply or part installed in the printer.

Your Lexmark printer is designed to function best with genuine Lexmark supplies and parts. Use of third-party supplies or parts may affect the performance, reliability, or life of the printer and its imaging components.

All life indicators are designed to function with Lexmark supplies and parts and may deliver unpredictable results if third-party supplies or parts are used. Imaging component usage beyond the intended life may damage your Lexmark printer or associated components.

Warning—Potential Damage: Use of third-party supplies or parts can affect warranty coverage. Damage caused by the use of third-party supplies or parts may not be covered by the warranty.

To accept any and all of these risks and to proceed with the use of non-genuine supplies or parts in your printer, press and hold and the # button on the printer control panel simultaneously for 15 seconds.

For non-touch-screen printer models, press on the printer control panel simultaneously for 15 seconds to clear the message and continue printing.

If you do not wish to accept these risks, then remove the third-party supply or part from your printer, and then install a genuine Lexmark supply or part.

Note: For a list of supported supplies, see the "Ordering supplies" section of the *User's Guide* or visit www.lexmark.com.

Not enough free space in flash memory for resources [52]

Try one or more of the following:

- From the printer control panel, select **Continue** to clear the message and continue printing. For non-touch-screen printer models, press oK to confirm.
- Delete fonts, macros, and other data stored in the flash memory.
- Upgrade to a larger capacity flash memory card.

Note: Downloaded fonts and macros that are not previously stored in the flash memory are deleted.

Printer had to restart. Last job may be incomplete.

From the printer control panel, touch to clear the message and continue printing. For non-touch-screen printer models, press or to confirm.

For more information, visit http://support.lexmark.com or contact customer support.

Reinstall missing or unresponsive cartridge [31.xy]

Try one or more of the following:

- Check if the toner cartridge is missing. If missing, install the toner cartridge.

 For information on installing the cartridge, see the "Replacing supplies" section of the *User's Guide*.
- If the toner cartridge is installed, then remove the unresponsive toner cartridge, and then reinstall it.

Note: If the message appears after reinstalling the supply, then the cartridge is defective. Replace the toner cartridge.

Reinstall missing or unresponsive imaging unit [31.xy]

Try one or more of the following:

- Check if the imaging unit is missing. If missing, install the imaging unit.

 For information on installing the imaging unit, see the "Replacing supplies" section of the *User's Guide*.
- If the imaging unit is installed, then remove the unresponsive imaging unit, and then reinstall it.

Note: If the message appears after reinstalling the supply, then the imaging unit is defective. Replace the imaging unit.

Remove paper from standard output bin

Remove the paper stack from the standard bin. The printer automatically detects paper removal and resumes printing.

If removing the paper does not clear the message, then select **Continue** on the printer control panel. For non-touch-screen printer models, press or to confirm.

Replace cartridge, 0 estimated pages remain [88.xy]

Replace the toner cartridge to clear the message and continue printing. For more information, see the instruction sheet that came with the supply or see the "Replacing supplies" section of the *User's Guide*.

Note: If you do not have a replacement cartridge, then see the "Ordering supplies" section of the *User's Guide* or visit <u>www.lexmark.com</u>.

Replace cartridge, printer region mismatch [42.xy]

Install a toner cartridge that matches the region number of the printer. *x* indicates the value of the printer region. *y* indicates the value of the cartridge region. *x* and *y* can have the following values:

List of printer and toner cartridge regions

Region number	Region
0	Global
1	United States, Canada
2	European Economic Area (EEA), Switzerland
3	Asia Pacific, Australia, New Zealand
4	Latin America
5	Africa, Middle East, rest of Europe
9	Invalid

Notes:

- The x and y values are the .xy of the error code shown on the printer control panel.
- The x and y values must match for printing to continue.

Replace imaging unit, 0 estimated pages remain [84.xy]

Replace the imaging unit to clear the message and continue printing. For more information, see the instruction sheet that came with the supply or see the "Replacing supplies" section of the *User's Guide*.

Note: If you do not have a replacement imaging unit, then see the "Ordering supplies" section of the *User's Guide* or visit **www.lexmark.com**.

Replace maintenance kit, 0 estimated pages remain [80.xy]

Contact customer support at http://support.lexmark.com or your service representative, and then report the message. The printer is scheduled for maintenance.

Replace unsupported cartridge [32.xy]

Remove the toner cartridge, and then install a supported one to clear the message and continue printing. For more information, see the instruction sheet that came with the supply or see the "Replacing supplies" section of the *User's Guide*.

Note: If you do not have a replacement cartridge, then see the "Ordering supplies" section of the *User's Guide* or visit **www.lexmark.com**.

Replace unsupported imaging unit [32.xy]

Remove the imaging unit, and then install a supported one to clear the message and continue printing. For more information, see the instruction sheet that came with the supply or see the "Replacing supplies" section of the *User's Guide*.

Note: If you do not have a replacement imaging unit, then see the "Ordering supplies" section of the *User's Guide* or visit <u>www.lexmark.com</u>.

Serial option [x] error [54]

Try one or more of the following:

- Make sure that the serial cable is properly connected and is the correct one for the serial port.
- Make sure that the serial interface parameters (protocol, baud, parity, and data bits) are set correctly on the printer and computer.
- From the printer control panel, select Continue to continue printing. For non-touch-screen printer models, press OK to confirm.
- Turn off the printer, and then turn it back on.

SMTP server not set up. Contact system administrator.

From the printer control panel, select **Continue** to clear the message. For non-touch-screen printer models, press of to confirm.

Note: If the message appears again, then contact your system support person.

Standard network software error [54]

Try one or more of the following:

- From the printer control panel, select **Continue** to continue printing. For non-touch-screen printer models, press OK to confirm.
- Turn off the printer and then turn it back on.
- Update the network firmware in the printer or print server. For more information, contact customer support.

Standard parallel port disabled [56]

 From the printer control panel, select **Continue** to clear the message. For non-touch-screen printer models, press OK to confirm.

Notes:

- The printer discards any data received through the parallel port.
- Make sure the Parallel Buffer menu is not set to Disabled.

Standard USB port disabled [56]

From the printer control panel, select **Continue** to clear the message. For non-touch-screen printer models, press of to confirm.

Notes:

- The printer discards any data received through the USB port.
- Make sure the USB Buffer menu is not set to Disabled.

Too many flash options installed [58]

- **1** Turn off the printer.
- 2 Unplug the power cord from the electrical outlet.
- **3** Remove the extra flash memory.
- **4** Connect the power cord to a properly grounded electrical outlet.
- **5** Turn the printer back on.

Too many trays attached [58]

- **1** Turn off the printer.
- **2** Unplug the power cord from the electrical outlet.
- **3** Remove the extra trays.
- **4** Connect the power cord to a properly grounded electrical outlet.
- **5** Turn the printer back on.

Unformatted flash detected [53]

Try one or more of the following:

- From the printer control, select **Continue** to stop the defragmentation and continue printing. For non-touch-screen printer models, press ok to confirm.
- Format the flash memory.

Note: If the error message remains, then the flash memory may be defective and need to be replaced.

Unsupported option in slot [x] [55]

- **1** Turn off the printer.
- **2** Unplug the power cord from the electrical outlet.
- **3** Remove the unsupported option card from the printer controller board, and then replace it with a supported card.
- **4** Connect the power cord to a properly grounded electrical outlet.
- **5** Turn the printer back on.

Weblink server not set up. Contact system administrator.

Select **Continue** to clear the message. For non-touch-screen printer models, press ot confirm.

Note: If the message appears again, then contact your system support person.

User attendance messages (0-99.99)

User attendance messages (0-99.99)

Error code	Description	Action
31.21	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.22	Excessive CTLS noise	Go to "Unresponsive imaging unit service check" on page 141.
31.23	Abrupt change detected in CTLS reading	Go to "Unresponsive imaging unit service check" on page 141.
31.25	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.40	Missing or unresponsive toner cartridge	Go to "Unresponsive toner cartridge service check" on page 126.
31.41	Missing or unresponsive toner cartridge	Go to "Unresponsive toner cartridge service check" on page 126.
31.42	Missing or unresponsive toner cartridge	Go to "Unresponsive toner cartridge service check" on page 126.
31.43	Missing or unresponsive toner cartridge	Go to "Unresponsive toner cartridge service check" on page 126.
31.44	Missing or unresponsive toner cartridge	Go to "Unresponsive toner cartridge service check" on page 126.
31.45	Missing or unresponsive toner cartridge	Go to "Unresponsive toner cartridge service check" on page 126.
31.46	Missing or unresponsive toner cartridge	Go to "Unresponsive toner cartridge service check" on page 126.
31.60	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.61	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.62	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.63	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.64	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.65	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.
31.66	Missing or unresponsive imaging unit	Go to "Unresponsive imaging unit service check" on page 141.

Error code	Description	Action
32.01	Unsupported cartridge	Go to <u>"Unsupported toner cartridge service check" on page 126</u> .
32.01	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.05	Printer/supply mismatch. Supply can either be a toner cartridge, imaging unit, or fuser.	Go to <u>"Unsupported toner cartridge service</u> <u>check" on page 126</u> .
32.05	Printer/supply mismatch. Supply can either be a toner cartridge, imaging unit, or fuser.	Go to "Unsupported imaging unit service check" on page 127.
32.08	Unsupported cartridge	Go to <u>"Unsupported toner cartridge service</u> <u>check" on page 126</u> .
32.10	Unsupported cartridge	Go to <u>"Unsupported toner cartridge service</u> <u>check" on page 126</u> .
32.11	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.13	Unsupported cartridge	Go to <u>"Unsupported toner cartridge service check" on page 126</u> .
32.14	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.16	Unsupported cartridge	Go to <u>"Unsupported toner cartridge service check" on page 126</u> .
32.17	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.19	Unsupported cartridge	Go to "Unsupported toner cartridge service check" on page 126.
32.20	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.22	Unsupported cartridge	Go to "Unsupported toner cartridge service check" on page 126.
32.23	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.25	Unsupported cartridge	Go to "Unsupported toner cartridge service check" on page 126.
32.26	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.28	Unsupported cartridge	Go to "Unsupported toner cartridge service check" on page 126.
32.29	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.31	Unsupported cartridge	Go to <u>"Unsupported toner cartridge service</u> check" on page 126.
32.32	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.

Error code	Description	Action
32.34	Unsupported cartridge	Go to "Unsupported toner cartridge service check" on page 126.
32.35	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
32.37	Unsupported cartridge	Go to "Unsupported toner cartridge service check" on page 126.
32.38	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
33.01	Unsupported cartridge	Go to "Unsupported toner cartridge service check" on page 126.
33.02	Unsupported imaging unit	Go to "Unsupported imaging unit service check" on page 127.
34	Media size mismatch (too short or too narrow)	Go to "Media size mismatch service check" on page 129.
35	Res save off deficient memory	Go to "Insufficient memory service check" on page 131.
37	Insufficient collation area	Go to "Insufficient memory service check" on page 131.
38	Memory full	Go to "Insufficient memory service check" on page 131.
41.01	Imaging unit/cartridge mismatch	Go to "Supplies mismatch service check" on page 130.
41.10	Cartridge/imaging unit mismatch	Go to "Supplies mismatch service check" on page 130.
42	Printer/cartridge region mismatch	Go to "Printer/cartridge mismatch service check" on page 127.
52	Flash full	Go to "Flash full service check" on page 131.
54	Network error	Go to "Network service check" on page 170.
80	Maintenance kit	Go to "Maintenance kit service check" on page 132.
84	Imaging unit low	Go to "Imaging unit low service check" on page 132.
88	Toner cartridge low	Go to "Toner cartridge low service check" on page 132.

Unresponsive toner cartridge service check

Action	Yes	No
 Step 1 a Check if the toner cartridge is a supported and genuine Lexmark supply. If not, then replace it. b Make sure that the toner cartridge is properly installed. c Check the toner cartridge, toner cartridge button, and cartridge plunger for damage. Replace if necessary. d Make sure that the latest firmware is installed. 	Go to step 2.	The problem is solved.
Does the problem remain? Step 2 Check the cable JARW1 for proper connection to the controller board.	Go to step 3.	Reseat the cable.
Is it properly connected?	Poplace the	Poplace the tener
Step 3 Check the toner cartridge smart chip contact for damaged pins. Is it free of damage?	Replace the controller board. See "Controller board removals" on page 245.	Replace the toner cartridge smart chip contact. See <u>"Toner cartridge smart chip contact removal" on page 249</u> .

Unsupported toner cartridge service check

Action	Yes	No
 Step 1 a Check if the toner cartridge is a supported and genuine Lexmark supply. If not, then replace it. b Make sure that the toner cartridge is properly installed. c Check the toner cartridge, toner cartridge button, and cartridge plunger for damage. Replace if necessary. d Make sure that the latest firmware is installed. Does the problem remain? 	Go to step 2.	The problem is solved.
Step 2 If this error occurred after replacing the controller board, then restore the printer configuration. See "Restoring the printer configuration after replacing the controller board" on page 203. Does the problem remain?	Contact the next level of support.	The problem is solved.

Printer/cartridge mismatch service check

Action	Yes	No
 Step 1 a Make sure that the printer and toner cartridge belong to the same country or region. If the printer comes from a different country or region, then contact the next level of support to reset the printer. b Check if the toner cartridge is a supported and genuine Lexmark supply. If not, then replace it. c Make sure that the latest firmware is installed. Does the problem remain?	Go to step 2.	The problem is solved.
Step 2 If this error occurred after replacing the controller board, then restore the printer configuration. See "Restoring the printer configuration after replacing the controller board" on page 203. Does the problem remain?	Contact the next level of support.	The problem is solved.

Unsupported imaging unit service check

Action	Yes	No
 Step 1 a Check if the imaging unit is a supported and genuine Lexmark supply. If not, then replace it. b Make sure that the imaging unit is properly installed. c Make sure that the latest firmware is installed. Does the problem remain? 	Go to step 2.	The problem is solved.
Step 2 If this error occurred after replacing the controller board, then restore the printer configuration. See "Restoring the printer configuration after replacing the controller board" on page 203. Does the problem remain?	Contact the next level of support.	The problem is solved.

Imaging unit smart chip contact service check

Action	Yes	No
Step 1	Go to step 2.	The problem is
a Check if the imaging unit is a supported and genuine Lexmark supply. If not, then replace it.		solved.
b Make sure that the imaging unit is properly installed.		
Does the problem remain?		
Step 2	Go to step 3.	Reseat the cables.
Check the cable JARW2 for proper connection to the controller board.		
Is it properly connected?		
Step 3	Replace the	Replace the printer.
Check the imaging unit smart chip contact for damaged pins.	controller board. See "Controller board	
Is it free of damage?	removals" on page 245.	

Toner smart chip compatibility service check

Action	Yes	No
Step 1 Check if the toner cartridge is a supported and genuine Lexmark supply. If not, then replace it.	Go to step 2.	The problem is solved.
Does the error remain?		
Step 2 Update the firmware.	Contact the next level of support.	The problem is solved.
Note: Contact the next level of support for the correct firmware level.		
Does the error remain?		

Imaging chip compatibility service check

Action	Yes	No
Step 1 Check if the imaging unit is a supported and genuine Lexmark supply. If not, then replace it.	Go to step 2.	The problem is solved.
Does the error remain?		
Step 2 Update the firmware.	Contact the next level of support.	The problem is solved.
Note: Contact the next level of support for the correct firmware level.		
Does the error remain?		

Media size mismatch service check

Action	Yes	No
Step 1	Go to step 2.	The problem is
a Make sure the media size setting matches the paper in the tray.		solved.
b Restore the engine settings to their defaults:		
Diagnostics Menu > Printer Setup > Defaults		
c Restore the EP setup settings to their defaults:		
Diagnostics Menu > EP Setup > Defaults		
Does the error remain?		
Step 2	Go to step 3.	Replace the input
Check the input tray for damage.		tray.
Is it free of damage?		
Step 3	Go to step 4.	Replace the index
a Make sure the index sensor is free of debris.		sensor. See <u>"Index</u>
b Check it for damage.		sensor removal" on page 293.
Is it free of damage?		
Step 4	Go to step 5.	Replace the trailing
a Make sure the trailing edge sensor is free of debris.		edge sensor. See
b Check it for damage.		"Trailing edge sensor removal" on
Is it free of damage?		<u>page 297</u> .

Action	Yes	No
Step 5 a Make sure the input sensor is free of debris. b POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Base Sensor Test > Input Does the sensor state on the control panel display change when it is toggled?	Go to step 6.	Replace the input sensor. See "Duplex sensor and input sensor removal" on page 290.
Step 6 POR into the Diagnostics menu and perform a sensor test: Diagnostics Menu > Base Sensor Test > Narrow Media Does the sensor state on the control panel display change when it is toggled?	Go to step 7.	Replace the narrow media/bin full sensor. See "Narrow media/bin full sensor removal" on page 306.
Step 7 a Remove the main drive gearbox. b Check the gears for wear or damage. c Check the main drive motor for rotation. Are the gears free of wear or damage and does the main drive motor rotate?	Go to step 8.	Replace the main drive gearbox. See "Main drive gearbox removal" on page 227.
Step 8 Replace the controller board. Does the error remain?	Problem is solved.	Contact the next level of support.

Supplies mismatch service check

Action	Yes	No
 Step 1 a Check if the toner cartridge and imaging unit are supported and genuine Lexmark supplies. If not, then replace the supplies. b Make sure that the supplies are compatible. Note: Do not install a MICR cartridge with a non-MICR imaging unit or vice versa. c Make sure that the latest firmware is installed. Does the problem remain? 	Go to step 2.	The problem is solved.
Step 2 If this error occurred after replacing the controller board, then restore the printer configuration. See "Restoring the printer configuration after replacing the controller board" on page 203. Does the problem remain?	Contact the next level of support.	The problem is solved.

Insufficient memory service check

Action	Yes	No
Step 1	Go to step 2.	The problem is
Disable the Resource save feature:		solved.
Settings > Print Settings > Setup Menu > Resource Save > Off		
Does the problem remain?		
Step 2	Go to step 3.	Reseat the memory
Check the memory card for proper installation.		card.
Is it properly installed?		
Step 3	Replace the	Replace the memory
a Print the Menu settings page:		card.
Settings > Reports > Menu Settings Page	"Controller board removals" on	
b POR into the Configuration menu and reset the printer's settings to factory default:	page 245.	
Configuration Menu > Factory Defaults > Restore Base		
c Remove the memory card.		
d Restart the printer.		
Does the error remain?		

Flash full service check

Action	Yes	No
Step 1 Format the flash memory. Navigate to Settings > Print Settings > Utilities, then select Format Flash.	Go to step 2.	The problem is solved.
Does the error remain?		
Step 2 Remove the installed memory, and then POR the machine.	Go to step 3.	Replace the memory card.
Does the error remain?		
Step 3 Replace the controller board. See "Controller board removals" on page 245.	Contact the next level of support.	The problem is solved.
Does the error remain?		

Maintenance kit service check

Action	Yes	No
Replace the maintenance kit and reset the Maintenance counter.		The problem is solved.
Does the error remain?		

Imaging unit low service check

Action	Yes	No
Step 1 Replace the imaging unit.	Go to step 2.	The problem is solved.
Does the problem remain?		
Step 2 a Make sure the imaging unit smart chip contact cable is properly connected to the controller board. b Make sure the contacts are free of debris.	Go to step 3.	The problem is solved.
Does the problem remain?		
Step 3 Check the contacts for damaged pins.	Contact the next level of support.	Replace the printer.
Are they free of damage?		

Toner cartridge low service check

Action	Yes	No
Step 1 Replace the toner cartridge.	Go to step 2.	The problem is solved.
Does the problem remain?		
 Step 2 a Make sure the toner cartridge smart chip contact cable JARW1 is properly connected to the controller board. b Make sure the contacts are free of debris. Does the problem remain? 	Go to step 3.	The problem is solved.
Step 3 Check the contacts for damaged pins. Are they free of damage?	Contact the next level of support.	Replace the toner cartridge smart chip contact. See "Toner cartridge smart chip contact removal" on page 249.

Printer hardware errors

111 errors

111 error messages

Notes:

- Some error messages are applicable only to printer models with a polygon LSU (laser scanning unit).
- If the sixth digit character assigned to the serial number of the printer is in the P–Z range, then the printer is installed with a polygon LSU (example: 4514 2ZHH 007CR).

Error code	Description	Action
111.00	Pel clock check failed.	Go to "Laser scanning unit (LSU) service
111.01	Downlevel ASIC detected.	check" on page 135.
111.20	Mirror motor lock is asserted before the motor is turned on.	
	Note: This error is applicable only to printer models installed with a polygon LSU.	
111.30	Failed to identify the printhead.	
	Note: This error is applicable only to printer models installed with a polygon LSU.	
111.31	Printhead never delivered HSYNCs.	
111.32	Printhead lost HSYNCs.	
111.33	Printhead lost HSYNCs during servo.	
	Note: This error is applicable only to printer models installed with a polygon LSU.	

Error code	Description	Action
111.34	Mirror motor lost lock. Note: This is applicable only to printer models installed with a polygon LSU.	Go to "Laser scanning unit (LSU) service check" on page 135.
111.35	Mirror motor was never locked first.	
	Note: This error is applicable only to printer models installed with a polygon LSU.	
111.36	Mirror motor lock was never stabilized.	
	Note: This error is applicable only to printer models installed with a polygon LSU.	
111.37	Page reached input sensor but the mirror motor was not locked.	
	Note: This error is applicable only to printer models installed with a polygon LSU.	
111.38	Page reached input sensor but the printhead startup was not completed.	
	Note: This error is applicable only to printer models installed with a polygon LSU.	
111.40	Wrong printhead installed.	Go to "Laser scanning unit (LSU) service
111.50	Open-loop printhead error, open-loop sweep state.	check" on page 135.
111.51	Open-loop printhead error, open-loop sweep state.	
111.52	Open-loop printhead error, check prelim amp state.	
111.53	Open-loop printhead error, enable amp Kp state.	
111.54	Closed-loop printhead error, amp Kp failed to converge.	
111.55	Closed-loop printhead error while waiting for amp Kp to converge.	
111.56	Closed-loop printhead error, amp Ki failed to converge.	
111.57	Closed-loop printhead error while waiting for amp Ki to converge.	
111.58	Closed-loop printhead error, load scan regs state.	
111.59	Closed-loop printhead error, forward and reverse capture times differ by too much.	

Error code	Description	Action
111.60	Closed-loop printhead sweep error, check sweep accuracy state.	Go to "Laser scanning unit (LSU) service check" on page 135.
111.61	Printhead drive control out of range due to an external event beyond what the control is designed to handle.	
111.62	Closed-loop printhead error, off-resonant PI effort state.	
111.63	Timed out on POR sweep.	
111.64	Attempted to exceed open loop drive limits.	
111.65		
111.66	Failed alignment of printhead.	
111.67	Attempted to exceed open loop drive limits.	
111.68	Too many fake HSYNCs while aligning printhead.	
111.69	Attempted to exceed open loop drive limits.	

Laser scanning unit (LSU) service check

Action	Yes	No
Step 1	Go to step 3.	Go to step 2.
Make sure that the LSU and controller board are compatible.		
 Check the serial number of the printer to determine whether the LSU is galvo or polygon. The LSU is galvo if the sixth digit character assigned is in the 0–9 or B–N range (example: 4514 20HH 007CR). It is polygon if the sixth digit character assigned is in the P–Z range (example: 4514 2ZHH 007CR). 		
Note: Galvo and polygon LSU parts are not interchangeable.		
 Check the color of the controller board. For galvo LSU, the color of the compatible controller board is green. For polygon LSU, the color is blue. 		
Are the LSU and controller board compatible?		
Step 2	Go to step 3.	The problem is
Replace the LSU or controller board with a compatible one.		solved.
Installation note: Mechanical and electronic LSU adjustments are required to complete the installation of the LSU. See "Printhead assembly adjustments" on page 223.		
Does the problem remain?		

Action	Yes	No
Step 3 Reseat the cables and connector between the LSU and controller board.	Go to step 4.	The problem is solved.
Does the problem remain?		
Step 4 Check the cables for damages, and replace if necessary.	Go to step 5.	The problem is solved.
Does the problem remain?		
Step 5 Check the LSU for proper installation. a POR into the Diagnostics menu, and then perform a feed test: Diagnostics Menu > Input Tray Test > Feed Test > select a tray b Check the display to determine whether the test is successful. c If the test fails, then perform the service check to resolve the error code shown.		The problem is solved.
Does the problem remain?		
Step 6 Check the LSU for damages, and replace if necessary. Installation note: Mechanical and electronic LSU adjustments are required to complete the installation of the LSU. See "Printhead assembly adjustments" on page 223.	Go to step 7.	The problem is solved.
Does the problem remain?		
Step 7 Check the LSU and controller board connector for damaged or bent pins. Replace the part with damaged pins.	Go to step 8.	The problem is solved.
Does the problem remain?		
Step 8 Replace the controller board.	Contact the next level of support.	The problem is solved.
Does the problem remain?		J

121 error messages

Error code	Description	Action
121.07	Fuser has been on for more than allowed after a gap blowout, and the temperature is still too cold.	Go to "Fuser service check" on page 137.
121.08	Fuser was under temp when page was in fuser.	
121.20	Fuser undertemp during steady state control. Can occur in printing or standby modes.	
121.22	Fuser did not warm enough to start line voltage detection.	
121.23	Fuser took too long to heat to line detection temp.	
121.24	Fuser never reached detection temperature.	
121.25	After line voltage detection, control did not roll over to steady state control in time.	
121.26	Failed to reach temperature during warm up.	
121.28	Failed to reach EP warm up temperature in time.	
121.29	Fuser failed to reach pre-heat temperature for motor start during warm up.	
121.30	Fuser failed to reach printing temperature by the time a page reached the fuser.	Go to "Fuser service check" on page 137.
121.31	Fuser is too hot. Global temperature check.	
121.32	Open fuser main thermistor.	
121.33	Open fuser edge thermistor.	
121.34	Open fuser backup roll thermistor.	
121.35	Attempting to POR after receiving a 121.34.	
121.36	Fuser did not heat to allow compression jog.	
121.37	Fuser heated faster than allowed during line voltage detection.	

Fuser service check

Note: A 121.32 fuser error may occur if the ambient temperature is below the freezing point. Printers are optimized to operate in an environment where temperature is between 60 and 90°F and relative humidity is between 8 to 80%.

Action	Yes	No
Step 1 a Restore the engine settings to their defaults: Diagnostics Menu > Printer Setup > Defaults b Restore the EP setup settings to their defaults: Diagnostics Menu > EP Setup > Defaults	Go to step 2.	The problem is solved.
Does the problem remain?		
 Step 2 Check the fuser cables JTHERM1 and JEXIT for proper connection to the controller board. Check the cable PCN5 for proper connection to the power supply. 	Go to step 3.	Reseat the cables.
Are they properly connected?		
Step 3 Are the cables JTHERM1, JEXIT and PCN5 free of damage?	Go to step 4.	Replace the fuser. See <u>"Fuser</u> removal" on page 311.
 Step 4 a Turn off the printer. b Remove the rear door and cover. c Disconnect the fuser cable connected to PCN5 of the power supply. d Check for approximate correct resistance on the fuser cable: 220V fuser—43 ohms 110V fuser—10 ohms 100V fuser—8 ohms Is the resistance equal to any of the above values? 	Perform an LVPS service check. See "LVPS service check" on page 139.	Replace the fuser. See <u>"Fuser</u> removal" on page 311.
Step 5 Check the fuser rollers, belts and gears for damage and debris. Are they free of damage and debris?	Perform a cooling fan service check and LVPS service check. See "Cooling fan service check" on page 145 and "LVPS service check" on page 139.	Replace the fuser. See "Fuser removal" on page 311.

126 error messages

Error code	Description	Action
126.01	Line frequency outside operating range of device.	Go to "LVPS service check" on page 139 .
126.02	No line frequency detected.	

LVPS service check

Action	Yes	No
 Step 1 a Check the power cord for continuity. If necessary, replace. b Make sure the nominal voltage source is within specification. See "Electrical specifications" on page 355. Does the problem remain?	Go to step 2.	The problem is solved.
Step 2 Check if the power supply cable is properly connected to the controller board. Is it properly connected?	Go to step 3.	Reseat the cables.
Step 3 a Turn off the printer. b Remove the power cord. c Measure the resistance between terminals A and D of the power supply socket. Is the resistance approximately 30 ohms?	Contact your next level of support.	Replace the power supply. See "Power supply removal" on page 287.

132 error messages

Error code	Description	Action
132.01	TDS baseline too low.	Go to "Toner density sensor service check" on
132.02	TDS baseline too high.	<u>page 140</u> .
132.03	TDS baseline excessive range.	
132.16	TDS calibration at maximum.	
132.17	TDS calibration too low.	
132.18	TDS calibration too close to baseline.	
132.32	PC drum measurement too high.	
132.33	PC drum measurement too different from calibration.	
132.34	PC drum measurement too close to baseline.	

Toner density sensor service check

Action	Yes	No
Step 1 Remove the transfer roll, and check for loose toner blocking the toner density sensor. Is it free of loose toner?	Go to step 2.	Clean the sensor.
Step 2 Check the toner density sensor for proper operation: a Lower the ACM assembly. b Move the toner density sensor wiper from left to right. Does it move freely?	Go to step 3.	Reinstall the wiper properly. If it still cannot move freely, replace the toner density sensor. See "Toner density sensor removal" on page 293.
Step 3 Check the toner density sensor cable for proper connection to the controller board. Is it properly connected?	Go to step 4.	Reseat the cable.
Step 4 Check the toner density sensor cable for damage and pinch points.	Replace the controller board. See "Controller board	Replace the toner density sensor. See "Toner density
Is it free of damage?	removals" on page 245.	sensor removal" on page 293.

133 error messages

Error code	Description	Action
133.05	CTLS reading above maximum expected value.	Go to "Unresponsive imaging unit service
133.06	CTLS reading below minimum expected value.	check" on page 141.
133.08	Excessive CTLS noise.	

Unresponsive imaging unit service check

Action	Yes	No
 Step 1 a Check if the imaging unit is a supported and genuine Lexmark supply. If not, then replace it. b Make sure that the imaging unit is properly installed. c Make sure that the latest firmware is installed. Does the problem remain? 	Go to step 2.	The problem is solved.
Step 2 Check the imaging unit contacts and spring for proper installation or damage.	Go to step 3.	Go to step 5.
Are the contacts and spring properly installed and damaged?	Contact the next	Co to stop 4
Step 3 Check if the imaging unit contacts and spring are beyond repair.	Contact the next level of support.	Go to step 4.
Are the contacts and spring beyond repair?		
Step 4 Straighten the imaging unit contacts and install the spring properly. Does the problem remain?	Go to step 5.	The problem is solved.
Step 5 Clean the CTLS. Does the problem remain?	Go to step 6.	The problem is solved.
 Step 6 Check the cable PCN3 for proper connection to the power supply. Check the CTLS cable for proper connection to the controller board. Are they properly connected?	Go to step 7.	Reseat the cables.

Action	Yes	No
Step 7 Check the cable PCN3 and CTLS cable for damage.	Replace the controller board. See "Controller board	Contact the next level of support.
Are they free of damage?	removals" on page 245.	

140 error messages

Error code	Description	Action
140.10	Transport motor halls not detected.	Go to "Main drive gearbox service check" on
140.20	Transport motor took too long to stop.	<u>page 142</u> .
140.30	Transport motor unable to lock (before motor ID).	
140.40	Transport motor overspeed detected.	
140.60	Transport motor unable to lock (after motor ID).	
140.70	Transport motor out of lock detected.	
140.80	Transport motor excessive PWM or temperature.	

Main drive gearbox service check

Action	Yes	No
Step 1	Go to step 2.	Remove the debris.
Remove the main drive gearbox and check for any debris.		
Is it free of debris?		
Step 2	Go to step 3.	Replace the main
Check the gears of main drive gearbox for wear or damage.		drive gearbox. See "Main drive gearbox
Are they free of wear or damage?		removal" on page 227.
Step 3	Go to <u>"LVPS service</u>	Replace the main
Check the main drive motor for proper operation:	check" on page 139.	drive gearbox. See
a Remove the main drive gearbox.		"Main drive gearbox removal" on
Note: Do not disconnect the main drive gearbox cable.		page 227.
b POR into the Diagnostics menu and perform a feed test:		
Diagnostics Menu > Input Tray Tests > Feed Test > Select any input source		
c Check if the main drive motor rotates when doing the feed test.		
Does it rotate when doing the feed test?		

146 error messages

Error code	Description	Action
146.00	·	Go to "Tray 1 pick/lift motor gearbox service check" on page 143.

Tray 1 pick/lift motor gearbox service check

Action	Yes	No
Step 1 a Remove Tray 1.	Go to step 2.	Replace the tray insert.
b Check the lift plate and gears for proper operation by moving the metal plate.		
Do the lift plate and gears move freely, and are they free of wear or damage?		
Step 2	Go to step 3.	Replace the pick/lift
Check the pick/lift motor gearbox for the following:		motor gearbox. See "Pick/Lift motor
Gear tooth breakage		gearbox removal"
Freedom of rotation		on page 303.
Is it free of wear or damage?		
Step 3	Go to step 4.	Replace the pick/lift
Check the cable JLIFT1 on the controller board.		motor gearbox. See "Pick/Lift motor
Is it properly connected and free of damage?		gearbox removal" on page 303.
Step 4	The problem is	Contact the next
Replace the controller board.	solved.	level of support.
Does this fix the problem?		

155 errors

155 error messages

Error code	Description	Action
155.00		Go to "Cartridge gearbox service check" on page 144.

Cartridge gearbox service check

Action	Yes	No
Step 1	Go to step 2.	Go to step 3.
Is the button aligned with the front of the toner cartridge?	·	·
Step 2	Go to step 5.	The problem is
a Remove the toner cartridge.		solved.
b Clear the paper jam.		
Does the problem remain?		
Step 3	Go to step 4.	The problem is
a Remove, and then reinstall the toner cartridge. Make sure that it is properly seated.		solved.
b Check the toner cartridge, toner cartridge button, and cartridge plunger for damage. Replace if necessary.		
c Make sure that the latest firmware is installed.		
Does the problem remain?		
Step 4	Go to step 5.	The problem is
Run a print test.		solved.
Does the problem remain?		
Step 5	Go to step 6.	The problem is
Replace the toner cartridge		solved.
Does the problem remain?		
Step 6	Go to step 7.	Replace the
Check the gears on the cartridge gearbox for proper rotation and for wear or damage.		cartridge gearbox. See <u>"Cartridge</u> gearbox removal"
Does it rotate properly and is it free of wear or damage?		on page 236.
Step 7	Go to step 8.	Reseat the cable.
Check the cartridge gearbox cable for proper connection to the controller board.		
Is it properly connected?		

Action	Yes	No
Step 8 Check the cartridge gearbox cable for damage.	Replace the controller board. See	, ,
Is it free of damage?	"Controller board removals" on page 245.	See <u>"Cartridge</u> gearbox removal" on page 236.

171 errors

171 error messages

Error code	Description	Action
171.03	Fuser fan error.	Go to "Cooling fan service check" on
171.04	Fuser fan error.	<u>page 145</u> .
171.05	Fuser fan error.	
171.06	Fuser fan error.	
171.07	Fuser fan error.	

Cooling fan service check

Action	Yes	No
 Step 1 a Make sure that the cable JFAN1 is properly connected to the controller board. b Check if the cooling fan is rotating properly. 	Go to step 2.	Replace the cooling fan. See "Cooling fan removals" on page 241.
 Step 2 a Turn off the printer, and disconnect JFAN1 from the controller board. b Turn on the printer, and measure the voltage across JFAN1. Is the voltage approximately 24 V? 	Go to step 3.	Replace the controller board. See "Controller board removals" on page 245.
Step 3 Is the fan idle?	Replace the cooling fan. See "Cooling fan removals" on page 241.	The problem is solved.

ACM service check

Action	Yes	No
Step 1 Check the pick/lift motor gearbox for proper operation. a POR into the Diagnostics menu and perform a feed test: Diagnostics Menu > Input Tray Tests > Feed Test > Tray 1 b Check if the pick/lift motor gearbox rotates on each pick.	Go to step 2.	Replace the pick/lift motor gearbox. See "Pick/Lift motor gearbox removal" on page 303.
Does it rotate during the feed test?		
Step 2	Replace the	Replace the ACM
Lower the ACM assembly, and rotate the pick roller toward the front without touching the pick tire. Does it rotate properly?	controller board. See <u>"Controller board</u> removals" on page 245.	assembly. See <u>"ACM</u> assembly removal" on page 301.

Procedure before starting the 9yy service checks

You will need to retrieve certain information. This information will aid your next level of support in diagnosing the problem before replacing the controller board.

Warning—Potential Damage: Do not replace the controller board unless directed by your next level of support.

- 1 Collect the history information and firmware logs (Fwdebug and logs.tar.gz) from the SE menu.
- **2** Collect the settings from the menu settings page.
- **3** Collect information from the user.

Note: Not all of the items are retrievable from the printer you are working on.

A. Collecting the history information from the SE menu

Note: Make sure that your printer is connected to a network or to a print server.

1 Open a Web browser, type http://printer_IP_address/se, and then press Enter.

Notes:

- printer_IP_address is the TCP/IP address of the printer
- **se** is required to access the printer diagnostic information
- **2** Click **History Information**, copy all information, and then save it as a text file.
- **3** E-mail the text file to your next level of support.

B. Collecting the firmware logs (Fwdebug and logs.tar.gz) from the SE menu

Notes:

• Make sure that your printer is connected to a network or to a print server.

- Some printers are designed to restart automatically after a 9yy error. On these printers, you can retrieve the secondary crash code information using the SE menu.
- Fwedebugs can also be referred to as LBtrace. If FWEdebugs does not appear in the list, then look for LBtrace. Multiple LBtrace logs can appear in the list of links referred to in step 2.
- 1 Open a Web browser, type http://printer_IP_address/se, and then press Enter.
- 2 Click List Fwedebugs captured during reboots.

Note: A list of the secondary crash codes retrieved from previous reboots will be generated. If there are Fwedebugs listed, then click **Dump Fwedebug log0**, **Dump Fwedebug log1**, and **Dump Fwedebug log2**. Clicking these links will dump the debug logs to the computer. Take note of the destination folder where the logs are saved.

3 E-mail the logs to your next level of support.

Note: Some printer SE menus give you the option of clicking **Logs Gzip Compressed**. If this option is shown in the menu, then click it and retrieve the compressed log file. Take note of the destination folder where the log file is saved.

C. Collecting the settings from the menu settings page

Note: The menu settings page is different for each printer. For more information see the *User's Guide*. Your next level of support will tell you which page they want to see.

Copying the menu settings page from the Embedded Web Server (EWS)

Note: Make sure that your printer is connected to a network or to a print server.

- 1 Open a Web browser, type http://printer_IP_address, and then press Enter.
- **2** Click Settings, and then select one of the settings pages from the links shown on the page.
- **3** Copy all the information, and then save it as a text file.
- **4** E-mail the text file to your next level of support.

Printing the menu settings page

1 From the home screen, navigate to:

Reports > Menu Settings Page

2 Print the menu settings page, and then use Scan to E-mail to send it to your next level of support.

D. Collecting information from the user

Ask the user for information about the following:

- Print job being run
- Operating system being used
- Print driver being used
- Other information on what was happening when the 9yy error occurred

900 errors

900 error messages

Error code	Description	Action
900.xx		Go to "System software error service check" on page 148.

System software error service check

There are different types of 900.xx errors that can occur. There may be a communication problem (bad cable, network connection, and so on) software issue, or a hardware problem with the controller board, or ISP (internal solutions port). The communication and software aspects should be checked first. Determine if the problem is constant or intermittent. Use the troubleshooting procedure below to isolate the issue. Take any notes as instructed. You will need that information in the event you need to contact your next level of support.

Before troubleshooting:

- 1 Perform the "Procedure before starting the 9yy service checks" on page 146.
- **2** Determine the operating system used when the error occurred. If possible determine whether a PostScript or PCL file was sent to the device when the error occurred. Ask the customer which Lexmark Solutions applications are installed on the device.

Action	Yes	No
Step 1	Go to step 2.	The problem is
POR the printer.		solved.
Does the error remain?		
Step 2	Go to step 3.	Go to step 6.
a Write down the exact 900.xx error code displayed on the device.		
b Turn off the printer.		
c Clear the print queues.		
d Disconnect all communication cables, and remove all memory options.		
e Remove any installed ISP.		
f POR the printer into the Diagnostics menu.		
Does the error remain during startup?		
Step 3	Go to step 5.	Go to step 4.
Check all the cables connected to the controller board for proper connectivity.		
Are the cables properly connected?		

a Replace the controller board. b POR the printer. Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error.	
a Properly connect the cables to the controller board. b POR the printer into the Diagnostics menu. Does the error remain during startup? Step 5 a Replace the controller board. b POR the printer. Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: • Error log • Menu settings page • Network settings page	step 6.
b POR the printer into the Diagnostics menu. Does the error remain during startup? Step 5 a Replace the controller board. b POR the printer. Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: • Error log • Menu settings page • Network settings page	
Does the error remain during startup? Step 5 a Replace the controller board. b POR the printer. Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: Error log Menu settings page Network settings page	
Step 5 a Replace the controller board. b POR the printer. Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: Error log Menu settings page Network settings page	
a Replace the controller board. b POR the printer. Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: • Error log • Menu settings page • Network settings page	
b POR the printer. Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: • Error log • Menu settings page • Network settings page	roblem is
Does the error remain during startup? Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: Error log Menu settings page Network settings page	d.
Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: • Error log • Menu settings page • Network settings page	
Note: If an error different from the original 900.xx is displayed, consult the service check for that error. Step 6 Print the following: • Error log • Menu settings page • Network settings page	
consult the service check for that error. Step 6 Print the following: • Error log • Menu settings page • Network settings page	
Print the following: • Error log • Menu settings page • Network settings page	
 Error log Menu settings page Network settings page 	step 7.
 Menu settings page Network settings page 	
Network settings page	
Does the error remain while these pages were printing?	
Step 7 Go to step 8. Go to	step 10.
Note: Before performing this step, write down the following	·
information about the file being sent to the printer:	
Application used	
Operating system	
Driver type	
File type (PCL, PostScript, XPS, etc.)	
a Reattach the communications cable.	
b POR the printer.	
c Send the printer a print job.	
Does the error remain?	
Step 8 Go to step 9. Go to	step 10.
a POR the printer.	
b Send a different print job to the printer.	
Does the error remain?	

Step 9 a Upgrade the firmware. Note: Contact your next level of support for the correct firmware level to use. b POR the printer. c Send the printer a print job. Does the error remain? Step 10 Is the device an MFP? Step 11 Go to step 31. Go to s Step 31. Go to s	
Note: Contact your next level of support for the correct firmware level to use. b POR the printer. c Send the printer a print job. Does the error remain? Step 10 Is the device an MFP? Step 11 Run a copy job. Does the error remain? Step 12 Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to step 15.	step 10.
firmware level to use. b POR the printer. c Send the printer a print job. Does the error remain? Step 10 Is the device an MFP? Step 11 Run a copy job. Does the error remain? Step 12 Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to step 15.	
c Send the printer a print job. Does the error remain? Step 10 Is the device an MFP? Step 11 Run a copy job. Does the error remain? Step 12 Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to step 15.	
Does the error remain? Step 10 Is the device an MFP? Step 11 Run a copy job. Does the error remain? Step 12 Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to step 16 Go to step 17 Go to step 18 Go to step 19	
Step 10Go to step 11.Go to step 11.Is the device an MFP?Go to step 31.Go to step 31.Step 11Go to step 31.Go to step 31.Does the error remain?Go to step 31.Go to step 31.Step 12Go to step 31.Go to step 31.Run a scan to PC job.Go to step 14.Go to step 14.Step 13Go to step 14.Go to step 15.Is there optional memory installed?Go to step 15.Go to step 15.	
Is the device an MFP? Step 11 Run a copy job. Does the error remain? Step 12 Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to step 15.	
Step 11 Run a copy job.Go to step 31.Go to step 31.Does the error remain?Go to step 31.Go to step 31.Step 12 Run a scan to PC job.Go to step 31.Go to step 31.Does the error remain?Go to step 14.Go to step 14.Step 13 Is there optional memory installed?Go to step 15.Go to step 15.	step 13.
Run a copy job. Does the error remain? Step 12 Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to step 15.	
Does the error remain? Step 12 Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to step 15.	step 12.
Step 12Go to step 31.Go to step 31.Run a scan to PC job.Does the error remain?Step 13Go to step 14.Go to step 14.Is there optional memory installed?Go to step 15.Go to step 15.	
Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to s	
Run a scan to PC job. Does the error remain? Step 13 Is there optional memory installed? Step 14 Go to step 15. Go to s	step 13.
Step 13Go to step 14.Go to sIs there optional memory installed?Go to step 15.Go to s	
Step 13 Is there optional memory installed? Step 14 Go to step 14. Go to step 15. Go to step 15.	
Is there optional memory installed? Step 14 Go to step 15. Go to s	
Step 14 Go to step 15. Go to s	step 16.
a Reinstall the memory.	step 16.
b Send a print job to the printer.	
Does the error remain?	
Step 15 Go to step 31. The pro	oblem is
a Install a Lexmark recommended memory option.	
b Send a print job to the printer.	
Does the error remain?	
Step 16 Go to step 17. Go to s	step 21.
Is there a modem installed?	
Step 17 Go to step 18. Go to s	step 20.
a Reinstall the modem.	
b POR the printer.	
Does the error remain?	

Action	Yes	No
Step 18	Go to step 19.	The problem is
a Upgrade the firmware if it was not upgraded in a previous step.	·	solved.
Note: Contact your next level of support for the correct firmware level to use.		
b POR the printer.		
c Send the printer a print job.		
Does the error remain?		
Step 19	Go to step 31.	The problem is
a Replace the modem.		solved.
b POR the printer.		
Does the error remain?		
Step 20	Go to step 31.	Go to step 21.
Run a fax job.		
Does the error remain?		
Step 21	Go to step 22.	The problem is
Is there an ISP option installed?		solved.
Step 22	Go to step 24.	Go to step 23.
a Reinstall the first ISP option.		
b POR the printer.		
Does the error remain?		
Step 23	Go to step 24.	Go to step 26.
Run a job to test the option.		
Does the error remain?		
Step 24	Go to step 25.	The problem is
a Upgrade the firmware if it was not upgraded in a previous step.		solved.
Note: Contact your next level of support for the correct firmware level to use.		
b POR the printer.		
c Send the printer a print job.		
Does the error remain?		
Step 25	Go to step 31.	Go to step 26.
a Replace the faulty ISP option.		
b POR the printer.		
Does the error remain?		

Action	Yes	No
Step 26	Go to step 27.	The problem is
Are there any more ISP options to install?		solved.
Step 27	Go to step 29.	Go to step 28.
a Install the next ISP option.		
b POR the printer.		
Does the error remain?		
Step 28	Go to step 29.	Go to step 26.
Run a job to test the option.		
Does the error remain?		
Step 29	Go to step 30.	Go to step 26.
a Upgrade the firmware if it was not upgraded in a previous step.		
Note: Contact your next level of support for the correct firmware level to use.		
b POR the printer.		
c Send the printer a print job.		
Does the error remain?		
Step 30	Go to step 31.	Go to step 26.
a Replace the faulty ISP option.		
b POR the printer.		
Does the error remain?		

Step 31

Contact your next level of support. You will need the following information:

- Exact 900.xx error digits and complete error message
- Printed menu settings page
- Printed network settings page
- Device error log
- A sample print file if the error appears to be isolated to a single file
- File/Application used if the error is related to specific print file
- Device operating system
- Driver used (PCL/PS)
- Frequency of the occurrence of the error

912 errors

912 error messages

Error code	Description	Action
912.xx	Unrecoverable Engine firmware error POR the machine. If the error re-occurs, then update the firmware. If the error continues occurring, then check the controller board.	Go to "Controller board service check" on page 166.

94y errors

94y error messages

Error code	Description	Action
940.xx	RIP to engine communication failure—the zero crossing signal used for fuser control in the low voltage (LV) power supply has failed, or the wrong low voltage power supply has been installed.	Go to "LVPS service check" on page 139.
948.xx	Failed engine card—pel clock check failed. Replace the controller board.	Go to <u>"Controller board removals" on</u> page 245.
949.xx	Failed engine card—delay line calibration failure. Replace the controller board.	

950-958 errors

950–958 error messages

Error code	Description	Action
950.xx	NVRAM mismatch failure—mismatch between controller board EEPROM and control panel mirror.	Go to "NVRAM mismatch failure service check" on page 154.
	".xx" codes:	
	00-29— mismatch between system and mirror	
	• 30-60—mismatch between secure and system	
952.xx	A recoverable NVRAM Cyclic Redundancy Check (CRC) error occurred—n is the offset at which the error occurred.	Go to "NVRAM cyclic redundancy service check" on page 155.

Error code	Description	Action
953.xx	NVRAM chip failure with mirror part Replace the controller board.	Go to <u>"Controller board removals" on</u> page 245.
954.xx	NVRAM chip failure with system part Replace the controller board.	
955.xx	The Code ROM or NAND flash failed the Cyclic Redundancy Check (CRC) or the NAND experienced an uncorrectable multi-bit failure. Replace the controller board.	
956.xx	RIP card failure—processor failure Replace the controller board.	
956.01	Processor temperature is over the limit. Replace the controller board.	
957.xx	RIP card failure—ASIC failure Replace the controller board.	
958.xx	Controller Board NAND Failure—printer has performed more than 100 shift and reflash operations as a result of ECC bit corrections. Replace the controller board.	

NVRAM mismatch failure service check

Warning—Potential Damage: When replacing any of the following components:

- Control panel assembly
- Controller board assembly

Replace only one component at a time. Replace the required component and perform a POR before replacing a second component listed above. If this procedure is not followed, the printer will be rendered inoperable. Never replace two or more of the components listed above without a POR after installing each one or the printer will be rendered inoperable.

Warning—Potential Damage: These components can be used as a method of troubleshooting as long as the machine is booted into diagnostic mode or is operating in diagnostic mode. Once a component has been installed in a machine and powered up into user mode, it cannot be used in another machine. It must be returned to the manufacturer.

Action	Yes	No
Step 1	Go to step 3.	Go to step 2.
Check the control panel assembly.		
Was the control panel assembly recently replaced?		
Step 2	Go to step 4.	Contact next level of
Check the controller board assembly.		support.
Was the controller board assembly recently replaced?		

Action	Yes	No
Step 3 Replace the current control panel assembly with the original control panel assembly. Go to "Control panel assembly removals" on page 263.	Go to step 5.	The problem is solved.
Does the error remain?		
Step 4 Replace the current controller board assembly with the original controller board assembly. Go to "Controller board removals" on page 245.	Go to step 6.	The problem is solved.
Does the problem continue?		
Step 5 Replace the original control panel assembly with a new and not previously installed control panel assembly.	Contact the next level of support.	The problem is solved.
Does the error continue?		
Step 6 Replace the original control panel assembly with a new and not previously installed control panel door assembly.	Contact the next level of support.	The problem is solved.
Does the error continue?		

NVRAM cyclic redundancy service check

Action	Yes	No
POR the printer.	Contact the next level of support.	The problem is solved.
Does the error remain?		J

959 errors

959 error messages

Error code	Description	Action
959.01	Controller verification failure of pensive boot code	Go to "Invalid firmware/controller board
959.02	Failure to authenticate Signature Verification Code	service check" on page 157.
959.03	Signature Verification Code failed to authenticate a code partition	
959.04	Jump to unverified address	
959.05	Unknown Boot Failure	
959.20	Pensive hardware failure	
959.21	Pensive did not respond to command request	
959.22	Challenge Secret Failure	
959.23	Pensive self test failed during initialization	
959.24	EEPROM Retention Error (Write failure)	
959.25	Insufficient device space during HW prog	
959.26	Incremental counter reset exceeds maximum value	
959.27	Increment count failed due to max value limit	
959.28	Invalid SP Memory Configuration	
959.30	Pensive library flagged an invalid argument(s)	Go to "Invalid firmware/controller board
959.31	Pensive library flagged an invalid device address	service check" on page 157.
959.32	Failure to init physical interface	
959.33	Unknown/unexpected Error	
959.34	System Pensive Bus Busy Error	
959.35	Transmission Error	
959.36	Pensive command is invalid due to unlocked device status	
959.37	Pensive command is invalid due to locked device status	
959.38	Incremental counter id(s) are invalid	
959.39	Invalid NV address	
959.40	Invalid Pensive command	

Invalid firmware/controller board service check

Action	Yes	No
Update the firmware. Note: Contact the next level of support for the correct firmware level. Does the error remain?	Replace the controller board. See "Controller board removals" on page 245.	The problem is solved.

96y errors

96y error messages

Error code	Description	Action
960.xx	RAM Memory Error—RAM soldered on the card is bad	Go to "Controller board removals" on page 245.
	Replace the controller board.	
961.xx	RAM Memory Error—optional DRAM is bad	Go to "RAM memory error service check" on page 157.
964.xx	Download Emulation Cyclic Redundancy Check (CRC) Error—checksum failure detected in the emulation header or emulation file.	Go to "Download emulation cyclic redundancy service check" on page 157.

RAM memory error service check

Action	Yes	No
Replace the bad memory card.	Contact the next level of support.	The problem is solved.
Does the error remain?		

Download emulation cyclic redundancy service check

Action	Yes	No
Step 1 Disable the download emulation, and then program the download emulation into the firmware card again.	Go to step 2.	The problem is solved.
Does the error remain?		
Step 2	Contact the next	The problem is
Replace the firmware card and download the emulation to the new card.	level of support.	solved.
Does the error remain?		

97y errors

97y error messages

Error code	Description	Action
975.xx	Network error—Unrecognizable network port.	Go to "Network port error service check" on
976.xx	Network error—Unrecoverable software error in network port.	page 158.
978.xx	Network error—Bad checksum while programming network port.	
979.xx	Network error—Flash parts failed while programming network port.	

Network port error service check

Action	Yes	No
Step 1 Check the network cable for proper connection and damage, and replace if necessary.	Go to step 2.	The problem is solved.
Does the problem remain?		
Step 2	Contact the next	The problem is
Check the controller board network port for proper operation and damage, and replace the controller board if necessary.	level of support.	solved.
Does the problem remain?		

98y errors

98y error messages

Error code	Description	Action
980.xx	Engine experiencing unreliable communication with the specified device.	Go to "Option communication error service check" on page 159.
981.xx	Engine protocol violation detected by the specified device.	
982.xx	Communications error detected by the specified device. Device can be:	
	• Engine, Duplex, Tray [x], Env Feeder	
	Output Bin [x] (applicable only for single bin devices)	
	Bins [x] to [y] (applicable only for multiple bin devices)	
983.xx	Invalid command received by the specified device.	
984.xx	Invalid command parameter received by the specified device.	

Option communication error service check

Action	Yes	No
Step 1	Go to step 2.	The problem is
Make sure that the optional hardware is compatible with the printer.		solved.
Does the problem remain?		
Step 2	Go to step 4.	Go to step 3.
Make sure that the firmware of the engine and options are compatible.		
Are the firmware of the engine and options compatible?		
Step 3		
Update the firmware.		
Does the problem remain?		
Step 4	Go to step 5.	The problem is
Make sure that the interconnect cables are properly seated.		solved.
Does the problem remain?		

Action	Yes	No
Step 5 Make sure that both ends of the interconnect cables are properly connected to the controller board and engine options card.	Go to step 6.	The problem is solved.
Does the problem remain?		
Step 6 Check the option for damage, and replace if necessary.	Go to step 7.	The problem is solved.
Does the problem remain?		
Step 7 Check the controller board for damage, and replace if necessary.	Contact the next level of support.	The problem is solved.
Does the problem remain?		

99y errors

99y error messages

Error code	Description	Action
990.xx	An equipment check condition has occurred in the specified device, but the device is unable to identify the exact component failure. The device can be: • Engine, Duplex, Tray [x], Env Feeder	Go to "Option communication error service check" on page 159.
	 Output Bin [x] (applicable only for single bin devices) 	
	Bins [x] to [y] (applicable only for multiple bin devices)	
991.xx	The specified device has detected an equipment check in its controller board. The device can be:	
	• Engine, Duplex, Tray [x], Env Feeder	
	Output Bin [x] (applicable only for single bin devices)	
	Bins [x] to [y] (applicable only for multiple bin devices)	

Input option hardware errors

3yy error messages

Error code	Description	Action
321.51	Motor 1 (Pick/Lift) motor no first encoder	Go to "Option tray pick/lift motor service check" on page 163.
321.52	Motor 1 (Pick/Lift) motor stop error	Go to "Option tray pick/lift motor service check" on page 163.
321.53	Motor 1 (Pick/Lift) PWM underflow (motor overspeed)	Go to "Option tray pick/lift motor service check" on page 163.
322.54	Motor 2 (Separator/Passthru) motor no first encoder	Go to "Option tray separator/pass through motor service check" on page 163.
322.55	Motor 2 (Separator/Passthru) motor stop error	Go to "Option tray separator/pass through motor service check" on page 163.
322.56	Motor 2 (Separator/Passthru) PWM underflow (motor overspeed)	Go to "Option tray separator/pass through motor service check" on page 163.
324.57	Motor 3 motor no first encoder	Go to "Option tray ACM motor service check" on page 164.
324.58	Motor 3 motor stop error	Go to "Option tray ACM motor service check" on page 164.
324.59	Motor 3 PWM underflow (motor overspeed)	Go to "Option tray ACM motor service check" on page 164.
325.60	Hardware error—Board ID unknown	Go to "Option tray controller card service check" on page 164.
325.61	Hardware error—Option type unknown	Go to "Option tray controller card service check" on page 164.
325.62	Hardware error—Product ID unknown	Go to "Option tray controller card service check" on page 164.
325.63	Hardware error—Sensors are not plugged on the board.	Go to "Option tray controller card service check" on page 164.
331.51	Motor 1 (Pick/Lift) motor no first encoder	Go to "Option tray pick/lift motor service check" on page 163.
331.52	Motor 1 (Pick/Lift) motor stop error	Go to "Option tray pick/lift motor service check" on page 163.
331.53	Motor 1 (Pick/Lift) PWM underflow (motor overspeed)	Go to "Option tray pick/lift motor service check" on page 163.
332.54	Motor 2 (Separator/Passthru) Motor no first encoder	Go to "Option tray separator/pass through motor service check" on page 163.
332.55	Motor 2 (Separator/Passthru) motor stop error	Go to "Option tray separator/pass through motor service check" on page 163.

Error code	Description	Action
332.56	Motor 2 (Separator/Passthru) PWM underflow (motor overspeed)	Go to "Option tray separator/pass through motor service check" on page 163.
334.57	Motor 3 motor no first encoder	Go to "Option tray ACM motor service check" on page 164.
334.58	Motor 3 motor stop error	Go to "Option tray ACM motor service check" on page 164.
334.59	Motor 3 PWM underflow (motor overspeed)	Go to "Option tray ACM motor service check" on page 164.
335.60	Hardware error—Board ID unknown	Go to "Option tray controller card service check" on page 164.
335.61	Hardware error—Option type unknown	Go to "Option tray controller card service check" on page 164.
335.62	Hardware error—Product ID unknown	Go to "Option tray controller card service check" on page 164.
335.63	Hardware error—Sensors are not plugged on the board.	Go to "Option tray controller card service check" on page 164.
341.51	Motor 1 (Pick/Lift) motor no first encoder	Go to "Option tray pick/lift motor service check" on page 163.
341.52	Motor 1 (Pick/Lift) motor stop error	Go to "Option tray pick/lift motor service check" on page 163.
341.53	Motor 1 (Pick/Lift) PWM underflow (motor overspeed)	Go to "Option tray pick/lift motor service check" on page 163.
342.54	Motor 2 (Separator/Passthru) motor no first encoder	Go to "Option tray separator/pass through motor service check" on page 163.
342.55	Motor 2 (Separator/Passthru) motor stop error	Go to "Option tray separator/pass through motor service check" on page 163.
342.56	Motor 2 (Separator/Passthru) PWM underflow (motor overspeed)	Go to "Option tray separator/pass through motor service check" on page 163.
344.57	Motor 3 motor no first encoder	Go to "Option tray ACM motor service check" on page 164.
344.58	Motor 3 motor stop error	Go to "Option tray ACM motor service check" on page 164.
344.59	Motor 3 PWM underflow (motor overspeed)	Go to "Option tray ACM motor service check" on page 164.

Option tray pick/lift motor service check

Action	Yes	No
Step 1	Go to step 2.	Replace the tray
a Remove the option tray insert.		insert.
b Check the lift plate and gears for proper operation by moving the metal plate.		
Do the lift plate and gears move freely, and are they free of wear or damage?		
Step 2	Go to step 3.	Replace the tray.
Check the pick/lift motor for the following:		
Gear tooth breakage		
Freedom of rotation		
Is it free of wear or damage?		
Step 3	Contact the next	Replace the tray.
Check the cable J11 on the option tray controller card.	level of support.	
Is it properly connected and free of damage?		

Option tray separator/pass through motor service check

Action	Yes	No
 Step 1 a Remove the option tray insert. b Check the separator roll assembly gear under the tray base for the following: Gear tooth breakage Freedom of rotation 	Go to step 2.	Replace the tray.
Step 2 Check the cable J10 on the option tray controller card. Is it properly connected and free of damage?	Go to step 3.	Replace the tray.
Step 3 Check the separator roll assembly for wear or damage. Is it free of wear or damage?	Contact the next level of support.	Replace the separator roll assembly. See "Separator roll assembly removal" on page 316.

Option tray ACM motor service check

Action	Yes	No
Step 1 Check the cable J11 on the option tray controller card.	Go to step 2.	Reseat the cable.
Is it properly connected?		
 Step 2 a Remove the option tray insert and bypass the tray present sensor. b POR into the Diagnostics Menu and perform a feed test: Diagnostics Menu > Feed Test > choose an option tray c Check the ACM for proper operation. Does the ACM freely rotate three times before displaying a jam message? 	Go to step 3.	Replace the ACM assembly. See <u>"ACM assembly removal"</u> on page 318.
Step 3 Is the ACM gear free of wear or damage?	Contact the next level of support.	Replace the ACM assembly. See <u>"ACM assembly removal"</u> on page 318.

Option tray controller card service check

Action	Yes	No
Step 1	Go to step 2.	Reseat the cables.
Check all connections to the option tray controller card.		
Are the properly connected?		
Step 2	Go to step 3.	Update the firmware.
Check printer's firmware level.		
Is it up to date?		
Step 3	Contact the next	The problem is
Replace the option tray.	level of support.	solved.
Does the error remain?		

Other symptoms

Base printer symptoms

Symptom	Action
Buttons on the control panel failed to respond	Go to "Control panel button service check" on page 167.
No display	Go to "Control panel service check" on page 168.
Printer not communicating with host	Go to "USB print service check" on page 169.
Machine does not POR (no power)	Go to "Dead machine service check" on page 165.
Toner starvation and 31.4x error code is displayed	Go to "Toner starvation service check" on page 168.
Print job not printing on network attached printer	Go to "Network service check" on page 170.
Network attached printer offline	Go to "Network service check" on page 170.

Dead machine service check

Action	Yes	No
 Step 1 a Check the power cord for continuity. Replace if necessary. b Make sure the nominal voltage source is within specification. See "Electrical specifications" on page 355. 	Go to step 2.	The problem is solved.
Step 2 Check if the power supply cable is properly connected to the controller board. Are they properly connected?	Go to step 3.	Reseat the cables.
Step 3 a Turn off the printer. b Remove the power cord. c Measure the resistance between terminals A and D of the power supply socket. Is the resistance approximately 30 ohms?	Go to "Controller board service check" on page 166.	Replace the power supply. See "Power supply removal" on page 287.

Controller board service check

Service checks which involve measuring voltages on the power supply should be performed with the printer positioned on its rear side.

Note: When making voltage readings, always use frame ground unless another ground is specified. See the wiring diagram in the back of the book for more information.

Warning—Potential Damage: Do not replace the control panel and controller board at the same time. Each card contains the printer settings. When either of these cards is new, it obtains some of the settings from the other card. Settings are lost when both are new and replaced at the same time.

Action	Yes	No
Step 1	Go to step 2.	Go to step 3.
POR the machine.		
Did the control panel, fuser, fan and drive motor function at startup?		
Step 2	Go to step 3.	The problem is
Run some print jobs.		solved.
Does the error remain?		
Step 3	Go to step 5.	Go to step 4.
Check all cables on the controller board.		
Are they connected properly?		
Step 4	The problem is	Go to step 5.
Properly connect all the cables on the controller board.	solved.	
Does the error remain?		
Step 5	Go to step 7.	Go to step 6.
Unplug the cable JPS1 from the controller board, and verify the following voltages from the cable:		
• +5 V at pins 11, 12, 13, 14, 15, 16		
• GND at pins 18, 20		
Are the voltages correct?		
Step 6	The problem is	Contact the next
Replace the power supply.	solved.	level of support.
Does the error remain?		
Step 7	Go to step 9.	Go to control panel
Is the control panel functioning properly?		service check. Go to "Control panel service check" on page 168.

Action	Yes	No
Step 8 Perform the control panel service check. Go to "Control panel service check" on page 168. Does the error remain?	Go to step 9.	The problem is solved.
Step 9 Is the LED on the bottom of the controller board illuminating?	Go to step 6.	Replace the controller board. Go to "Controller board removals" on page 245.

Control panel button service check

Action	Yes	No
Step 1 Are the control panel display and control panel indicator light illuminated?	Go to step 2.	Perform a control panel service check. Go to "Control panel service check" on page 168.
Step 2	Go to step 4.	Go to step 3.
POR into the Diagnostics menu and perform a button test:		
Diagnostics Menu > HARDWARE TESTS > Button Test		
Did the printer pass the test?		
Step 3	The problem is	Go to step 4.
Replace the UICC. Go to "UICC removals" on page 269.	solved.	
Did this fix the problem?		
Step 4	The problem is	Contact the next
Replace the controller board. Go to "Controller board removals" on page 245.	solved.	level of support.
Did this fix the problem?		

Control panel service check

Warning—Potential Damage: Do not replace the operator panel and controller board at the same time. Each card contains the printer settings. When either of these cards is new, it obtains some of the settings from the other card. Settings are lost when both are new and replaced at the same time.

Action	Yes	No
Step 1 Check the UICC cable for proper connection to the UICC and to the controller board.	Go to step 2.	Reseat the cable.
Are they properly connected?		
Step 2 Is the control panel display blank?	Go to step 3.	The problem is solved.
Step 3 Replace the UICC. Go to "UICC removals" on page 269. Did this fix the problem?	The problem is solved.	Replace the controller board. Go to "Controller board removals" on page 245.

Toner starvation service check

Action	Yes	No
 Step 1 a Check if the toner cartridge is a supported and genuine Lexmark supply. If not, then replace it. b Make sure that the toner cartridge is properly installed. c Check the toner cartridge and toner cartridge button for damage. Replace if necessary. d Make sure that the latest firmware is installed. 	Go to step 2.	The problem is solved.
Does the problem remain?		
Step 2	Go to step 5.	Go to step 3.
Check the cartridge plunger. Is the cartridge plunger properly attached to the front door and is the spring functioning properly?		
 Step 3 a Install a new cartridge plunger and spring. See "Cartridge plunger removal" on page 256. b Print some pages. Did this fix the problem? 	The problem is solved.	Go to step 4.
Step 4 Did a 201.22 error display?	Go to <u>"Cartridge</u> gearbox service check" on page 144.	Go to step 5.

Action	Yes	No
Step 5	The problem is	Go to step 6.
Try a different toner cartridge.	solved.	
Did this fix the problem?		
Step 6	Go to step 8.	Go to step 7.
Check the connections between the cartridge gearbox and the controller board.		
Is the cable properly connected to the cartridge gearbox and to the controller board?		
Step 7	The problem is	Go to step 8.
Reconnect the cable to the cartridge gearbox and to the controller board.	solved.	
Did this fix the problem?		
Step 8	The problem is	Contact the next
Replace the cartridge gearbox. See <u>"Cartridge gearbox removal"</u> on page 236.	solved.	level of support.
Did this fix the problem?		

USB print service check

Action	Yes	No
Step 1	Go to step 2.	Go to step 7.
Enter Diagnostic mode and perform a print test to make sure the printer prints correctly. Verify that the indicator light is on, and then print the menu settings page. Navigate to:		
Reports > Menu Settings Page		
Are the internal pages printing?		
Step 2	Go to step 4.	Go to step 3.
Verify if the user's applications are set up correctly.		
Are they set up correctly?		
Step 3	This is not a printer	Go to step 4.
Try a different application to run a print job.	issue.	
Did the output print?		
Step 4	Go to step 6.	Go to step 5.
Check the printer driver.		
Is the correct driver being used and properly set up?		

Action	Yes	No
Step 5 Use a different driver.	The problem is solved.	Go to step 6.
Did this fix the issue?		
Step 6 Try a different USB cable.	The problem is solved.	Go to step 7.
Did this fix the issue?		
Step 7 Replace the controller board. Go to "Controller board removals" on page 245.	The problem is solved.	Contact the next level support
Did this fix the issue?		

Network service check

Note: Before starting this service check, print out the network setup page. This page is found under **Menu > Reports > Network Settings**. Consult the network administrator to verify that the physical and wireless network settings displayed on the network settings page for the device are properly configured. If a wireless network is used, then verify that the printer is in range of the host computer or wireless access point, and there is no electronic interference. Have the network administrator verify that the device is using the correct SSID, and wireless security protocols. For more network troubleshooting information, consult the Lexmark Network Setup Guide.

Actions	Yes	No
Step 1 If the device is physically connected to the network, verify that the Ethernet cable is properly connected on both ends.	Go to step 3. If the network is wireless, then go to step 3.	Go to step 2.
Is the cable properly connected?		
Step 2 Connect the Ethernet cable.	The problem is solved.	Go to step 3.
Does this fix the problem.		
Step 3 Check the printer's online status under Printers and Faxes on the host computer. Delete all print jobs in the print queue.	Go to step 5.	Go to step 4.
Is the printer online and in a Ready state?		
Step 4 Change the printer status to online.	The problem is solved.	Go to step 5.
Did this fix the issue?		

Actions	Yes	No
Step 5	Go to step 10.	Go to step 6.
Does the IP address displayed on the network settings page match the IP address in the port of the drivers using the printer?		
Step 6	Go to step 7.	Go to step 9.
Does the LAN use DHCP?		
Note: A printer should use a static IP address on a network.		
Step 7	Go to step 8.	Go to step 9.
Are the first two segments of the IP address 169.254		
Step 8 POR the printer.	The problem is solved.	Go to step 10.
Did this resolve the issue?		
Step 9 Reset the address on the printer to match the IP address on the driver. Did this resolve the issue?	The problem is solved.	Go to step 10.
Step 10	Go to step 12.	Go to step 11.
Have the network administrator verify that the printer and PC's IP address have identical subnet addresses.	OG to Step 12.	eo to step iii
Are the subnet addresses the same?		
Step 11 Using the subnet address supplied by the network administrator, assign a unique IP address to the printer.	The problem is solved.	Go to step 12.
Note: The printer IP address should match the IP address on the printer driver.		
Did this fix the problem?		
Step 12 Is the device physically connected (Ethernet cable) to the network?	Go to step 13.	Go to step 15.
Step 13	The problem is	Go to step 14.
Try using a different Ethernet cable.	solved.	
Did this fix the problem?		
Step 14 Have the network administrator check the network drop for activity. Is the network drop functioning properly?	Replace the controller board. See "Controller board removals" on page 245.	Contact the network administrator.
Step 15 Is the printer on the same wireless network as the other devices?	Go to step 17.	Go to step 16.


Actions	Yes	No
Step 16	The problem is	Go to step 17.
Assign the correct wireless network to the printer.	solved.	
Did this fix the problem?		
Step 17	Go to step 18.	Contact the network
Are the other devices on the wireless network communicating properly?		administrator.
Step 18 Verify that the wireless card is properly seated on the controller board.	Go to step 20.	Go to step 19.
Is the wireless card seated correctly?		
Step 19	The problem is	Go to step 20.
Properly reseat the wireless card.	solved.	
Did this fix the problem?		
Step 20	Go to step 22.	Go to step 21.
If there is an attached antenna, is the antenna damaged?		
Step 21 Replace the antenna.	The problem is solved.	Go to step 22.
Did this fix the problem?		
Step 22	Go to step 24.	Go to step 23.
Verify that the antenna is properly connected to the wireless card.		
Is it connected correctly?		
Step 23	The problem is	Go to step 24.
Properly connect the antenna.	solved.	
Did this fix the problem?		
Step 24	The problem is	Go to step 25.
Replace the wireless card.	solved.	
Did this fix the problem?		
Step 25	The problem is	Contact the next
Replace the controller board. See <u>"Controller board removals" on page 245</u> .	solved.	level of support.
Did this fix the problem?		

Service menus

Understanding the printer control panel

Using the printer control panel


MS510dn and MS610dn

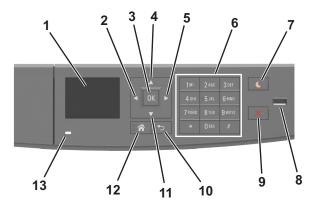

#	Use the	То
1	Display	View the printer status and messages.
		Set up and operate the printer.
2	Left arrow button	Scroll to the left.
3	Select button	Select menu options.
		Save settings.
4	Up arrow button	Scroll up.
5	Right arrow button	Scroll to the right.
6	Keypad	Enter numbers, letters, or symbols.
7	Sleep button	Enable Sleep mode or Hibernate mode.
		The following actions wake the printer from Sleep mode:
		Pressing any hard button
		Opening a tray or the front door
		Sending a print job from the computer
		Performing a power-on reset using the main power switch
		Attaching a device in the USB port
8	USB port	Connect a flash drive to the printer.
		Notes:
		 Only the front USB port supports flash drives.
		This feature is available only in select printer models.
9	Stop or cancel button	Stop all printer activities.

#	Use the	То
10	Back button	Return to the previous screen.
11	Down arrow button	Scroll down.
12	Home button	Go to the home screen.
13	Indicator light	Check the status of the printer.

MS610de

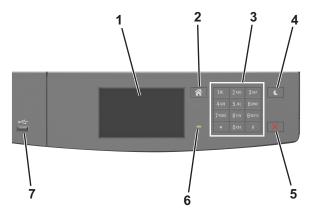

#	Use the	То
1	Display	View the printer status and messages.
		Set up and operate the printer.
2	Home button	Go to the home screen.
3	Keypad	Enter numbers, letters, or symbols.
4	Sleep button	Enable Sleep mode or Hibernate mode.
		The following actions wake the printer from Sleep mode:
		Touching the screen
		Pressing any hard button
		Opening a tray or the front door
		 Sending a print job from the computer
		Performing a power-on reset using the main power switch
		Attaching a device to a USB port
5	Stop or cancel button	Stop all printer activities.
6	Indicator light	Check the status of the printer.
7	USB port	Connect a USB Bluetooth adapter or a flash drive to the printer.
		Note: Only the front USB port supports flash drives.

Understanding the colors of the indicator and Sleep button lights

The colors of the indicator and Sleep button lights on the printer control panel signify a certain printer status or condition.

Indicator light	Printer status
Off	The printer is off or in Hibernate mode.
Blinking green	The printer is warming up, processing data, or printing.
Solid green	The printer is on, but idle.
Blinking red	The printer requires user intervention.

Sleep button light	Printer status
Off	The printer is idle or in Ready state.
Solid amber	The printer is in Sleep mode.
Blinking amber	The printer is waking from or entering Hibernate mode.
Blinking amber for 0.1 second, then goes completely off for 1.9 seconds in pulsing pattern	The printer is in Hibernate mode.

Menus list

Paper Menu	Reports	Network/Ports
Default Source	Menu Settings Page	Active NIC
Paper Size/Type	Device Statistics	Standard Network ³
Configure MP	Network Setup Page ²	Reports
Substitute Size	Profiles List	Network Card
Paper Texture	Print Fonts	TCP/IP
Paper Weight	Print Directory	IPv6
Paper Loading	Print Demo	Wireless
Custom Types	Asset Report	AppleTalk
Custom Names ¹		Standard USB
Universal Setup		Parallel ⁴
		SMTP Setup

Security	Settings	Help
Miscellaneous Security Settings ⁴	General Settings	Print All Guides
Confidential Print	Flash Drive Menu ⁴	Print Quality
Disk Wiping ⁴	Print Settings	Media Guide
Security Audit Log		Print Defects Guide
Set Date and Time		Menu Map
		Information Guide
		Connection Guide
		Moving Guide
		Supplies Guide

¹ This menu appears only in touch-screen printer models.

Diagnostics menu

Entering the Diagnostics menu

- **1** Turn off the printer.
- **2** Press and hold **3** and **6** while turning on the printer. Release the buttons when the splash screen appears.

Registration

These settings adjust the margins of the black plane.

To set the Registration:

- **1** Print a Quick test page.
 - **a** From the Diagnostics menu, navigate to:

Registration > Quick Test

b Retain this page to determine the changes you need to make to the margin settings. The alignment diamonds in the margins should touch the margins of the page.

The Quick test page contains the following information:

- Printer registration settings
- Code levels
- Alignment diamonds at the top, bottom, and each side
- Horizontal lines for skew adjustment
- General printer information, including current page count, installed memory, processor speed, serial number, engine ID, and system card ID
- **2** Change the value of any of the margin settings.

² Depending on the printer setup, this menu item appears as Network Setup Page or Network [x] Setup Page.

³ Depending on the printer setup, this menu item appears as Standard Network or Network [x].

⁴ This feature is available only in select printer models.

Top Margin	-16 to +16	Increasing the value moves the image down the page. Always adjust the top before the bottom margin.
Bottom Margin	-20 to +20	Increasing the value moves the image toward the top of the page.
Left Margin	-25 to +25	Increasing the value moves the image toward the right margin. Always adjust the left before the right margin.
Right Margin	-30 to +30	Use this to adjust the printhead.

Note: The alignment of the left margin positions the black plane to the right or left. The alignment of the right margin does not alter the margins and should only be used to adjust the printhead.

PRINT TESTS

This test determines if the printer can print on paper from any of the input trays. Each installed tray is available within the Print Tests menu.

The content of the test page varies depending on the paper in the selected input tray.

- If the selected tray contains paper, then a page similar to the Quick Test page is printed but without the print registration diamonds information.
- If the selected tray contains envelopes, then an envelope print test pattern is printed. If Continuous is selected, then the envelope print test pattern is printed on the first envelope and the rest of the envelopes are blank.

The Print Test page always prints one-sided, regardless of the duplex setting or the presence of the duplex option.

- **1** Enter the Diagnostics menu, and then select **PRINT TESTS**.
- **2** Select the paper source.
- **3** Select any of the following:
 - Single—This option prints a single Print Test page (no buttons are active while the test page is printing).
 - **Continuous**—This option continuously prints the Print Test page until **X** is pressed.

Print Quality Pages

This enables the user to view the values of the printer settings and to test its ability to generate acceptable printed output.

The report consists of four pages. The printer always uses media from Tray 1 to print this report. It will not prompt for a change in media regardless of the media type in Tray 1.

Note: This test cannot be canceled after it has begun. If duplex is activated, then the report is printed in duplex.

To print the Print quality pages:

From the Diagnostics menu, navigate to **Print Tests** > **Print Quality Pages**.

Hardware Tests

If the hardware test fails, replace the failing part.

Panel Test

This test verifies the function of the control panel display.

1 Enter the Diagnostics menu, and then navigate to:

Hardware Tests > Panel Test

2 Exit the test.

Button Test

This test verifies the control panel button function except for the Sleep button.

To run the test for the MS510dn or MS610dn:

1 From the Diagnostics menu, navigate to:

Hardware Tests > Button Test

2 The panel displays **Press** and an icon matching one of the control panel buttons. Press the physical button that is represented by the icon, and the printer tests the function of that button.

If the test is successful, then the panel displays another icon to test.

If a button fails the test, or if a different button is pressed, then the panel displays **Test Failed** and returns to the main section of the Hardware tests menu. After three seconds of inactivity, the panel automatically returns to the main section of the Hardware tests menu.

If all buttons pass the test, then the panel displays **PASSED** and returns to the main section of the Hardware tests menu.

3 Press **X** or **Back** to exit the test.

To run the test for the MS610de:

1 From the Diagnostics menu, navigate to:

Hardware Tests > Button Test

- **2** With no buttons pressed, a pattern matching the control panel buttons is displayed. Press each control panel button one at a time, and the panel highlights the represented button in the matching pattern.
- **3** Release the button, and the highlight disappears.
- 4 Press X or Back to exit the test.

DRAM Test

This test checks the validity of the standard and optional dynamic random access memory (DRAM). The test repeatedly writes patterns of data to the DRAM to verify that each bit in the memory can be set and read correctly.

1 Enter the Diagnostics menu, and then navigate to:

HARDWARE TESTS > DRAM Test

- **2** Testing and resetting the printer messages appear on the display.
- 3 After the printer resets, the results of the test appear: DRAM Test [x] P:##### F:#####.
 - [x] represents the size of the installed DRAM.
 - **P:#####** represents the number of times the memory test passed and finished successfully. The maximum pass count is 999,999.
 - **F:**#### represents the number of times the memory test failed and finished with errors. The maximum pass count is 999,999.
- **4** After the maximum pass or fail count is reached or when all the DRAM has been tested, the test stops and the final results appear.

USB HS Test Mode

1 From the Diagnostics menu, navigate to:

Hardware Tests > USB HS Test Mode

2 Choose the desired port, and then choose the desired test.

Ports	Tests
Port 0	Test J
Port 1	Test K
Port 2	Test SEO NAK
Port 3	Test Packet
	Test Force Enable
Single Step Get Device	
Single Step Set Feature	

- **3** To exit the test, POR the printer.
- 4 If the test fails, replace the failing USB cable.

Duplex Tests

Quick Test

The Duplex quick test determines if the top margin at the back of a duplexed page is set correctly. This test prints a duplexed version of the Quick test page that can be used to adjust the duplex top margin. Use either Letter or A4 paper.

To run the Duplex quick test:

1 From the Diagnostics menu, navigate to:

Duplex Tests > Quick Test

- **2** Choose any of the following:
 - Single—Prints a single Quick test page.
 - Continuous—Continuously prints the Quick test pages until **X** is pressed.

The printer attempts to print the Quick test page from the default paper source. If the default paper source supports only envelopes, then the page is printed from Tray 1.

The Quick test page contains the following information:

- Printer registration settings
- Code levels
- Alignment diamonds at the top, bottom, and each side
- Horizontal lines for skew adjustment
- General printer information, including current page count, installed memory, processor speed, serial number, engine ID, and controller board ID
- **3** Check the Quick test page for the correct offset between the placement of the first scan line on the front and back side of a duplexed sheet.
- **4** If adjustment is necessary, the top margin in the Registration menu must be adjusted first. The duplex top margin offset may be adjusted next. A positive offset moves the text down the page and widens the top margin, while a negative offset moves the text up the page and narrows the top margin.

Top Margin

This setting controls the offset between the placement of the first scan line on the front and back side of a duplex sheet.

Note: If adjustment is necessary, the top margin in the Registration menu must be adjusted first. The duplex top margin may be adjusted next.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

Duplex tests > Top Margin

2 Change the margin values.

Changing the value by 1 unit moves the margin by 1/100 in. A positive value moves the text down the page and widens the top margin. A negative value moves the text up the page and narrows the top margin.

3 Depending on the printer model, press **OK** or touch ✓ to save the desired margin value.

Left Margin

This setting allows the user to shift the position of the left margin of the back side of a duplexed page to the left or right. The default margin is 1/4 in.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

Duplex Tests > Left Margin

2 Change the margin value.

Each increment corresponds to 4 pels at 600 dpi (0.00666 in. or 0.1693 mm). A more positive offset moves the margin to the right, and a more negative offset moves the margin to the left.

3 Depending on the printer model, press **OK** or touch \checkmark to save the desired margin value.

Sensor Test

Use this test to determine if the duplex sensor and switches are working properly.

To run this test:

1 From the Diagnostics menu, navigate to:

Duplex Tests > Sensor Test

2 Testing... appears while the printer is verifying the state of the sensor.

The control panel displays the current state of the sensor.

- **3** Manually actuate the sensor to make it toggle between **Open** and **Closed**. If the sensor does not toggle, then it is malfunctioning.
- **4** Press **X** to exit the test.

Duplex Feed 1

This test feeds a blank sheet of paper from Tray 1 to the duplex paper stop position 1. This test can be run using any of the supported paper sizes.

To run this test:

1 From the Diagnostics menu, navigate to:

Duplex Tests > Duplex Feed 1

The power indicator blinks while the paper is feeding, and **Duplex Feed 1 Feeding...** appears. This test cannot be canceled. The panel displays **Duplex Feed 1 Clear Paper** when the paper reaches the duplex paper stop position 1.

- **2** Remove the sheet of paper from the duplex unit, and shut the duplex door.
- **3** Press **X** to clear the message.

Input tray tests

Feed Tests

This test feeds blank pages through the paper path. It can run using any of the paper or envelope sizes supported by the printer.

To run the Feed test:

1 From the Diagnostics menu, navigate to:

Input Tray Tests > Feed Tests

- **2** Choose the input source. All installed sources appear.
- **3** Choose any of the following:
 - **Single**—Feeds a single page.
 - **Continuous**—Continuously feeds pages until **X** is pressed.

Sensor Test

Use this test to determine if the input tray sensors are working correctly.

1 From the Diagnostics menu, navigate to:

Input Tray Tests > Sensor Test

2 Select the input source. All installed sources appear.

Not all sensors appear for all trays. The following table indicates which tray sensors are available for each input source:

Input source	Tray empty sensor	Pass through sensor
Standard tray	✓	
Optional 250-/550-sheet tray	✓	<
Multipurpose feeder	✓	

- **3** Manually actuate each sensor. The tray empty sensor can be actuated by hand; however, a sheet of paper can be used to cover the pass through sensor.
- **4** Press **X** to exit the test.

Output Bin Tests

Feed Tests

This test verifies that media can be fed to a specific output bin. No information is printed on the media.

To run this test:

1 From the Diagnostics menu, navigate to:

Output Bin Tests > Feed Tests

- 2 Select the output bin into which you want the paper to exit. All installed output bins appear.
- **3** Select one of the following:
 - Single—Feeds a single page.
 - Continuous—Continuously feeds pages until **X** is pressed.

Sensor Test

This test verifies that the output bin sensors are working correctly.

To run this test:

1 From the Diagnostics menu, navigate to:

Output Bin Tests > Sensor Test > Standard Bin

Testing... appears while the printer is verifying the state of the sensor.

The control panel displays the current state of the sensor.

- **2** Manually actuate the sensor to make it toggle between **empty** and **full**. If the sensor does not toggle, then the sensor is malfunctioning.
- **3** Press **X** to exit the test.

BASE SENSOR TEST

Use the Base Sensor Test to determine that the sensors located inside the printer are operating correctly.

The following sensors can be checked using this test:

- Narrow Media
- Input
- Exit
- Front Door



CAUTION—SHOCK HAZARD: Do not use your hand to toggle these switches. Use a nonconducting item.

To run the Base Sensor Test.

- **1** From the Diagnostics menu, navigate to **BASE SENSOR TEST**.
- 2 Choose a sensor.
- 3 Manually actuate the sensor to verify that it toggles. If the sensor does not toggle, then it is malfunctioning.

Sensor	Values	
Input	Open	
Output	Closed	
Front Door		
Narrow Media	Narrow	
	Wide	

4 Press **X** to exit the test.

Device Tests

Quick Disk Test

This test performs a non-destructive read/write test on one block per track on the disk. The test reads one block on each track, saves the data, and then writes and reads four test patterns to the bytes in the block. If the block is good, then the saved data is written back to the disk.

Note: This test is available only on the MS610de model.

To run the quick disk test:

1 From the Diagnostics menu, navigate to:

Device Tests > Quick Disk Test.

- The power indicator blinks while the test is in progress.
- Quick Disk Test/Test Passed appears if the test passes.
- Quick Disk Test/Test Failed appears if the test fails.
- **2** Press **X** to return to the Device tests menu.

Disk Test/Clean

Warning—Potential Damage: This test destroys all data on the disk and should not be attempted on a good disk. This test may run approximately 1.5 hours, depending on the disk size.

Note: This test is available only on the MS610de model.

1 From the Diagnostics menu, navigate to:

DEVICE TESTS > Disk Test/Clean

Contents will be lost appears.

- **2** Do one of the following:
 - Touch

 to continue.
 - Press X to cancel.

The test cannot be stopped or canceled after it has begun.

- **3** After the test is complete, a message appears indicating a pass or fail result.
- **4** Press **X** to return to the Device tests menu.

Flash Test

This test verifies the condition of the flash device by writing data to it and then reading data from it.

Warning—Potential Damage: This test destroys all data on the flash device.

Note: After this test is executed, reformat the flash using the Flash Format setting in the Utilities menu.

1 From the Diagnostics menu, navigate to:

Device Tests > Flash Test

Files will be lost. Go/Stop? appears.

- **2** Do one of the following:
 - Depending on the printer model, press **OK** or touch \checkmark to continue.
 - Press X to cancel.

Note: When the test starts, it cannot be stopped or canceled.

- **3** After the test is complete, a message appears indicating a pass or fail result.
- **4** Press **X** to return to the Device tests menu.
- **5** Reformat the flash device using the Flash format setting in the Utilities menu.

Printer Setup

Defaults

Warning—Potential Damage: Modification of the printer setting Defaults causes the NVRAM space to be restored to the printer factory settings.

This setting is used by the printer to determine whether U.S. or non-U.S. factory default values should be used. The following printer settings have different U.S. and non-U.S. values:

Printer default values	U.S. value	Non-U.S. value
Paper Sizes setting in the General Settings menu	U.S.	Metric
Default Paper Size (paper feeding sources which do not have hardware size sensing capabilities)	Letter	A4
Default Envelope Size (envelope feeding sources which do not have hardware size sensing capability)	10 Envelope	DL Envelope
Fax media size	Letter	A4
PCL Symbol Set	PC-8	PC-850
PPDS Code Page	437	850
Universal Units of Measure	Inches	Millimeters

To change this setting:

1 From the Diagnostics menu, navigate to:

Printer Setup > Defaults

- 2 Choose U.S. or Non-U.S.
- **3** Do one of the following:
 - Depending on the printer model, press **OK** or touch \checkmark to save any changes.
 - Press **X** to return to the Printer setup menu.

Printed Page Count

The value of this setting gauges the amount of usage on the printer. The value of the Printed Page Count setting will equal the values of the Picked Sides meter. After all print tests have been completed, the value will reset to zero.

Note: The value of the setting cannot be changed manually.

Permanent Page Count

The value of this setting indicates the total amount of pages that have been printed. After all print tests have been completed, the value will reset to zero.

Note: The Permanent Page Count value cannot be reset.

Processor ID

This is a 16-digit hexadecimal value representing the ID of the processor on the controller card.

Engine Setting [x]

These settings are used by Engine code ECs to fix field problems. The value of [x] is any value from 1 to 16.

Edge to Edge

When set to On, this shifts all four margins (top, bottom, left, and right) to the physical edge of the page (printable area of a supported paper size). This feature does not work in PPDS emulation.

Par S Strobe Adj

This setting adjusts the factory setting for the amount of time the strobe is sampled to determine that valid data is available on the parallel port.

Each time the value is increased by one, the strobe is sampled 50 nanoseconds longer. Each time the value is decreased by 1, the strobe is sampled 50 nanoseconds less than the default value. The range of values is between -4 and +6, in increments of one. A value of zero indicates no change is made from the factory setting.

EP Setup

EP Defaults

This setting restores each printer setting listed in EP SETUP to its factory default value. Sometimes this is used to help correct print quality problems.

To restore the EP defaults:

1 From the Diagnostics menu, navigate to:

EP Setup > EP Defaults

2 Select **Restore** to restore the default values, or press **X** to exit without changing the settings.

Fuser Temperature (Fuser Temp)

This setting adjusts the fuser temperature to solve problems with paper curl on low-grade paper and/or melting of letterheads on some papers.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

EP Setup > Fuser Temp

2 Press **OK** or touch \checkmark to save any changes.

Transfer Adjust

This setting controls the transfer roll algorithm.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

EP Setup > Transfer Adjust

2 Press **OK** or touch to save any changes.

Print Contrast

This setting controls the developer voltage offset.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

EP Setup > Print Contrast

2 Press **OK** or touch to save any changes.

Charge Roll

This setting controls the charge roll voltage.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

EP Setup > Charge Roll

2 Press **OK** or touch \checkmark to save any changes.

Gap Adjust

The setting adjusts the minimum gap between sheets. Increasing this value may reduce curl of some printed media and eliminate some output bin stacking problems. However, increasing this value also results in slower overall performance, measured in pages per minute.

The range of values is 0 to 255, and the default value is 0.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

EP Setup > Gap Adjust

2 Press **OK** or touch \checkmark to save any changes.

Auto Dark Adj

When activated, this setting attempts to optimize the amount of toner used when printing with a specific operating point.

Each time this setting executes, the printer performs the following:

- Calibrates its toner density sensor
- Measures the reflectivity of its bare drum
- Prints patches on the drum and measures the reflectivity of the drum through the patches
- Cleans the transfer roll
- Calculates reflectivity ratios and operating points to attain the darkness target of each operating point
- Modifies the EP mechanism as necessary to adjust toner darkness

The cartridge smart chip controls how often this process executes.

Note: No messages are displayed on the control panel to give any indication that this test is running. The device stores the results of its most recent process in the Auto dark adj field on the Menu settings page report.

When deactivated, the printer disables and never executes this process.

To adjust this setting:

1 From the Diagnostics menu, navigate to:

EP Setup > Auto Dark Adj

- 2 Choose Enable or Disable.
- **3** Press **OK** to save any changes.

Reports

Menu Settings Page

This setting prints the Menu Settings Page. The report prints the Diagnostics Menu settings and their current values.

Event Log

Display Log

This version of the Event log displays the panel text that appeared when the event occurred.

To view the Event log:

1 From the Diagnostics menu, navigate to:

Event Log > Display Log

2 Use the arrow buttons to navigate through the entries.

Print Log

Additional diagnostic information is available when the event log is printed. The first page of the report shows the general device information.

The specific events that appear in the report vary depending on the operational history of the printer. Logs may be printed from the following events:

- Job accounting log failures
- NV reset failures
- NV mirror entries
- 9yy and 1yy (print engine) service error entries
- Programming error entries
- Maintenance count reset entries
- Clear log entries
- · Paper jam entries
- Firmware update entries
- JFFS2 partition format entries
- USB setup pkt info entries
- Supply event entries

To print the Event log:

From the Diagnostics menu, navigate to **Event Log** > **Print Log**.

Clear Log

Use this to remove all the current information in the Event log. This affects both the viewed log and the printed log information.

To clear the event log:

1 From the Diagnostics menu, navigate to:

Event Log > Clear Log

- **2** Choose any of the following:
 - Yes—To clear the Event log
 - No—To exit the Clear log menu

Exit Diags

Select this to exit the Diagnostics menu. The printer performs a POR and restarts in normal mode.

In MS610de, this menu appears as a soft button at the bottom right corner of the display. This is always accessible to the user from the main Diagnostics menu.

Configuration menu

The Configuration menu group consists of menus, settings, and operations that are used to configure a printer for operation.

Entering the Configuration menu

- **1** Turn off the printer.
- **2** Press and hold **2** and **6** while turning on the printer. Release the buttons when the splash screen appears.

Maintenance Counter Value

When this is selected, the printer displays the current value for the maintenance kit counter. This counter tracks printer usage. A print job containing a single page increments the counter by one, while a duplex print job increments the counter by two. When the value has reached the rated life of the maintenance kit, it reminds the user that scheduled maintenance is required. See "Maintenance kits" on page 326. The counter must be reset after the maintenance kit is installed.

To view the maintenance counter value:

- **1** From the Configuration menu, navigate to **Maintenance Counter Value**. The value is displayed and cannot be changed.
- **2** Press **Back** or **X** to return to the Configuration menu.

Reset Maintenance Counter

After installing the maintenance kit, the maintenance counter must be reset.

To reset the maintenance counter:

- **1** From the Configuration menu, navigate to **Reset Maintenance Counter**.
- **2** Depending on the printer model, press **OK** or touch \checkmark to reset the counter, or press **X** to exit without resetting the counter.

Once initiated, the operation cannot be canceled.

Print Quality Pages

This option is a limited version of the Print quality pages setting that appears in the Diagnostics menu. See <u>"Print Quality Pages" on page 177</u>. This setting reports the values of a broad range of printer settings and tests the ability of the printer to generate acceptable printed output.

To print the report:

- 1 From the Configuration menu, navigate to Print Quality Pages.
- 2 Depending on the printer model, press **OK** or touch **≤** to print the pages, or press **X** to exit without printing the pages.

Printing Quality Test Pages appears on the display. Once started, the printing cannot be canceled and no buttons are active until the printing completes.

Reports

Menu Settings Page

This report generates a list of the Configuration menu settings and the value of each setting.

To print the Menu settings page from the Configuration menu:

1 From the Configuration menu, navigate to:

Reports > Menu Settings Page

2 Depending on the printer model, press **OK** or touch **✓** to print the page, or press **X** to return to the Configuration menu.

Event Log

This generates a printed report of the events detailed in the Print log. See "Print Log" on page 189.

To print the Event log from the Configuration menu:

1 From the Configuration menu, navigate to:

Reports > Event Log

2 Press **X** to return to the Configuration menu.

Panel Menus

This enables or disables the control panel menus.

Available options:

- On—Menus enabled
- Off-Menus disabled

PPDS Emulation

The value of this option determines if a printer can recognize and use the PPDS data stream.

Available options:

- Deactivate
- Activate

Download Emuls

This appears only if at least one download emulator (DLE) is installed. The default setting is Disable. All download emulators (DLEs) are reenabled automatically after two PORs.

Safe Mode

The settings for this menu item are On and Off (default). When enabled, Safe Mode lets the printer operate in a special limited mode in which it attempts to continue offering as much functionality as possible despite known issues.

Available options:

- On
- Off

Factory Defaults

Warning—Potential Damage: This operation cannot be undone.

This setting enables a user to restore all of the printer settings to either the network settings (on network models only) or to the base printer settings.

To restore Factory Default settings:

- 1 From the Configuration Menu, navigate to Factory Defaults.
- 2 Select from the available options:
 - Restore Base—restores all non-critical base printer NVRAM settings.
 - Restore STD Net—restores all network NVRAM settings.
 - Restore LES (available on the touch screen models only)—restores the factory default values for all framework, standard applications and eSF configuration by removing all non-standard applications; and clears the SE logs.

After this setting is changed, the device automatically performs a POR, and restores the appropriate settings to their factory default values.

Energy Conserve

This setting controls which values appear on the Power Saver menu.

To change the setting:

- **1** From the Configuration menu, navigate to **Energy Conserve**.
- 2 Select On or Off.

If On (default), then the Sleep Mode cannot be turned off. If Off, then **Disabled** appears on the Sleep Mode menu, and it can be turned off.

Paper Prompts

This controls which tray a change prompt is directed to when paper is sensed to be the wrong size.

Note: The value of "Action for Prompts" on page 194 may override the value of this setting.

To change this setting:

- **1** From the Configuration menu, navigate to **Paper Prompts**.
- **2** Select from the available options:
 - Auto (default)
 - Multi-purpose Feeder
 - Manual Paper
- 3 Depending on the printer model, press **OK** or touch ✓ to save the setting, or press **X** to return to the Configuration menu without saving any changes.

When it is set to **Auto**, the emulator selected to print the job determines which of the installed input sources will receive the change prompt. When set to a value other than Auto, the selected source always receives this type of prompt.

Envelope Prompts

This controls which tray a change prompt is directed to when the envelopes are sensed to be the wrong size.

Note: The value of "Action for Prompts" on page 194 may override the value of this setting.

To change this setting:

- **1** From the Configuration menu, navigate to **Envelope Prompts**.
- **2** Select from the available options:
 - Auto (default)
 - Multi-purpose Feeder
 - Manual Envelope
- 3 Depending on the printer model, press **OK** or touch ✓ to save the setting, or press **X** to return to the Configuration menu without saving any changes.

When it is set to **Auto**, the emulator selected to print the job determines which of the installed input sources will receive the change prompt. When set to a value other than Auto, the selected source always receives this type of prompt.

Action for Prompts

This setting enables a user to determine which input source would receive paper-related or envelope-related change prompts when they occur. Regardless of the target source, the printer always requires some type of user assistance to resolve the change prompt (examples: pushing a button to ignore the prompt and changing the source's installed media). However, this setting gives a user the option of having the printer resolve change prompt situations without requiring any user assistance.

To change this setting:

- 1 From the Configuration menu, navigate to **Action for Prompts**.
- **2** Select from the available options to change the setting.
 - Prompt User (default)
 - Continue
 - Use Current
- 3 Depending on the printer model, press **OK** or touch ≤ to save the setting, or press **X** to return to the Configuration menu without saving any changes.

When set to **Prompt user**, the printer behaves like the past implementation. When a change prompt occurs, the printer stops printing, posts the change prompt to the target source, and waits for the user to select an action before continuing.

When set to **Continue**, the printer automatically assumes that the user selects **Continue** every time a change prompt is encountered. Likewise, when the device is set to **Use Current**, all change prompts will perform as if **Use Current** was selected by the user.

Jobs on Disk

This setting appears only if a hard disk is installed. It allows buffered jobs to be deleted from the disk. This does not affect Print and Hold or parked jobs.

To change the setting:

- **1** From the Configuration menu, navigate to **Jobs on Disk**.
- **2** Select from the available options to change the setting:
 - Delete
 - Do Not Delete (default)
- **3** Press **X** to return to the Configuration menu.

Disk Encryption

Warning—Potential Damage: If the settings are changed, then the printer completely formats the hard disk. All information on the disk will be unrecoverable.

This setting appears only if a hard disk is installed. It controls whether the printer encrypts the information that it writes to the hard disk.

To change the setting:

- **1** From the Configuration menu, navigate to **Disk Encryption**.
- **2** Select from the available options to change the setting.
 - Enable—enables encryption of hard disk.
 - Disable (default)—enables formatting of hard disk.
- **3 Contents will be lost. Continue?** appears. Select **Yes** to proceed with the encryption or formatting of the disk, or **No** to cancel the operation. If Yes is selected, then a progress bar appears on the display that indicates the overall completion of the selected operation. After completion, the display returns to Disk Encryption.

Wipe All Settings

This makes any sensitive information that may exist on the volatile or non-volatile storage of the device completely indecipherable. When selected, the printer performs a non-critical NVRAM reset and then reboots.

Font Density

This creates microscopic holes in all black text. The holes save toner by reducing overlapping toner.

Available options: 1 to 5

Font Sharpening

This allows a user to set a text point-size value below which the high-frequency screens will be used when printing font data.

Available options:

- Off
- On

Reduced Curl

When on, this setting significantly reduces throughput and should be activated only as a last resort to solve paper curl problems. The printer uses this mode only when the media type is set to Paper.

Available options:

- Off
- On

Require Standby

Note: This setting is available only on the MS610de model.

This sets Standby Mode to On or Off. The default is On.

To change the setting:

- 1 From the Configuration menu, navigate to Require Standby.
- **2** Select **On** or **Off** to change the setting.
- 3 Depending on the printer model, press **OK** or touch ✓ to save the setting, or press **X** to return to the Configuration menu without saving any changes.

If Standby mode is On, the printer begins functioning in Standby mode when it remains idle for an amount of time.

The Standby mode enables the printer:

- To consume less energy than when operating in normal mode but not as little as when operating in Power saver.
- To return to the Ready state more quickly than when operating in power saver. If set to Off, this setting disables Standby mode in the General settings menu.

A5 Loading

This determines the orientation used when printing on A5 paper.

Available options:

- Long Edge—The printer will print A5-size paper in the long-edge feed orientation from all trays.
- Short Edge—The printer will print A5-size paper in the short-edge feed orientation from all trays.

UI Automation

Once enabled, this setting creates an **ENABLE_UI_AUTOMATION** file in the /var/fs/shared/ directory. As long as this file exists, the printer permits external developers to test the stability of their applications against the printer to make sure that their applications have an appropriate level of stability. Disabling this setting deletes the file and prohibits automated testing.

To change the setting:

- **1** From the Configuration menu, navigate to **UI Automation**.
- **2** Select from the available options to change the setting.
 - Enable
 - Disable (default)
- 3 Depending on the printer model, press **OK** or touch ✓ to save the setting, or press **X** to return to the Configuration menu without saving any changes.

Key Repeat Initial Delay

Note: This setting is available only on the MS610de model.

This setting determines the length of delay before a repeating key starts repeating. The range is 0.25–5 seconds, with increments of 0.25. The default setting is one second.

To adjust this setting:

- 1 From the Configuration menu, navigate to **Key Repeat Initial Delay**.
- **2** Touch the arrow keys to adjust the setting.
- **3** Touch to save the setting, or press **X** to return to the Configuration menu without saving any changes.

Key Repeat Rate

Note: This setting is available only on the MS610de model.

This setting indicates the number of presses per second for repeating keys. The range is 0.5–100, with increments of 0.5. The default setting is 15 presses per second.

To adjust this setting:

- 1 From the Configuration menu, navigate to **Key Repeat Rate**.
- 2 Touch the arrow keys to adjust the setting.
- **3** Touch ✓ to save the setting, or press **X** to return to the Configuration menu without saving any changes.

Clear Supply Usage History

This setting reverts the supply usage history (number of pages and days remaining) to the factory shipped level.

To clear the supply usage history:

- 1 From the Configuration menu, navigate to Clear Supply Usage History.
- 2 Depending on the printer model, press **OK** or touch **Clear Supply Usage History** to proceed.

Clear Custom Status

Executing this operation erases any strings that have been defined by the user for the default or alternate custom messages.

To clear the custom status:

- **1** From the Configuration menu, navigate to **Clear Custom Status**.
- 2 Depending on the printer model, press **OK** or touch **Clear Custom Status** to proceed.

USB Speed

This setting is used to set the throughput of the USB port on the printer.

Available options:

- Auto
- Full—Forces the USB port to run at full speed and also disables its high-speed capabilities.

Automatically Display Error Screens

If On, the panel automatically displays any existing printer-related IR after the printer remains inactive on the home screen for a length of time equal to the Screen timeout setting in the Timeouts section of the General settings menu. Any IR that appears on the display will give the user the option of returning to the home screen without clearing it. From the home screen, any other workflow or feature can be initiated as usual. Once the printer returns to the home screen, any existing IR will again appear after the printer remains inactive for a length of time equal to the Screen timeout setting.

To change this setting:

- 1 From the Configuration menu, navigate to Automatically Display Error Screens.
- 2 Select from the available options:
 - On (default)
 - Off
- 3 Depending on the printer model, press **OK** or touch ✓ to save the setting, or press **X** to return to the Configuration menu without saving any changes.

USB PnP

In some cases, the USB port at the back of the printer may be incompatible with the chipset in a user's PC. This setting lets the user change the USB driver mode to improve its compatibility with these PCs.

Available options:

- 1
- 2

Restore Factory Defaults

Restore Settings

This setting enables a user to restore all of the printer settings to either the network settings (on network models only) or to the base printer settings.

To restore the settings:

- 1 From the Configuration menu, navigate to **Restore Factory Defaults** > **Restore Settings**.
- **2** Select from the available options:
 - Restore Printer Settings—restores all non-critical base printer NVRAM settings.
 - Restore Network Settings—restores all network NVRAM settings.
 - Restore Apps—restores the factory default eSF configuration.

Erase Printer Memory

This makes any sensitive information that may exist on the volatile or non-volatile storage of the device completely indecipherable. When selected, the printer performs a non-critical NVRAM reset and then reboots.

Erase Hard Disk

This setting performs a wipe of the printer hard disk, erasing all data.

Warning—Potential Damage: This deletes all data on the printer hard disk, including downloaded fonts, macros, and held jobs. Do not initiate a disk wipe if you have information on the printer that you want to save.

Available options:

- Single Pass Erase—overwrites all data and the file system. This wipe is faster but less secure since it is possible to retrieve the deleted data with forensic data-retrieval techniques.
- Multi Pass Erase—overwrites all data without rewriting the file system. This wipe is DoD 5220.22-M compliant since the deleted data is irretrievable.

Note: If the printer is reset while a disk wipe operation is executing, then **Corrupt Disk** appears upon regaining power.

Entering Invalid engine mode

This mode allows the printer to load the correct firmware code.

- **1** Turn off the printer.
- 2 From the control panel, press and hold the 3, 4, and 6 while turning on the printer.
- **3** Release the buttons after 10 seconds.

Entering Recovery mode

This mode will allow the printer to boot from a secondary set of instructions to allow a code flash to the printer. Code can be flashed from a PC by USB.

- **1** Turn off the printer.
- 2 Press and hold 7, 2, and 8 simultaneously.
- **3** Turn on the printer.
- 4 Release the buttons after 10 seconds.

Accessing the Network SE menu

This menu contains settings for fine tuning the communication settings for the network interfaces and protocols.

1 Navigate to:

Networks/Ports > Standard Network > Standard Network Setup.

2 Press and hold **6**, **7**, and **9** simultaneously.

Service engineer menu

Accessing the service engineer (SE) menu

From a Web browser on a host PC, add /se to the printer IP address.

Service engineer (SE) menu

This menu should be used as directed by the next level of support.

Top level menu	Intermediate menu
Print SE Menus	
General	Copyright — Displays copyright information
Code Revision Info	 Network code level — Displays network code level Network Compile Info — Displays network compile information Printer Code Level — Displays printer code information Printer Compile Info — Displays compile information
History	Print HistoryMark HistoryHistory Mode
MAC	Set Card SpeedLAAKeep Alive
NVRAM	Dump NVRAM Reinit NVRAM
TCP/IP	 netstat-r arp-a Allow SNMP Set MTU Meditech Mode RAW LPR Mode Gather Debug Enable Debug

Parts removal

Removal precautions



CAUTION—SHOCK HAZARD: For personal safety and to prevent damage to the printer, remove the power cord from the electrical outlet before you connect or disconnect any cable, electronic board or assembly.

Data security notice

- 1 This printer contains various types of memory that are capable of storing device and network settings, information from embedded solutions, and user data. The types of memory, along with the types of data stored by each, are described below.
 - **Volatile memory**—This device utilizes standard Random Access Memory (RAM) to temporarily buffer user data during simple print and copy jobs.
 - **Non-volatile memory**—This device may utilize two forms of non-volatile memory: EEPROM and NAND (flash memory). Both types are used to store the operating system, device settings, network information, scanner and bookmark settings, and embedded solutions.
 - Hard disk memory—Some devices have a hard disk drive installed. The printer hard disk is designed for device-specific functionality and cannot be used for long term storage for data that is not print-related. The hard disk does not provide the capability for users to extract information, create folders, create disk or network file shares, or transfer FTP information directly from a client device. The hard disk can retain buffered user data from complex print jobs, as well as form data and font data.

To erase volatile memory, turn off the printer.

To erase non-volatile memory, see the menu item under <u>"Configuration menu" on page 190</u> pertaining to this.

To erase the printer hard disk, see the menu item under <u>"Configuration menu" on page 190</u> pertaining to this.

The following parts are capable of storing memory:

- printer control panel
- UICC (User Interface Controller Card)
- controller board
- optional hard drives

Note: The printer control panel and controller board contain NVRAM.

2 After removing the old part, it must be returned to your next level of support.

Handling ESD-sensitive parts

Many electronic products use parts that are known to be sensitive to electrostatic discharge (ESD). To prevent damage to ESD-sensitive parts, use the following instructions in addition to all the usual precautions, such as turning off power before removing logic boards:

- Keep the ESD-sensitive part in its original shipping container (a special "ESD bag") until you are ready to install the part into the machine.
- Make the least-possible movements with your body to prevent an increase of static electricity from clothing fibers, carpets, and furniture.
- Put the ESD wrist strap on your wrist. Connect the wrist band to the system ground point. This discharges any static electricity in your body to the machine.
- Hold the ESD-sensitive part by its edge connector shroud (cover); do not touch its pins. If you are removing a pluggable module, use the correct tool.
- Do not place the ESD-sensitive part on the machine cover or on a metal table; if you need to put down the ESD-sensitive part for any reason, first put it into its special bag.
- Machine covers and metal tables are electrical grounds. They increase the risk of damage, because they
 make a discharge path from your body through the ESD-sensitive part. (Large metal objects can be discharge
 paths without being grounded.)
- Prevent ESD-sensitive parts from being accidentally touched by other personnel. Install machine covers when you are not working on the machine, and do not put unprotected ESD-sensitive parts on a table.
- If possible, keep all ESD-sensitive parts in a grounded metal cabinet (case).
- Be extra careful while working with ESD-sensitive parts when cold-weather heating is used, because low humidity increases static electricity.

Critical information for controller board or control panel replacement



CAUTION—POTENTIAL INJURY: The lithium battery in this product is not intended to be replaced. There is a danger of explosion if a lithium battery is incorrectly replaced. Do not recharge, disassemble, or incinerate a lithium battery. Discard used lithium batteries according to the manufacturer's instructions and local regulations.



ATTENTION—RISQUE DE BLESSURE: La batterie lithium de ce produit n'est pas destinée à être remplacée. Il existe un risque d'explosion si une batterie lithium est placée de façon incorrecte. Ne rechargez pas, ne démontez pas et n'incinérez pas une batterie lithium. Mettez les batteries lithium usagées au rebut selon les instructions du fabricant et les réglementations locales.



PRECAUCIÓN: POSIBLES DAÑOS PERSONALES: La batería de litio de este producto no debe reemplazarse. Existe riesgo de explosión si se sustituye incorrectamente una batería de litio. No recargue, desmonte ni incinere una batería de litio. Deseche las baterías de litio según las instrucciones del fabricante y las normativas locales.



VORSICHT – MÖGLICHE VERLETZUNGSGEFAHR Die Lithiumbatterie in diesem Produkt darf nicht ausgetauscht werden. Wird eine Lithiumbatterie nicht ordnungsgemäß ausgetauscht, besteht Explosionsgefahr. Lithiumbatterien dürfen auf keinen Fall wieder aufgeladen, auseinander genommen oder verbrannt werden. Befolgen Sie zum Entsorgen verbrauchter Lithiumbatterien die Anweisungen des Herstellers und die örtlichen Bestimmungen.

Warning—Potential Damage: Replace only one of the following components at a time:

- Control panel
- Controller board

To replace a component and to test whether the problem is resolved:

- **1** Replace the affected component.
 - **Warning—Potential Damage:** Do not perform a Power-On Reset (POR) until the problem is resolved. If a POR is performed at this point, then the replacement part can no longer be used in another printer and must be returned to the manufacturer.
- 2 Enter the Diagnostics Menu. The Diagnostics Menu allows you to temporarily use the replacement part.
 - **Warning—Potential Damage:** Some printers will perform automatically a POR if the Diagnostics Menu is not opened within five seconds. If a POR is performed at this point, then the replacement part can no longer be used in another printer and must be returned to the manufacturer.
- 3 Use the Diagnostics Menu to test the replacement part. Do a feed test to check if the problem is resolved.
 - If the problem is not resolved—Turn off the printer, and then reinstall the old part.
 - If the problem is resolved—Perform a POR.

Restoring the printer configuration after replacing the controller board


Restore the printer to its correct configuration to complete the replacement service. Use the Service Restore Tool to download the software bundle, and then flash the printer settings and embedded solutions.

Note: The software bundle contains the latest version of the firmware, applications, and software licenses from the Lexmark Virtual Solutions Center (VSC). The printer firmware may be at a different level from what was used before replacing the controller board.


Using the Service Restore Tool

- 1 Go to https://cdp.lexmark.com/service-restore-tool/ to access the tool.
- **2** Log in using your Lexmark or partner login.

 If your login fails, then contact your next level of support.
- **3** Enter the printer serial number, and then submit the information.

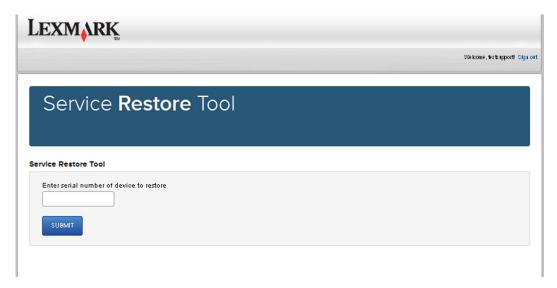


Note: Make sure that the serial number that appears on the verification screen is correct.

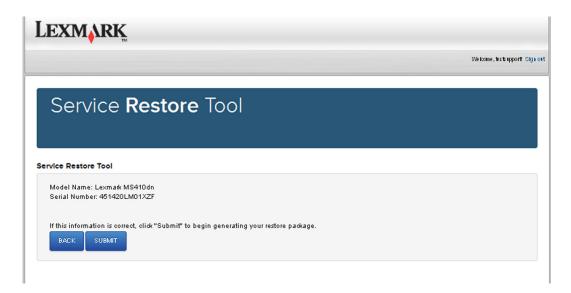

4 Save the zip file.


Note: Make sure that the serial number in the zip file matches the serial number of the printer being restored.

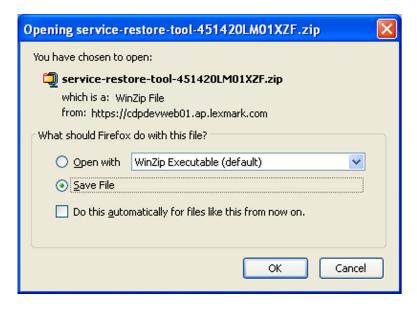

5 Extract the contents of the zip file, open the *Readme* file, and then follow the instructions in the file.

Notes:

- Perform the install instructions on the *Readme* file in the exact order shown. Restart the printer only if the file says so.
- For more information on how to flash the downloaded files, see "Updating the printer firmware" on page 207.
- To load the zip files that are extracted from the Service Restore Tool, see <u>"Restoring solutions,</u> licenses, and configuration settings" on page 206.

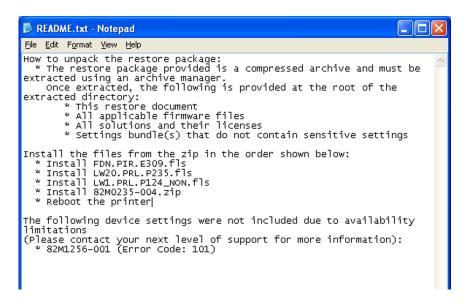

6 After performing the installation instructions in the *Readme* file, confirm from the customer if all the eSF apps have been installed.


Notes:

- If you are unable to access the administrative menus to verify that the printer is restored, then ask the customer for access rights.
- If a 10.00 error appears after you restart the printer, then contact the next level of support.

Restoring solutions, licenses, and configuration settings


To load the zip files that are extracted from the Service Restore Tool, do the following:

- **1** Open a Web browser, and then type the printer IP address.
- 2 Navigate to Settings > Configuration Files.

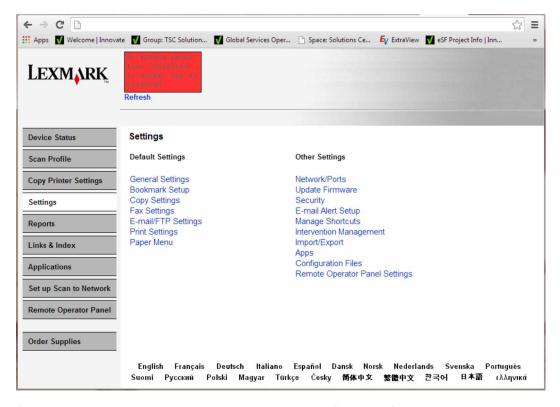

- **3** From the Configuration File History tab, navigate to **Import** > **Choose File**.
- **4** Select the zip file from the expanded Service Restore Tool package.

5 Click Import.

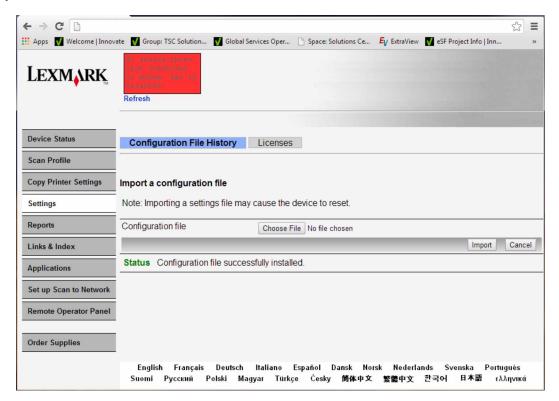

6 Repeat steps 3 through 5 for the other zip files that are included in the expanded zip file.

Updating the printer firmware

Warning—Potential Damage: Before updating the printer firmware, ask the next level of support for the correct code. Using an incorrect code level may damage the printer.

The printer must be in ready state in order to update the firmware.

Using a flash drive

This option is available only in printer models with front USB port.

Make sure to enable the Enable Drive and Update Code settings. You can find the settings in the Flash drive menu under the Settings menu.

- **1** Insert the flash drive into the USB port.
- 2 From the control panel, navigate to USB Menu: Print from USB > Accept or OK.
- **3** Select the file that you need to flash.

Note: Do not turn off the printer while the update is going on.

Using a network computer

Using the File Transfer Protocol (FTP)

Make sure that the printer is in ready state before flashing the printer.

- **1** Turn on the printer.
- 2 Obtain the IP address:
 - From the home screen
 - From the TCP/IP section of the Network/Ports menu
- **3** From the command prompt of a network computer, open an FTP session to the printer IP address.
- **4** Use a PUT command to place the firmware file on the printer.

 The printer performs a POR sequence and terminates the FTP session.
- **5** Repeat step 2 through step 4 for the other files.

Using the Embedded Web Server

Make sure that the printer is in ready state before flashing the printer.

- 1 Open a web browser, and then type the printer IP address.
- 2 From the home page, navigate to Configuration > Update Firmware.
- 3 Select the file to use.

The printer performs a POR sequence and terminates the FTP session.

4 Repeat step 2 through step 4 for the other files.

Backing up eSF solutions and settings

Note: Export the eSF solutions and settings from the printer before replacing the controller board.

Exporting eSF solutions and settings file

- 1 Reset the printer into Invalid engine mode. See "Entering Invalid engine mode" on page 199.
- **2** Open a web browser, and then type the printer IP address.

Note: If the web page cannot be accessed or an error occurs when starting the printer into Invalid engine mode, then data backup is not an option. Inform the customer that the data cannot be saved.

- 3 Navigate to Settings > Solutions > Embedded Solutions.
- **4** From the Embedded Solutions page, select the applications that you want to export.
- 5 Click Export.

Note: The size limit of the export file is 128 KB.

Importing eSF solutions and settings file

After replacing the controller board, import back to the printer the eSF solutions and settings that were exported.

- 1 Reset the printer into Invalid engine mode. See "Entering Invalid engine mode" on page 199.
- **2** Open a web browser, and then type the printer IP address.

Note: If the web page cannot be accessed or an error occurs when starting the printer into Invalid engine mode, then data backup is not an option. Inform the customer that the data cannot be saved.

- 3 Navigate to Settings > Solutions > Embedded Solutions.
- 4 From the Embedded Solutions page, select the applications that you want to import.
- 5 Click Import.

Ribbon cable connectors

Zero Insertion Force (ZIF) connectors

Zero Insertion Force (ZIF) connectors are used on the boards and cards used in this printer. Before inserting or removing a cable from these connectors, read this entire section. Great care must be taken to avoid damaging the connector or cable when inserting or removing the cable.

Warning—Potential Damage: Do not insert the cable so that the contacts are facing the locking actuator. The contacts always face away from the actuator.

Warning—Potential Damage: Do not insert the cable diagonally into the ZIF socket. This can cause damage to the contacts on the cable.

Warning—Potential Damage: Avoid using a fingernail, or sharp object to open the locking mechanism. This could damage the cable.

Warning—Potential Damage: Avoid pressing against the cable when opening the locking mechanism. This can also damage the cable.

These are the types of ZIF connectors used in this printer:

- Horizontal top contact connector
- Horizontal bottom contact connector
- Vertical mount contact connector
- Horizontal sliding connector

Horizontal top contact connector


This FRU contains a horizontal top contact cable connector. Read the instructions before proceeding.

The horizontal top contact connector uses a back flip locking actuator to lock the ribbon cable into the Zero Insertion Force (ZIF) connector. The cable is inserted horizontally into the connector.

Warning—Potential Damage: When opening or closing this type of actuator, gently lift or close the two tabs located on each end of the actuator. The two tabs should be moved simultaneously. Do not close the actuator from the center of the actuator.

Removing a cable from the horizontal top contact connector

1 Place a finger at each end of the locking actuator, and then gently lift the actuator to the unlocked position.

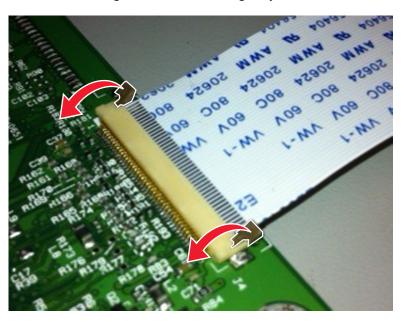

2 Slide the cable out of the connector.


Inserting a cable into the horizontal top contact connector

1 When installing the cable, check the locking actuator to ensure it is in the unlocked position. The tabs on the ends of the actuator are vertical when the actuator is unlocked.




2 Insert the cable with the contacts on the cable facing up. Insert the cable on top of the actuator.

Note: Verify that the cable is installed squarely into the connector. If the cable is not squarely installed, then intermittent failures could occur.

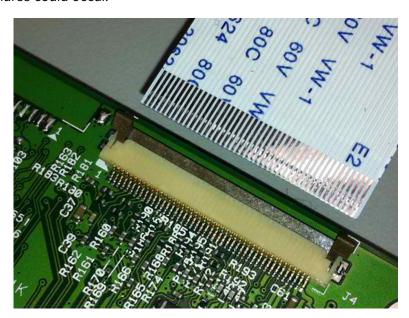

3 Rotate the locking actuator to the locked position. The cable should not move while this step is performed. If the cable moves, open the actuator, reposition the cable, and then close the actuator to the down position.

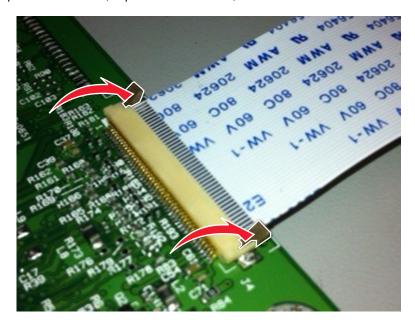

Horizontal bottom contact connector

This FRU contains a horizontal bottom contact cable connector. Read the instructions before proceeding.

The horizontal bottom contact connector uses a flip locking actuator to lock the ribbon cable into the Zero Insertion Force (ZIF) connector. The cable is inserted horizontally into the connector.

Warning—Potential Damage: When opening or closing this type of actuator, gently lift the center of the actuator using your finger. Do not use a fingernail or screwdriver to open the actuator. This could damage the ribbon cable. Do not close the actuator from the ends of the actuator.

Removing a cable from the horizontal bottom contact connector

1 Place two fingers towards each end of the locking actuator, and then gently lift the actuator to the unlocked position.



2 Slide the cable out of the connector.

Inserting a cable into the horizontal bottom contact connector

1 Check the actuator to verify it is in the open position.



2 Insert the cable into the ZIF connector with the contacts facing downward and away from the locking actuator. The cable needs to be inserted below the actuator.

Note: Verify that the cable is installed squarely into the connector. If the cable is not squarely installed, then intermittent failures could occur.



3 Place your finger in the middle of the actuator, and then rotate the locking actuator to the locked position.



Vertical mount contact connector


This FRU contains a vertical mount contact connector. Read the instructions before proceeding.

The vertical mount contact connector uses a back flip locking actuator to lock the ribbon cable into the Zero Insertion Force (ZIF) connector. The cable is inserted vertically into the connector.

Warning—Potential Damage: When opening or closing this type of actuator, gently lift the center of the actuator using your finger. Do not use a fingernail or screwdriver to open the actuator. This could damage the ribbon cable. Do not close the actuator from the ends of the actuator.

Removing a cable from the vertical mount contact connector

1 Gently rotate the locking actuator from the center of the actuator to the unlocked position.

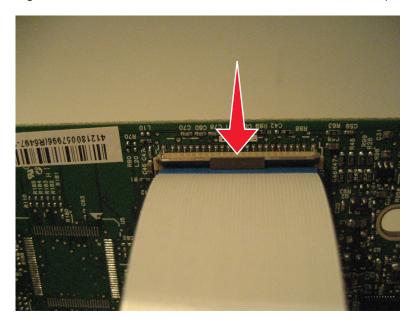

2 Slide the cable out of the connector.

Inserting a cable into the vertical mount contact connector

1 When installing the cable, check the locking actuator to verify it is in the open position.




2 Insert the cable with the contacts on the cable away from the locking actuator. Insert the cable on top of the actuator.

Note: Verify that the cable is installed squarely into the connector. If the cable is not squarely installed, then intermittent failures could occur.



3 Rotate the locking actuator to the locked position by pressing down on both ends of the actuator. The cable should not move when this step is performed. If the cable moves, open the actuator, reposition the cable, and then close the actuator to the down position.

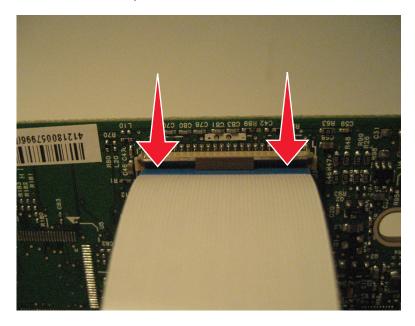

Horizontal sliding contact connector


This FRU contains a horizontal sliding contact connector. Read the instructions before proceeding.

The horizontal sliding contact connector uses a slide locking actuator to lock the ribbon cable into the Zero Insertion Force (ZIF) connector. The cable is inserted horizontally into the connector.

Warning—Potential Damage: When opening or closing this type of actuator, gently push or pull the two tabs located on each end of the actuator. Do not close the actuator from the center of the actuator. Do not use a screwdriver to open or close the actuator. Damage to the cable or connector could occur.

Removing a cable from the horizontal sliding contact connector

1 Simultaneously slide the two tabs located on the ends of the locking actuator away from the connector.

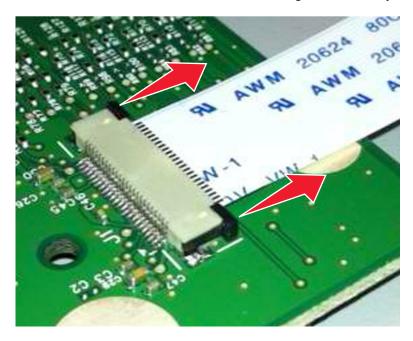

2 Slide the cable out of the connector.

Inserting a cable into the horizontal sliding contact connector


1 When installing the cable, check the locking actuator to verify it is in the open position. If you are opening the connector, pull back on both end tabs using equal force to avoid breaking the connector.



2 Insert the cable with the contacts on the cable facing away from the locking actuator. Insert the cable on top of the actuator.



3 Slide the locking actuator towards the connector, locking the cable into place. The cable should not move when this step is performed. If the cable moves, open the actuator, reposition the cable, and then close the actuator to the down position.

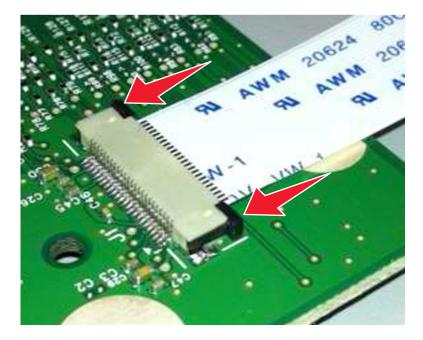


Low Insertion Force (LIF) connector

This FRU contains a Low Insertion Force (LIF) connector. Read the instructions before proceeding.

Warning—Potential Damage: When installing a cable into an LIF connector, care must be taken to avoid bending the edges of the cables and damaging the contacts on the cables.

Inserting a cable into the LIF connector

1 Looking at the connector, take note on which side the contacts are located. Many boards will have the word "contacts" stamped on them to indicate which side of the LIF has the contacts. When looking at the board, take note that the contacts from the board to the connector are located on the side of the connector with the contacts.

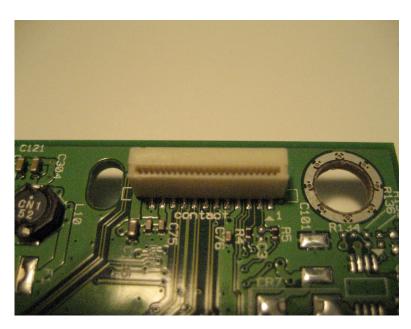

2 Insert the cable squarely into the connector.

Note: Verify that the cable is installed straight into the connector. If the cable is not installed properly, then intermittent failures could occur.




Printhead assembly adjustments

Printhead assembly mechanical adjustment

A printhead needs to be correctly positioned after it has been removed. Use a sharp pencil or a small, flat-blade screwdriver to mark the location of the old printhead on the printer frame. Align the new printhead relative to the location of the old printhead.


Note: Skew is caused by a sheet being fed through the printer while misaligned. The entire image is rotated relative to the sheet edges. However, a mechanically misaligned printhead causes the horizontal lines to appear skewed, while the vertical lines remain parallel to the vertical edges. There are no adjustments for skew. Check the pick tires for wear, the paper path for obstructions, the fuser for proper setting, and the tray paper guides for fit to the media.

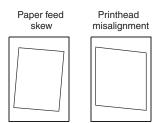


To adjust the printhead:

- **1** POR into the Diagnostics menu, and print a Quick test page:
 - **Diagnostics Menu > Print Tests > Tray 1 > Single**
- **2** Fold the printed test page on the left side so that a few millimeters of grid lines wrap around the outside of the fold.

3 Fold a second vertical fold near the center so that the left side top edge aligns with the right side top edge.

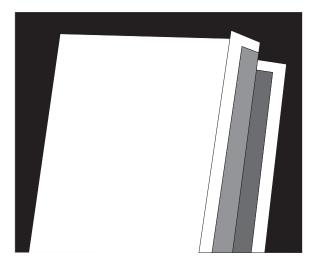

4 If the grid lines of the right flap align below the corresponding lines on the left flap, then adjust the printhead clockwise relative to the printer, and recheck. If the grid lines of the left flap align below the corresponding lines of the right side, then adjust the printhead counterclockwise.

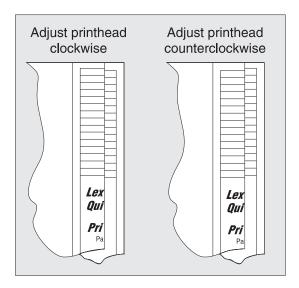

- **5** Print another Quick test page, and check if adjustments are still needed.
- **6** After obtaining a properly adjusted image on the paper, tighten all the screws.
- **7** Align the printhead electronically.

Printhead assembly electronic adjustment

Note: Before aligning the printhead electronically, first align the printhead mechanically.

1 POR into the Diagnostics menu, and print a Quick test page:

Diagnostics Menu > Registration > Quick Test

Sample Quick test page. Use the actual sheet.

2 From the Registration menu, select the Right margin setting:

Diagnostics Menu > Registration > Right Margin

- **3** To determine the Right margin setting:
 - **a** Choose the value of the darkest bar on the right side of the Quick test page.
 - **b** Add that value to the current Right margin setting found on the left side of the Quick test page. For example, if the current Right margin setting is -2, and the darkest bar is at +3, then the right margin setting will be equal to +1 (-2+3=+1).
- **4** Choose and save the desired Right margin setting.
- **5** Print again a Quick test page and check if the darkest bar is at zero. If it is, then check to see if the left, top, and bottom margins are detected. If the darkest bar is not at zero, then repeat steps 3 and 4.

Note: The alignment of the left margin positions the black plane to the right or left. The alignment of the right margin does not alter the margins and should only be used to adjust the printhead.

Removal procedures


Keep the following tips in mind as you replace parts:

- Some removal procedures require removing cable ties. You must replace cable ties during reassembly to avoid pinching wires, obstructing the paper path, or restricting mechanical movement.
- Remove the toner cartridges, imaging unit, and media tray before removing other printer parts. The imaging
 unit should be carefully set on a clean, smooth, and flat surface. It should also be protected from light while
 out of the device.
- Disconnect all external cables from the printer to prevent possible damage during service.
- Unless otherwise stated, reinstall the parts in reverse order of removal.
- When reinstalling a part held with several screws, start all screws before the final tightening.

Left side removals


Left cover removal

- **1** Position the printer so that it sits on its right side.
- **2** Open the front door.
- **3** Remove the two screws (A) securing the left cover.
- **4** Release the latches, and swing the left cover upward to remove.

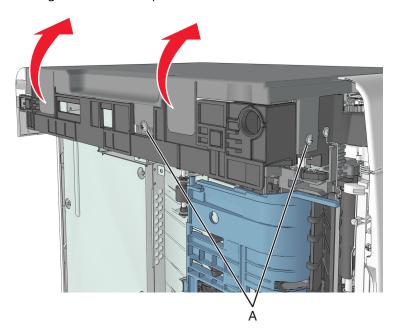


Main drive gearbox removal

- 1 Remove the left cover. See <u>"Left cover removal" on page 226</u>.
- **2** Squeeze the latch, and then detach the link from the front door.

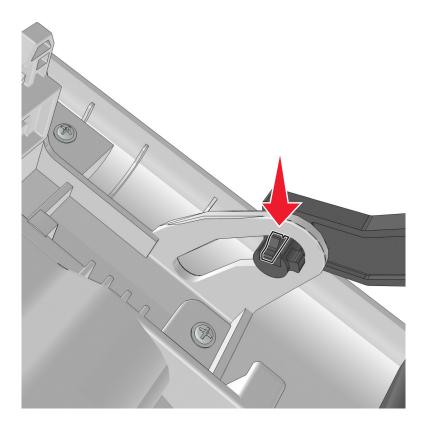


3 Remove the 4 screws (A), and then remove the main drive gearbox.

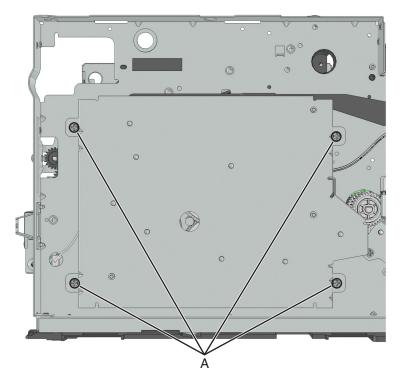

4 Disconnect the cable from the main drive gearbox.


5 Remove the spring (B) and the fuser gear (C).

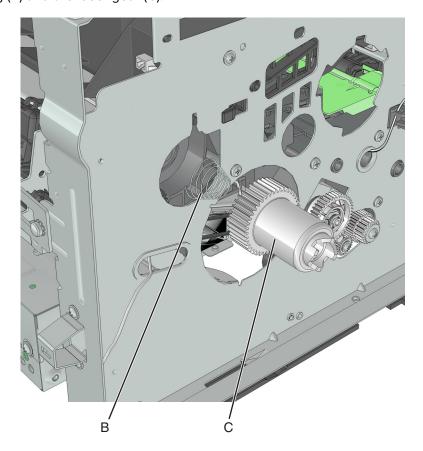

MPF solenoid removal

- 1 Remove the left cover. See <u>"Left cover removal" on page 226</u>.
- 2 Remove the right cover. See "Right cover removal" on page 239.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Remove the main drive gearbox. See "Main drive gearbox removal" on page 227.
- **5** Remove the power supply. See "Power supply removal" on page 287.
- 6 Remove the power supply shield. See "Power supply shield removal" on page 288.
- 7 Remove the duplex. See "Duplex removal" on page 289.
- **8** Disconnect the MPF solenoid cable from the controller board.
- **9** Remove the screw (A).

10 Cut the cable (B).

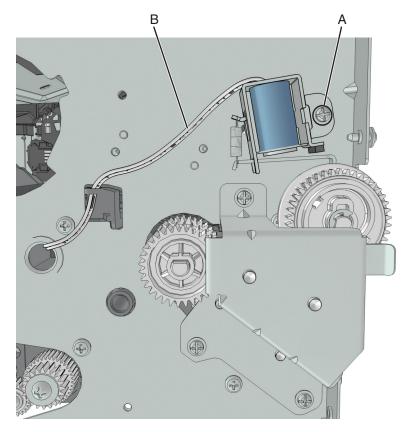


11 Remove the other half of the cable from the printer.


Installation notes:

- **a** Install the MPF solenoid.
- **b** Secure the cable to the holder (A).


c Insert the cable into the hole (B).

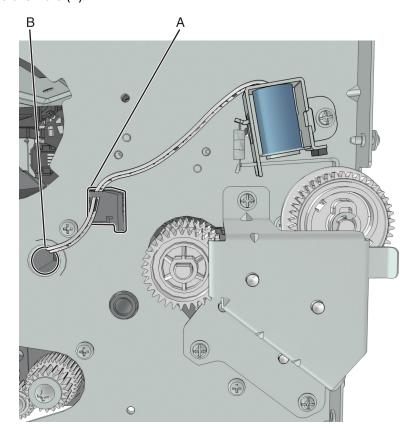

d Route the cable using the new path.

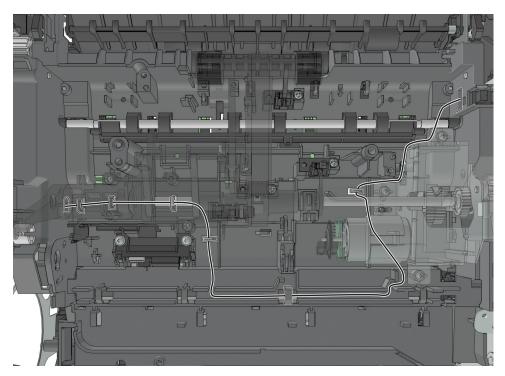


e Secure the cable at the pick/lift motor gearbox using cable ties. Cut off any excess cable tie.

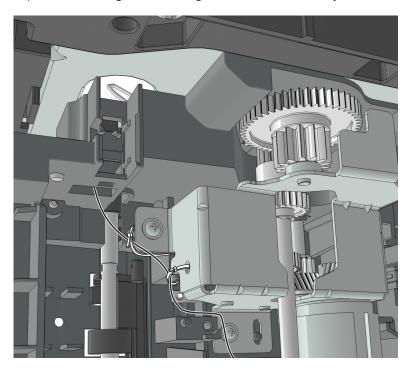


MPF gearbox removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the main drive gearbox. See "Main drive gearbox removal" on page 227.
- **3** Remove the front door. See <u>"Front door removal" on page 279</u>.


4 Disconnect the spring (A) from the printer.

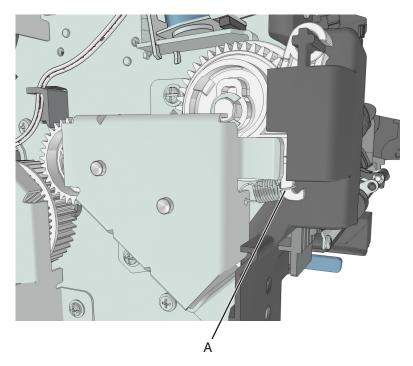


5 Remove the three screws (B), and then remove the left front mount.

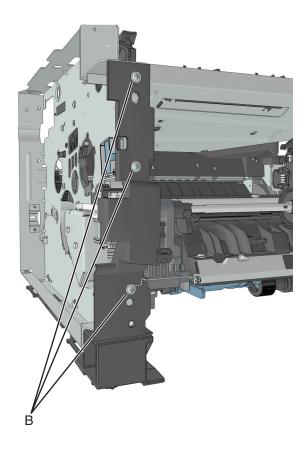

6 Remove the three screws (C), and then remove the MPF gearbox.

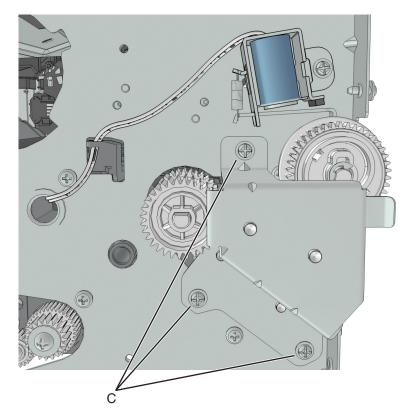


7 Release the two latches (D), and then remove the main input drive gears.

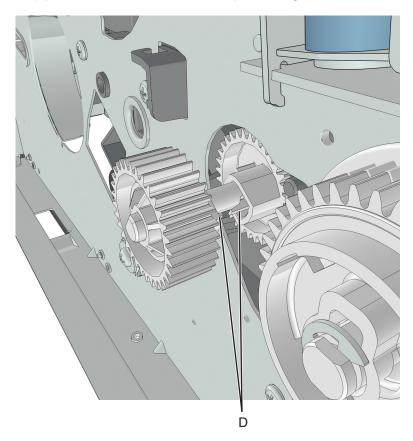

Parts removal


8 Remove the E-clip (E), and then remove the MPF sector gear (F).

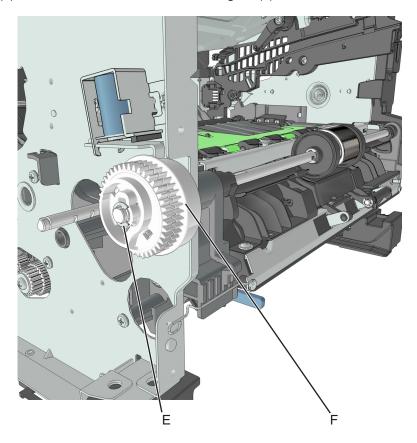

Reverse solenoid removal


- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the left cover. See "Left cover removal" on page 226.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Remove the top cover. See "Top cover removal" on page 312.
- **5** Remove the cooling fan. See "Cooling fan removals" on page 241.
- **6** Disconnect cable JDRSOL1 from the controller board.

7 Remove the two screws (A) securing the reverse solenoid.

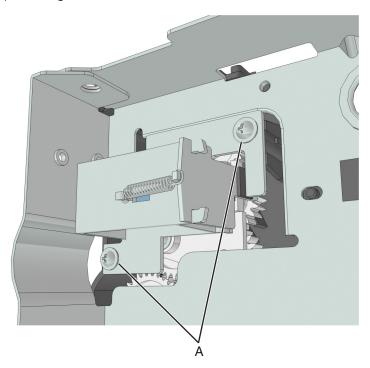

Cartridge gearbox removal


- 1 Remove the left cover. See <u>"Left cover removal" on page 226</u>.
- **2** Remove the four screws (A) securing the cartridge gearbox.

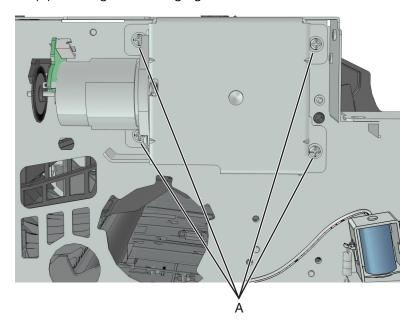


3 Disconnect the cable from the cartridge gearbox.

Duplex gear assembly removal


- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 3 Remove the power supply. See "Power supply removal" on page 287.
- 4 Remove the power supply shield. See "Power supply shield removal" on page 288.
- **5** Remove the duplex. See "Duplex removal" on page 289.
- **6** Position the printer so that it sits on its right side.
- 7 Remove the E-clip (A).
- 8 Remove the screw (B).
- **9** Remove the screw (C).
- **10** Remove the three gears.

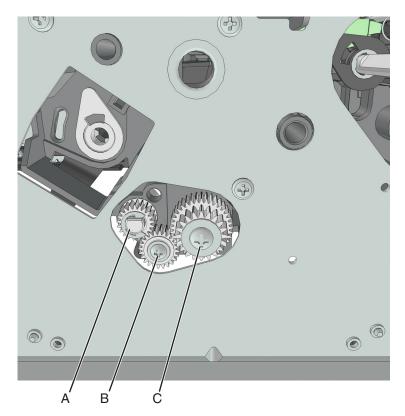

11 From behind the three gears, remove the duplex coupling (D).

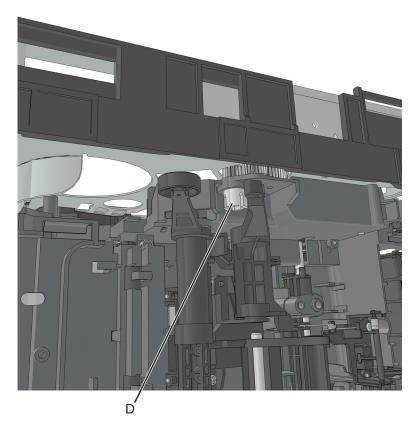


12 Remove the duplex link (E) from the duplex.

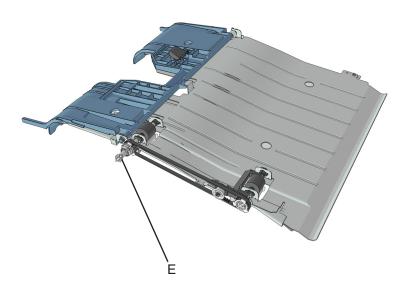

Right side removals

Right cover removal

- **1** Open the front door.
- **2** Position the printer so that it sits on its left side.
- **3** Remove the two screws (A) securing the right cover.
- 4 Release the latches (B) to remove the right cover.

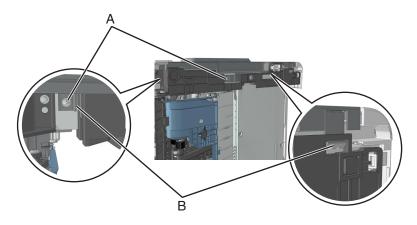


Right cover removal (MS610de)

- **1** Open the controller board access door.
- 2 Remove the two screws (A).



- **3** Open the front door.
- **4** Position the printer so that it sits on its left side.
- **5** Remove the two screws (B).

6 Release the latches (C) to remove the right cover.

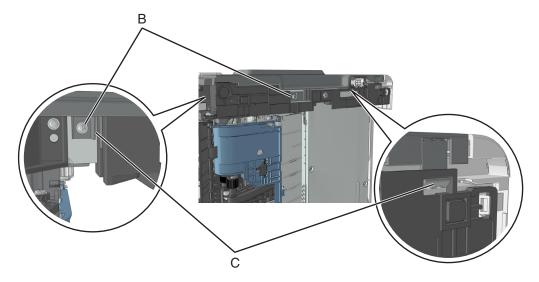


Tray present sensor removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- **2** Disconnect the cable (A) from the tray present sensor.
- **3** Pry to remove the sensor retainer (B).

Note: The retainer is secured to the sensor by an adhesive.


4 Release the three latches (C), and then pry to remove the tray present sensor.

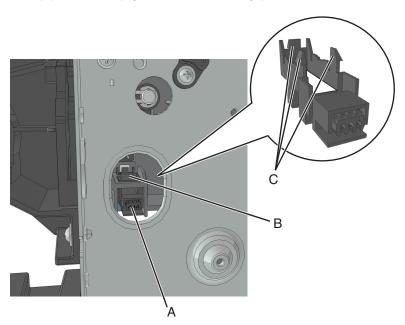

Cooling fan duct removal

Note: This is not a FRU.


- 1 Remove the right cover. See "Right cover removal" on page 239.
- **2** Remove the screw (A), and then remove the cooling fan duct.

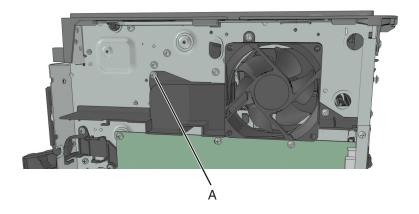


Cooling fan removals

Cooling fan removal (MS510dn and MS610dn)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the cooling fan duct. See "Cooling fan duct removal" on page 241.
- **3** Disconnect the cable JFAN1 from the controller board.
- **4** Remove the two screws (A), and then remove the fan and the fan mount.

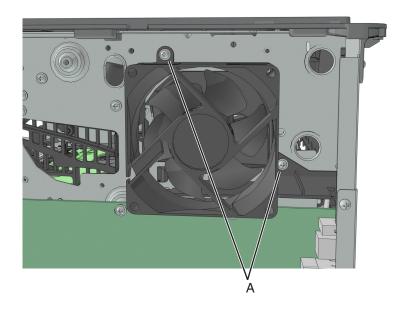


5 Remove the two screws (B) securing the fan to the fan mount.

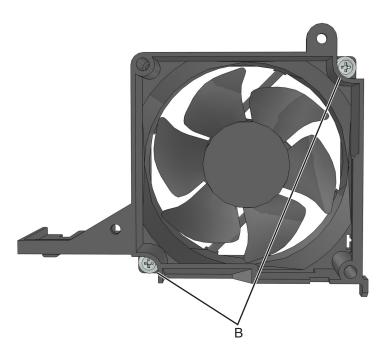

Cooling fan removal (MS610de)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- **2** Disconnect the cable JFAN1 from the controller board.

3 Remove the two screws (A), and then remove the fan.

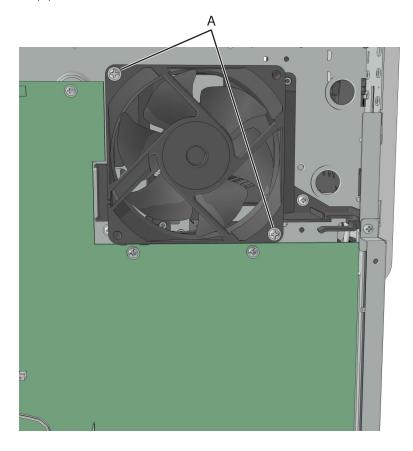


Cooling fan mount removal (MS610de)

Note: This is not a FRU.

- 1 Remove the right cover. See <u>"Right cover removal" on page 239</u>.
- 2 Remove the cooling fan. See "Cooling fan removals" on page 241.


3 Remove two screws (A), and then remove the cooling fan mount.

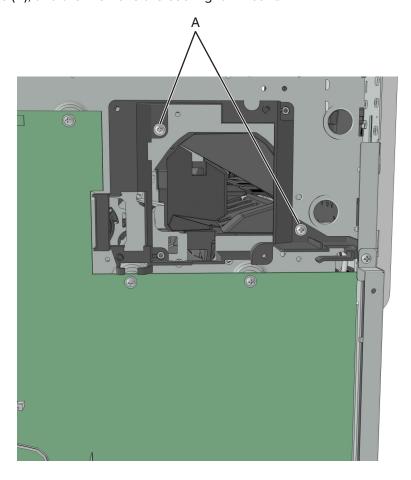

Controller board shield removal (MS610de)

Note: This is not a FRU.

- 1 Remove the right cover. See "Right cover removal" on page 239.
- **2** Remove the four screws (A) securing the controller board shield.

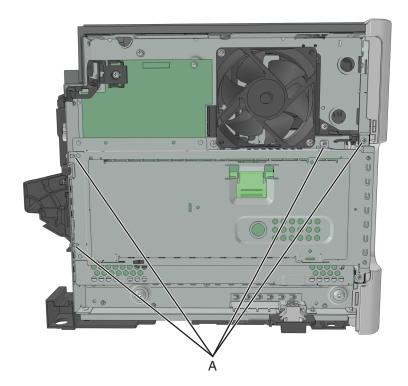

Controller board removals

Critical information for controller board or control panel replacement

Warning—Potential Damage: Replace only one of the following components at a time:

- Control panel
- Controller board

To replace a component, and to test whether the problem is resolved:

- **1** Replace the affected component.
 - **Warning—Potential Damage:** Do not perform a POR (Power-On Reset) until the problem is resolved. If a POR is performed at this point, the replacement part can no longer be used in another printer and must be returned to the manufacturer.
- 2 Enter the Diagnostics Menu. The Diagnostics Menu allows you to temporarily use the replacement part.
 - **Warning—Potential Damage:** Some printers will automatically perform a POR if the Diagnostics Menu is not opened within five seconds. If a POR is performed at this point, the replacement part can no longer be used in another printer and must be returned to the manufacturer.


- **3** Use the Diagnostics Menu to test the replacement part. Do a feed test to check if the problem is resolved.
 - If the problem is not resolved—Turn off the printer, and then reinstall the old part.
 - If the problem is resolved—Perform a POR.

Note: Before replacing the controller board, export the eSF solutions and settings from the printer. For more information, see "Backing up eSF solutions and settings" on page 208.


Removal procedure

Controller board removal (MS510dn and MS610dn)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- **2** Disconnect all cables from the controller board.
- **3** Remove the screw (A) from the rear side of the printer.

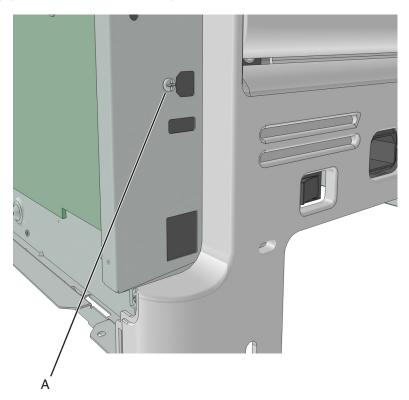

4 Remove the five screws (B) securing the controller board.

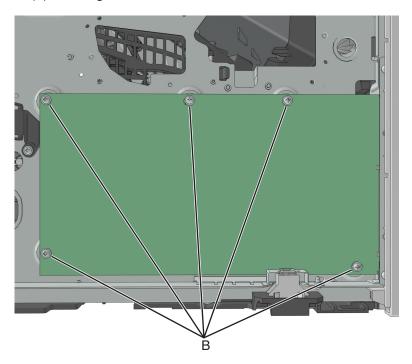


Installation note: After installing a new controller board, perform the printer configuration restoration. See **"Restoring the printer configuration after replacing the controller board" on page 203**.


Controller board removal (MS610de)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the controller board shield. See "Controller board shield removal (MS610de)" on page 245.
- **3** Disconnect all cables from the controller board.

4 Release the toroid from the holder.

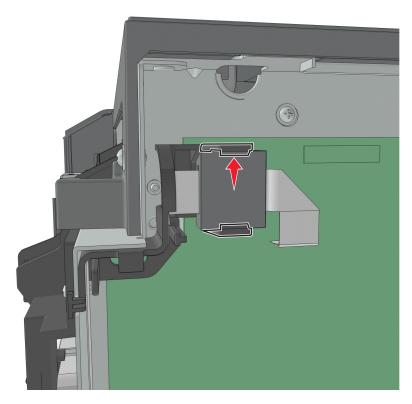


5 Remove the screw (A) from the rear side of the printer.

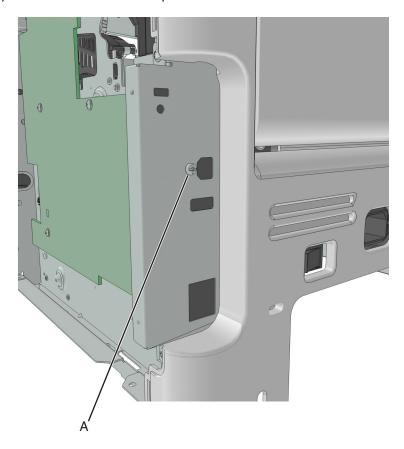

Parts removal

6 Remove the seven screws (B) securing the controller board.

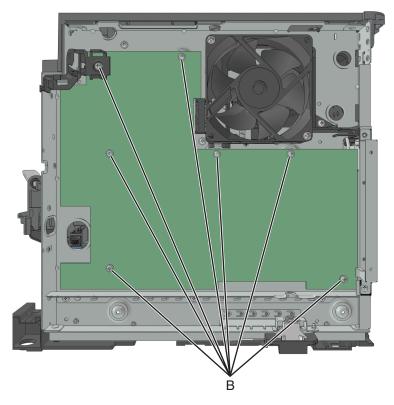

Installation note: After installing a new controller board, perform the printer configuration restoration. See **"Restoring the printer configuration after replacing the controller board" on page 203**.


Toner cartridge smart chip contact removal

1 Remove the right cover. See "Right cover removal" on page 239.

Note: For MS610de, also remove the following:


- a Controller board shield. See "Controller board shield removal (MS610de)" on page 245.
- **b** Controller board. See "Controller board removals" on page 245.
- **2** Disconnect the cable JARW1 from the system board.

3 Remove the two screws (A).

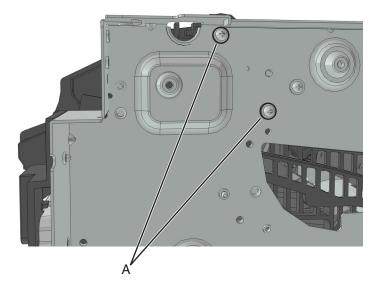


4 Remove the two screws (B), and then detach the right cartridge guide.

Warning—Potential Damage: Do not cut or disconnect the cable at the rear of the right cartridge guide. Leave the right cartridge guide dangling while performing the rest of the steps.

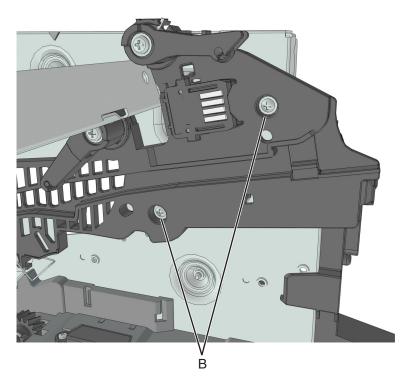


5 From behind the right cartridge guide, release the 4 latches (C) to detach the toner cartridge smart chip contact.

Note: Pay attention to the original position of the spring and the actuators.

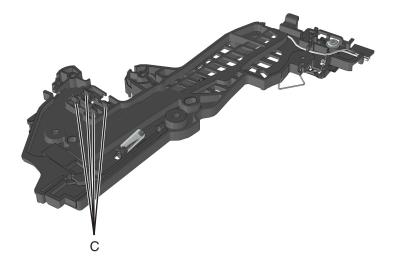

Installation notes:

- **a** Test for proper installation of the spring and the actuators.
- **b** Press the cartridge actuator. The cartridge lock should move up.

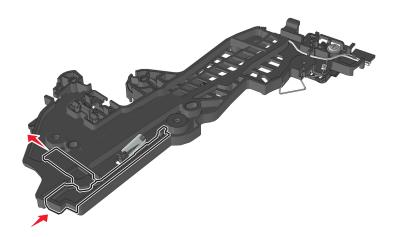


c Release the cartridge actuator. The cartridge lock should move back to its original position.

Front removals


Left front mount removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the front door. See "Front door removal" on page 279.

3 Disconnect the spring (A) from the printer.

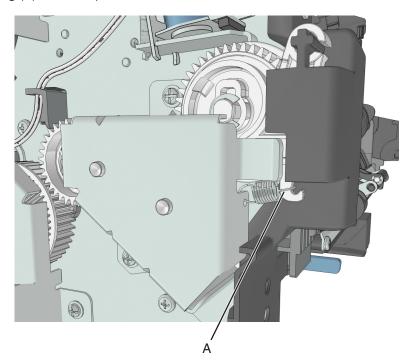


4 Remove the three screws (B), and then remove the left front mount.

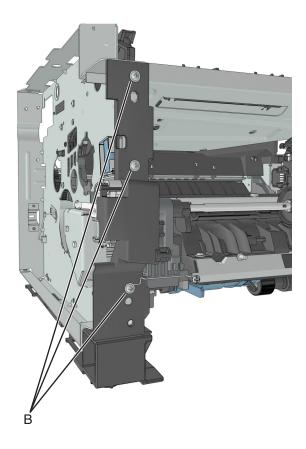


Right front mount removal

- 1 Remove the right cover. See <u>"Right cover removal" on page 239</u>.
- **2** Disconnect all control panel cables from the controller board.
- **3** Disconnect the cable JCVR1 from the controller board.
- **4** Remove the screw (A) to disconnect the ground wire.

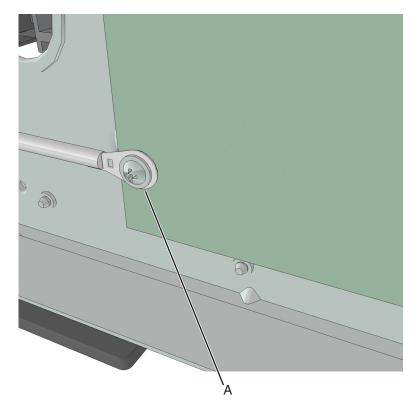


5 Remove the four screws (B), and then remove the right front mount.

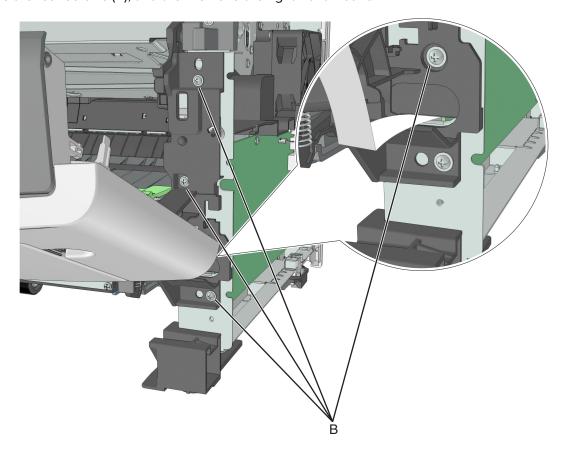

Transfer roll removal


Warning—Potential Damage: Do not touch the transfer roll with bare hands. Oil from the skin can damage it.

1 Squeeze the latches at each end of the transfer roll.

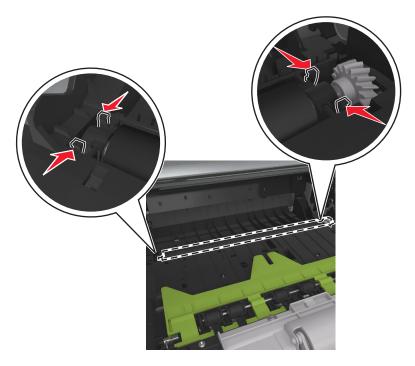


2 Lift to remove the transfer roll.

Warning—Potential Damage: Do not remove the spring under the left latch. Doing so will damage the printer.

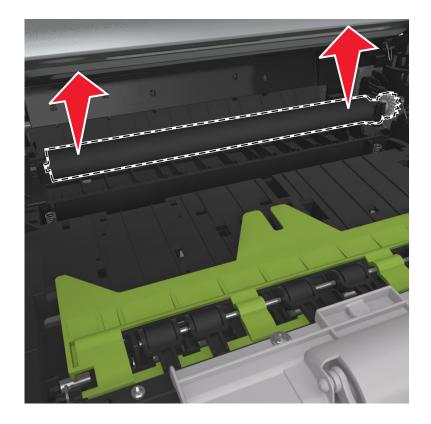


Cartridge plunger removal

- **1** Open the front door.
- 2 Tilt the cartridge plunger.

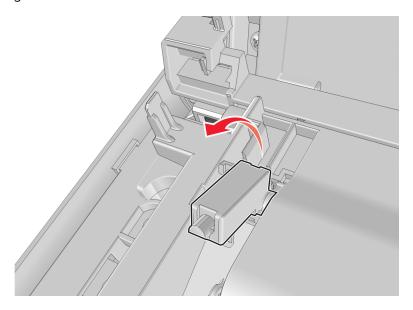


3 Twist and then remove the cartridge plunger.

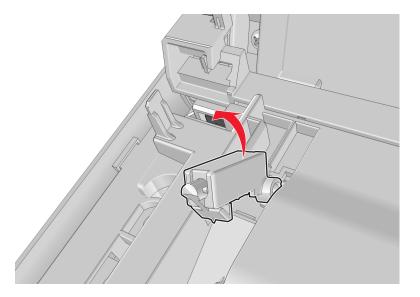


Installation notes:

a Use a spring hook to hold the spring, and then reinstall the cartridge plunger.

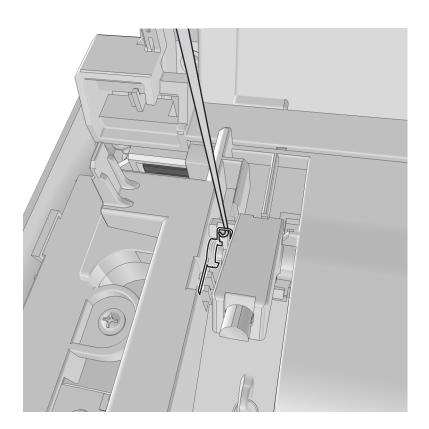


b Set the spring over the plunger.

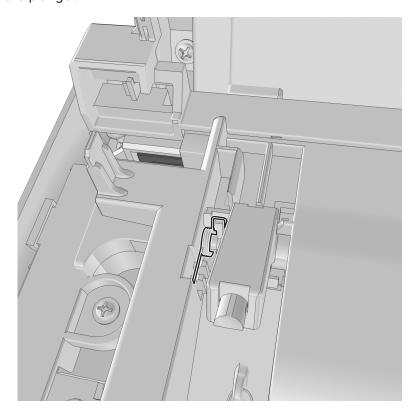

Bezel removals


Bezel removal (MS510dn)

- **1** Open the front door.
- **2** Push the latches (A), and then remove the bezel.

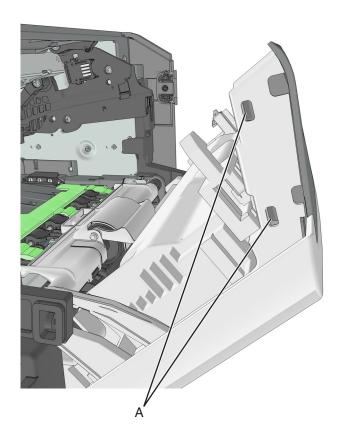

Bezel removal (MS610dn)

- **1** Open the front door.
- **2** Push the latches (A), and then remove the bezel.

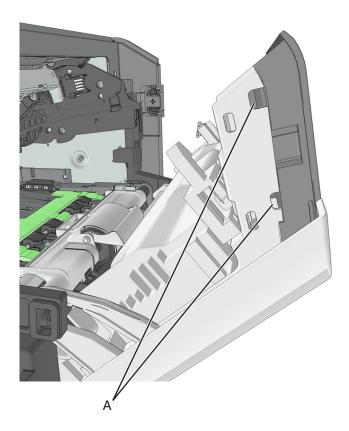

Bezel removal (MS610de)


- **1** Open the front door.
- **2** Pull to remove the bezel.



Nameplate removals

Nameplate removal (MS510dn and MS610dn)


- **1** Open the front door.
- **2** Remove five screws (A) securing the nameplate.

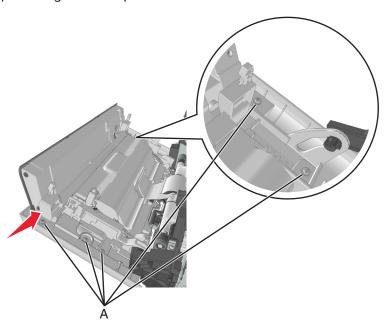


Parts removal

Nameplate removal (MS610de)


- **1** Open the front door.
- 2 Press the latch (A) to release the access cover latch (B).

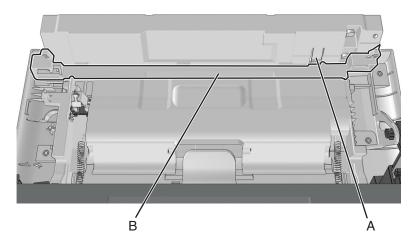

- **3** Release the access cover latch from the mechanical keys on both sides.
- **4** Remove the spring (C) from the front access cover.

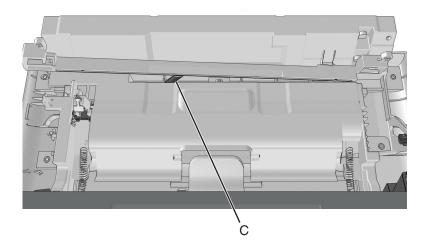

5 Remove the six screws (D) securing the nameplate.

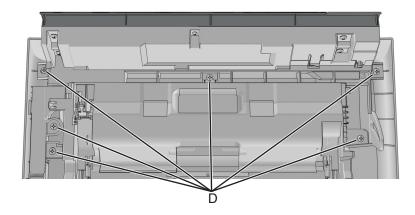

Control panel assembly removals

Critical information for controller board or control panel replacement

Warning—Potential Damage: Replace only one of the following components at a time:

- Control panel
- Controller board

To replace a component, and to test whether the problem is resolved:


- **1** Replace the affected component.
 - **Warning—Potential Damage:** Do not perform a POR (Power-On Reset) until the problem is resolved. If a POR is performed at this point, the replacement part can no longer be used in another printer and must be returned to the manufacturer.
- 2 Enter the Diagnostics Menu. The Diagnostics Menu allows you to temporarily use the replacement part.
 - **Warning—Potential Damage:** Some printers will automatically perform a POR if the Diagnostics Menu is not opened within five seconds. If a POR is performed at this point, the replacement part can no longer be used in another printer and must be returned to the manufacturer.
- **3** Use the Diagnostics Menu to test the replacement part. Do a feed test to check if the problem is resolved.
 - If the problem is not resolved—Turn off the printer, and then reinstall the old part.
 - If the problem is resolved—Perform a POR.

Removal procedure

Control panel assembly removal (MS510dn and MS610dn)


- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the nameplate. See "Nameplate removals" on page 261.
- 3 Remove the bezel. See "Bezel removals" on page 259.

4 Remove the screw (A) securing the ground connector to the controller board.

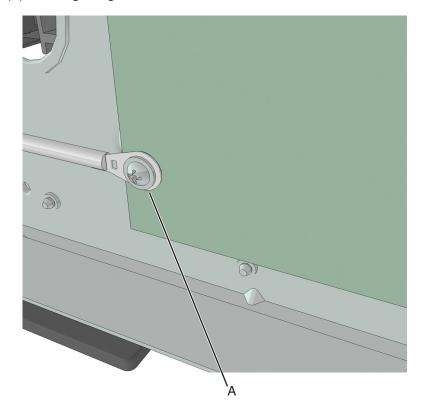


5 Disconnect the cables JUSBF1 (for MS610dn only) and JUICC1 and from the controller board.

6 Remove the screw (B) from the right front mount, and route the cables through the slot.

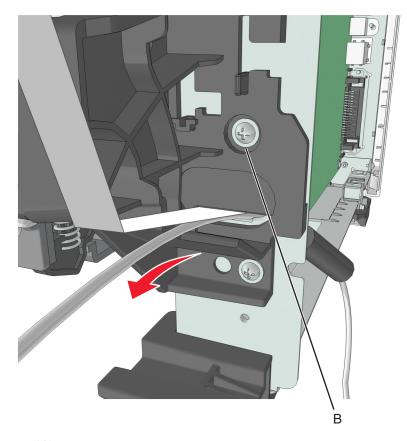


7 Remove the two screws (C) securing the control panel assembly.

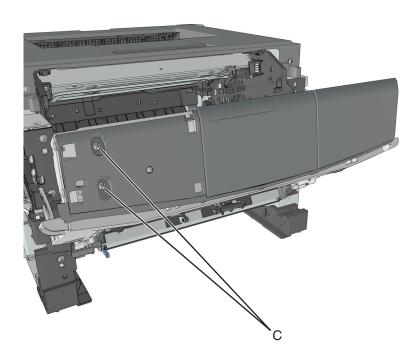


8 Route all cables off the printer to completely remove the control panel assembly.

Control panel assembly removal (MS610de)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the nameplate. See "Nameplate removals" on page 261.
- **3** Remove the bezel. See <u>"Bezel removals" on page 259</u>.
- **4** Remove the toroid.

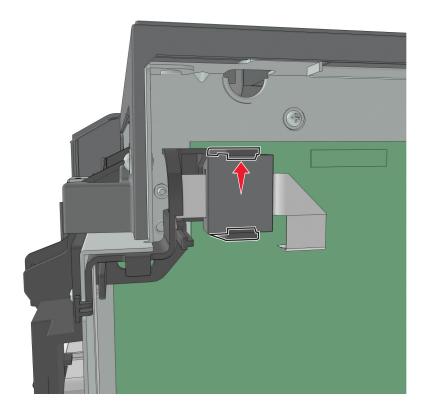


5 Remove the screw (A) securing the ground connector to the controller board.

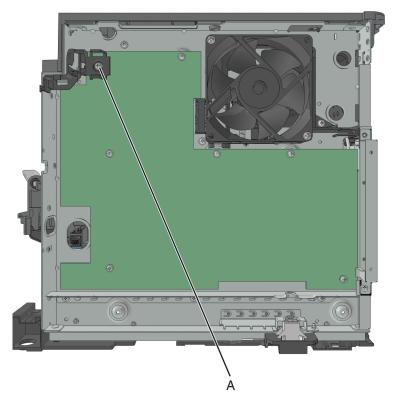


6 Disconnect the cables JUICC1 and J24 from the controller board.

7 Remove the screw (B) from the right front mount, and route the cables through the slot.

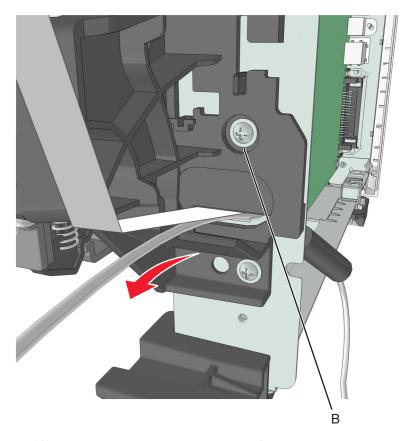

8 Remove the five screws (C) securing the control panel to the front door.

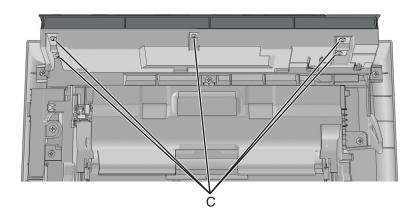

UICC removals

Critical information for controller board or UICC replacement

Warning—Potential Damage: Replace only one of the following components at a time:

- UICC
- Controller board

To replace a component, and to test whether the problem is resolved:

1 Replace the affected component.

Warning—Potential Damage: Do not perform a POR (Power-On Reset) until the problem is resolved. If a POR is performed at this point, the replacement part can no longer be used in another printer and must be returned to the manufacturer.

2 Enter the Diagnostics Menu. The Diagnostics Menu allows you to temporarily use the replacement part.

Warning—Potential Damage: Some printers will automatically perform a POR if the Diagnostics Menu is not opened within five seconds. If a POR is performed at this point, the replacement part can no longer be used in another printer and must be returned to the manufacturer.


- 3 Use the Diagnostics Menu to test the replacement part. Do a feed test to check if the problem is resolved.
 - If the problem is not resolved—Turn off the printer, and then reinstall the old part.
 - If the problem is resolved—Perform a POR.

Removal procedure


UICC removal (MS510dn and MS610dn)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the nameplate. See "Nameplate removals" on page 261.
- 3 Remove the bezel. See "Bezel removals" on page 259.
- 4 Remove the control panel assembly. See "Control panel assembly removals" on page 263.
- **5** Remove the cable from the connector (A).


6 Remove the eight screws (B).

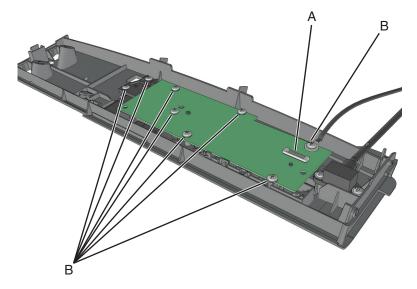

7 Flip the UICC, and then remove the screw (C).

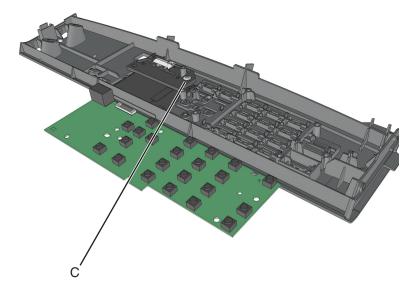


Note: The control panel cover, buttons, and light pipe are not included with the UICC.

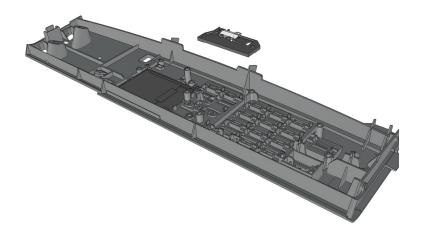


UICC removal (MS610de)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the nameplate. See "Nameplate removals" on page 261.
- **3** Remove the bezel. See <u>"Bezel removals" on page 259</u>.
- 4 Remove the control panel assembly. See <u>"Control panel assembly removals" on page 263</u>.
- **5** Disconnect the cable from the connector (A).
- **6** Remove the five screws (B).

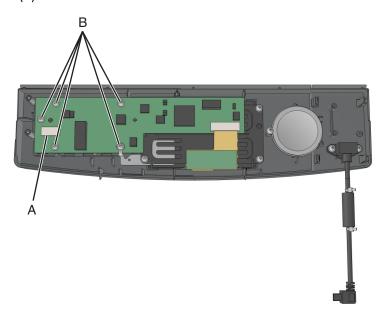

7 Flip the UICC, and remove the four screws (C) securing the display bracket.

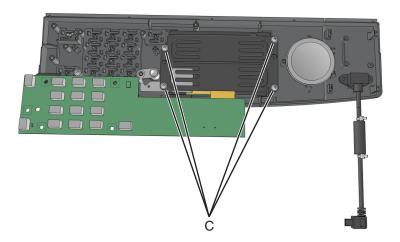


Note: The control panel cover, buttons, and light pipe are not included with the UICC.



Control panel USB port removal (MS610dn)


- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the nameplate. See "Nameplate removals" on page 261.
- **3** Remove the bezel. See <u>"Bezel removals" on page 259</u>.
- 4 Remove the control panel assembly. See "Control panel assembly removals" on page 263.

5 Remove the two screws (A), and then remove the control panel USB port.

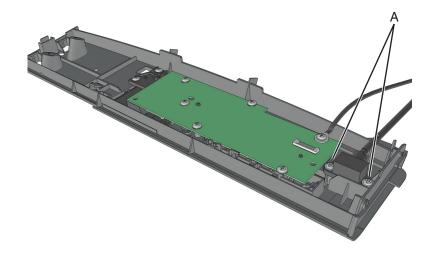


Speaker and control panel USB port removal (MS610de)

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the nameplate. See "Nameplate removals" on page 261.
- 3 Remove the bezel. See "Bezel removals" on page 259.
- 4 Remove the control panel assembly. See "Control panel assembly removals" on page 263.
- **5** Remove the three screws (A), and then remove the speaker and control panel USB port.

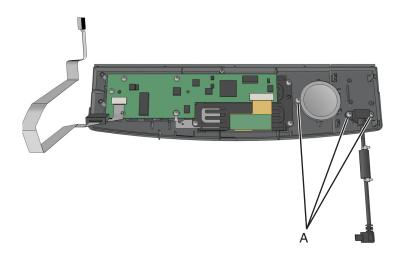


MPF assembly removal


- 1 Remove the nameplate. See <u>"Nameplate removals" on page 261</u>.
- **2** Remove the two springs (A).

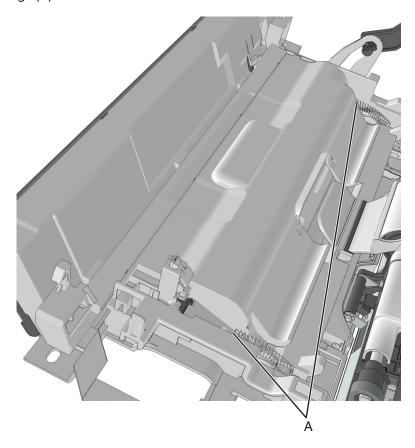


3 Squeeze the latches (B) to release the left and right links.

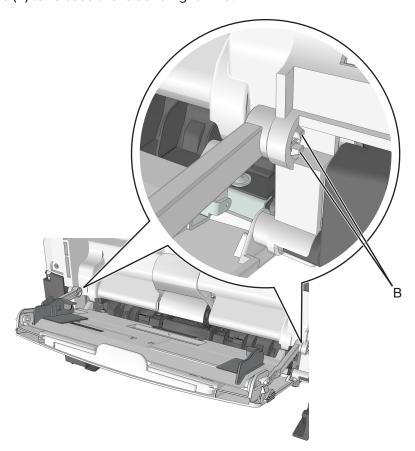

4 Release the lock (C) remove the MPF link. Do the same on the other MPF link.

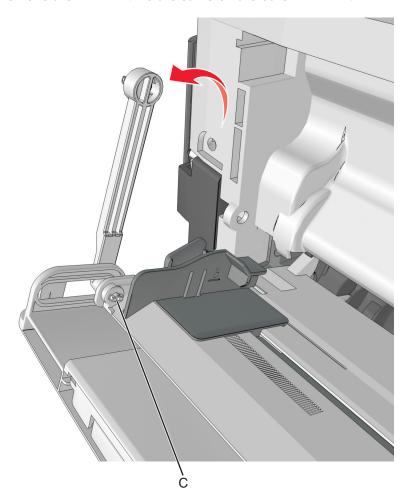


- **5** Release the right tab (D) of the MPF.
- **6** Slide the MPF assembly to remove.

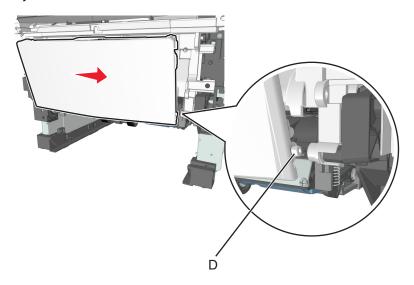

MPF pick roller cover removal


- **1** Open the front door.
- 2 Remove the two screws (A), and then remove the MPF pick roller cover.

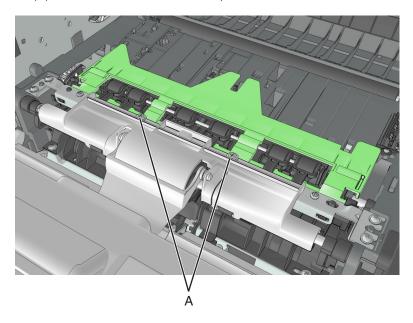

MPF pick roller removal


- 1 Remove the MPF pick roller cover. See "MPF pick roller cover removal" on page 277.
- **2** Remove the two screws (A).

Note: Use a #0 Phillips screwdriver.

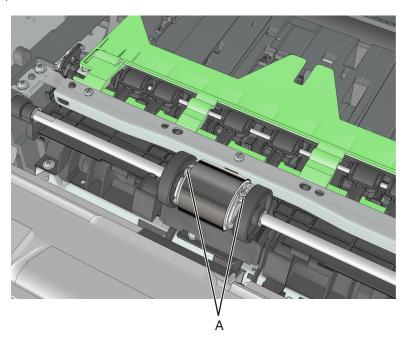


3 Pull the MPF pick roller outward to remove.

Warning—Potential Damage: Do not touch the pick tire with bare hands, as this can damage the pick roller.

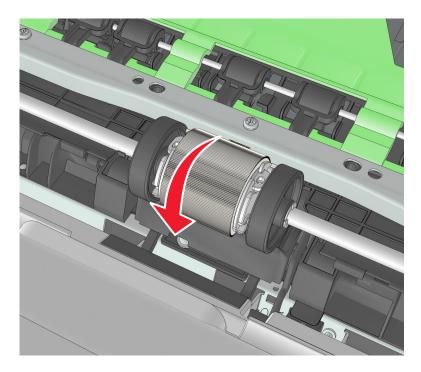

Bail removal


- 1 Remove the MPF pick roller cover. See "MPF pick roller cover removal" on page 277.
- **2** Rotate the bail.
- **3** Squeeze the latches, and then remove the bail.

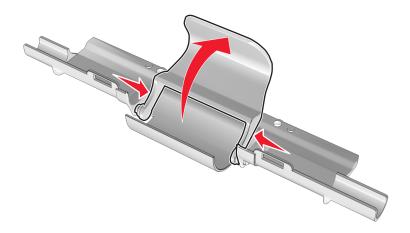

Jam access cover removal

- 1 Remove the MPF pick roller cover. See "MPF pick roller cover removal" on page 277.
- 2 Remove the MPF pick roller. See "MPF pick roller removal" on page 277.

3 Remove the four screws (A), and then remove the jam access cover.

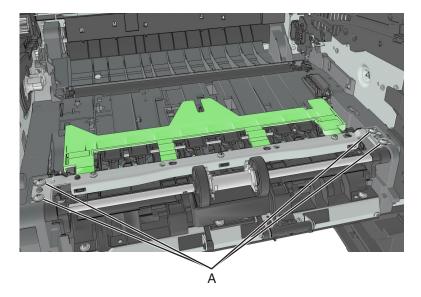

Front door removal

Note: This is not a FRU.

- 1 Remove the right cover. See "Right cover removal" on page 239.
- **2** Disconnect the following cables from the controller board:


For MS510dn and MS610dn:

- JUICC1
- JCVR1
- If applicable, JUSBF1


For MS610de:

- JUICC
- JCVR1
- JAUD1
- J43

3 Squeeze the latch, and then detach the link from the front door.

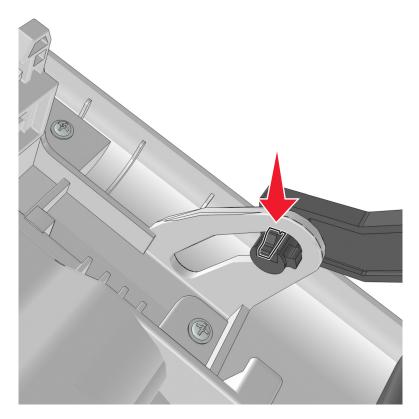


4 Remove the screw (A) to disconnect the ground wire.

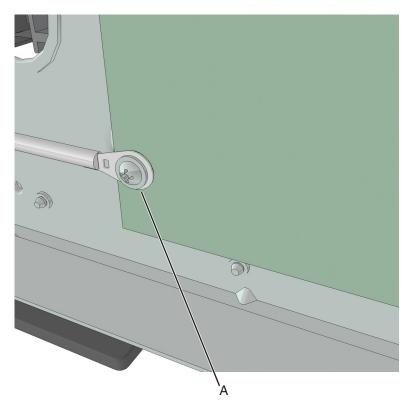

Parts removal

5 Remove the four screws (B).

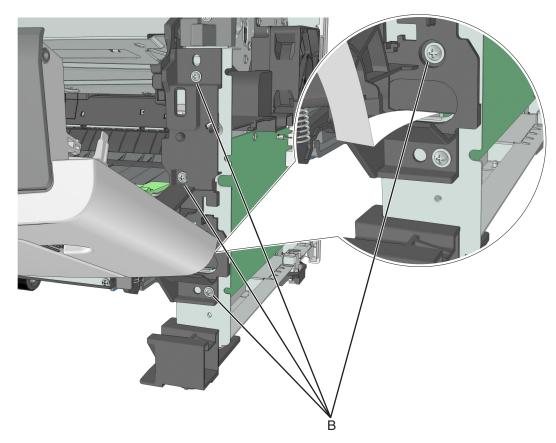

6 Remove the right front mount, and then remove front door. Below are the front door and the right front mount.




Installation notes:

- **a** Mount the left side of the front door to the printer.
- **b** Attach the right front mount to the front door.

c Install the right front mount to the printer.

Front access cover removal


- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the front door. See "Front door removal" on page 279.
- 3 Remove the nameplate. See "Nameplate removals" on page 261.
- 4 Remove the MPF assembly. See "MPF assembly removal" on page 274.
- **5** Remove the bezel. See "Bezel removals" on page 259.
- **6** Remove the control panel assembly. See "Control panel assembly removals" on page 263.
- **7** The front access cover remains.

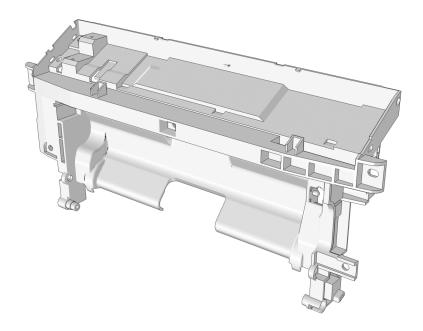

Front door sensor removal


- 1 Remove the front door. See "Front door removal" on page 279.
- **2** From under the right front mount, remove the screw (A).

Note: Use a #0 Phillips screwdriver.

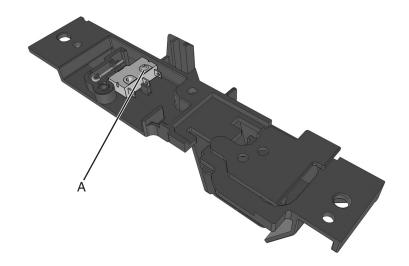


Front input guide removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the front door. See "Front door removal" on page 279.
- 3 Remove the MPF pick roller cover. See "MPF pick roller cover removal" on page 277.
- 4 Remove the MPF pick roller. See "MPF pick roller removal" on page 277.
- **5** Remove the jam access cover. See "Jam access cover removal" on page 278.
- **6** Disconnect cable JMPF1 from the controller board.
- **7** Remove the four screws (A).

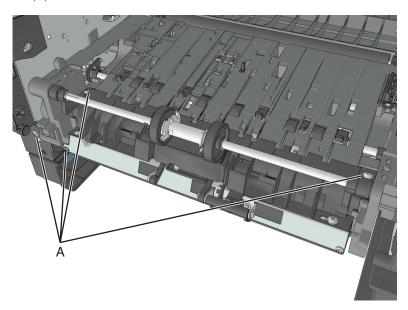


8 Push and hold the cam restraint to release the MPF shaft.

9 Rotate the MPF shaft inward so that the cams at each end point up.

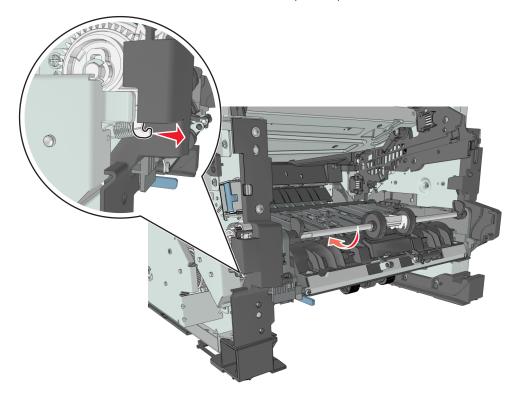


10 Release the front guide from the guides at each end.

Installation note: The cams at each end of the MPF shaft must point down.

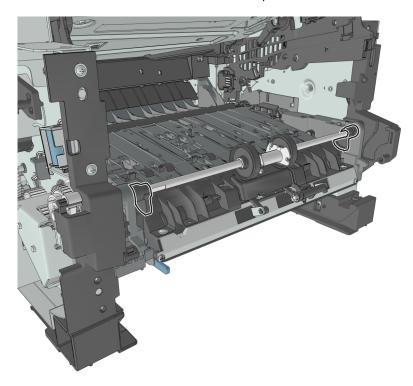


Separator pad removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the front door. See "Front door removal" on page 279.
- **3** Remove the MPF pick roller cover. See <u>"MPF pick roller cover removal" on page 277</u>.
- 4 Remove the MPF pick roller. See "MPF pick roller removal" on page 277.
- **5** Remove the jam access cover. See "Jam access cover removal" on page 278.
- 6 Remove the E-clip (A).
- **7** While pressing down the MPF sensor flag (B) and separator pad (C), move the restraint roller (D) and MPF pick roller hub (E) to the right.

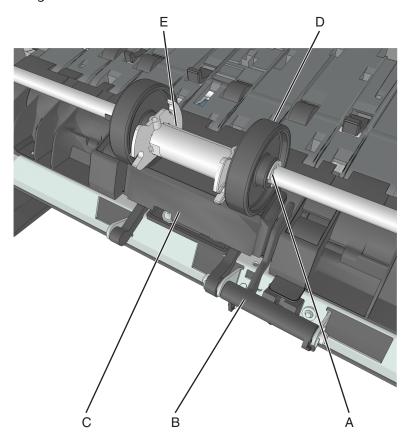


8 Remove the pin (F).

9 While pressing down the MPF sensor flag and separator pad, move the restraint roller (G) to the right.

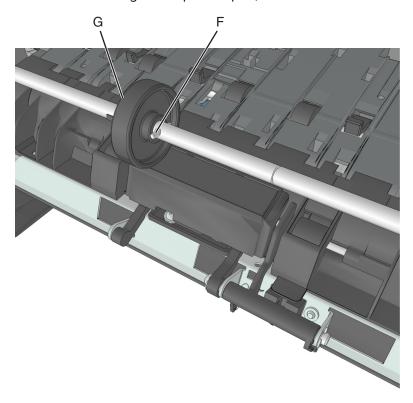

10 Remove the E-clip (H), and then move the shaft (I) to the right.

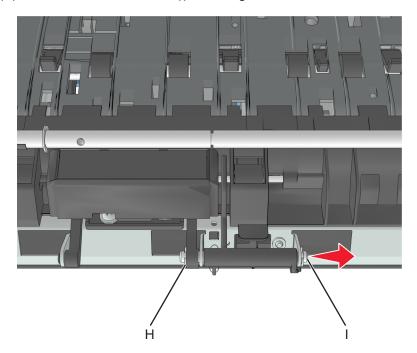


11 Remove the separator pad and the spring underneath.


Bottom removals

Power supply removal


- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- **3** Disconnect the cable (A) from the rear, and disconnect the cable (B) from the left side.

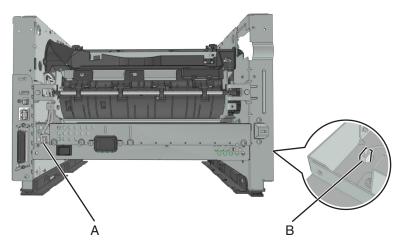

- **4** Position the printer so that it sits on its right side.
- **5** Remove the three screws (C), and then remove the right tray guide.

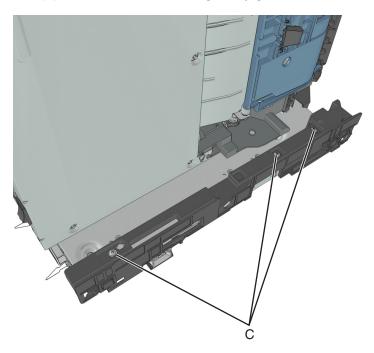

6 Remove the five metal screws (D) and the plastic screw (E) securing the power supply.

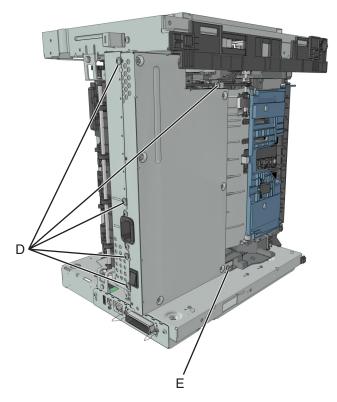


7 Remove the power supply, and then disconnect all cables from the power supply.

Power supply shield removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- **3** Remove the power supply. See <u>"Power supply removal" on page 287.</u>
- **4** Position the printer so that it sits on its right side.


5 Remove the three screws (A), and then remove the power supply shield.

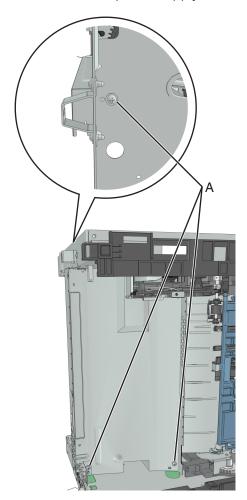


Duplex removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- **3** Remove the power supply. See <u>"Power supply removal" on page 287.</u>
- 4 Remove the power supply shield. See <u>"Power supply shield removal" on page 288</u>.
- **5** Position the printer so that it sits on its right side.

6 Remove the four screws (A) securing the duplex.

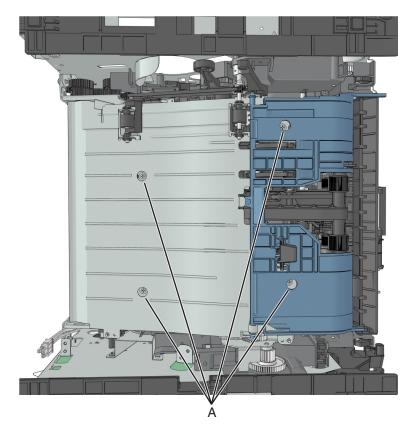


Note: The duplex link (B) is part of the FRU.

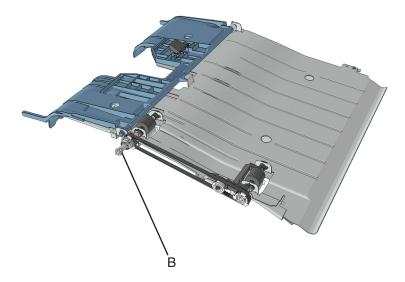

Duplex sensor and input sensor removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the right cover. See "Right cover removal" on page 239.
- **3** Remove the rear door and cover. See <u>"Rear door and cover removal" on page 305</u>.


- 4 Remove the power supply. See "Power supply removal" on page 287.
- **5** Remove the power supply shield. See <u>"Power supply shield removal" on page 288</u>.
- 6 Remove the duplex. See "Duplex removal" on page 289.
- **7** Disconnect the cable JDUPPI1 from the controller board.
- **8** Remove the two screws (A), and cut the cable near the frame to detach the sensors.

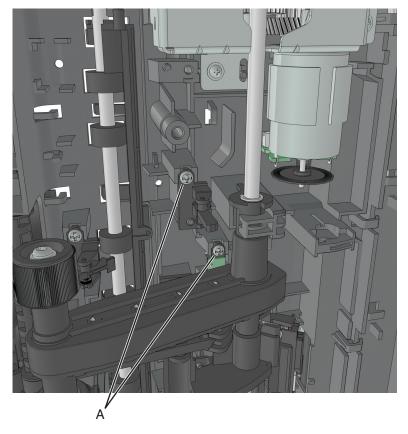


9 Remove the other half of the cable from the printer.

Installation notes:

- **a** Install the duplex sensor, followed by the input sensor.
- **b** Route the cable using the new path.

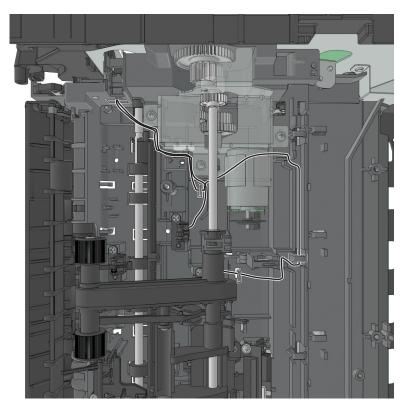


c Secure the cable at the pick/lift motor gearbox using cable ties. Cut off any excess cable tie.

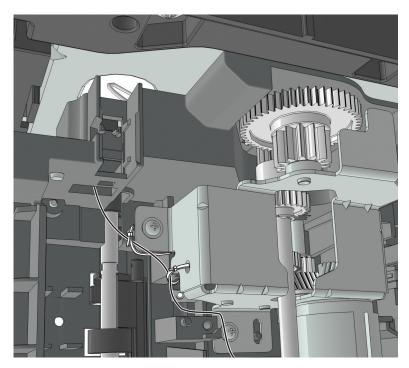

Index sensor removal


- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the right cover. See "Right cover removal" on page 239.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Remove the power supply. See "Power supply removal" on page 287.
- 5 Remove the power supply shield. See "Power supply shield removal" on page 288.
- 6 Remove the duplex. See "Duplex removal" on page 289.
- **7** Disconnect the cable JINDEX1 from the system board.
- 8 Remove the screw (A).
- **9** Route off the cable, and then remove the index sensor.

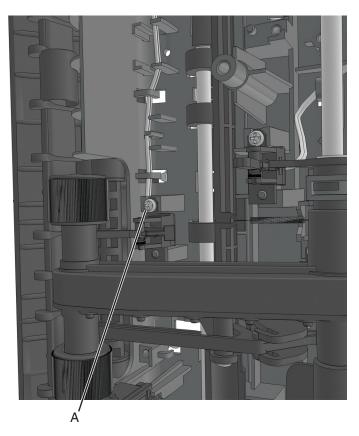

Toner density sensor removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the main drive gearbox. See "Main drive gearbox removal" on page 227.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Remove the power supply. See "Power supply removal" on page 287.
- **5** Remove the power supply shield. See <u>"Power supply shield removal" on page 288</u>.

- 6 Remove the duplex. See "Duplex removal" on page 289.
- **7** Disconnect the spring (A) from the printer.
- **8** Remove the two screws (B), and then remove the sensor.

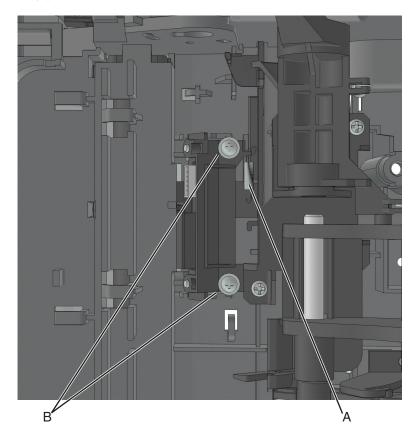

9 Disconnect the cable from the sensor.


Installation notes:

a Apply RheoGel 793 to the top and bottom of the shutter blade extension.



b Apply RheoGel 793 to the point of contact between the bracket (A) and cam.


c Apply RheoGel 793 to the point of contact to the lower edge (B) where the wiper bracket glides.

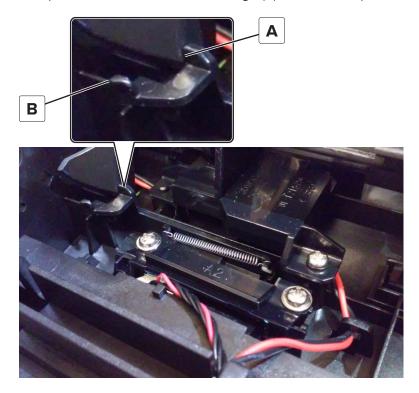


Media present sensor removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- **3** Remove the power supply. See <u>"Power supply removal" on page 287.</u>
- 4 Remove the power supply shield. See "Power supply shield removal" on page 288.
- **5** Remove the duplex. See "Duplex removal" on page 289.
- **6** Position the printer so that it sits on its left side.

7 Disconnect the cable from the media present sensor (A).

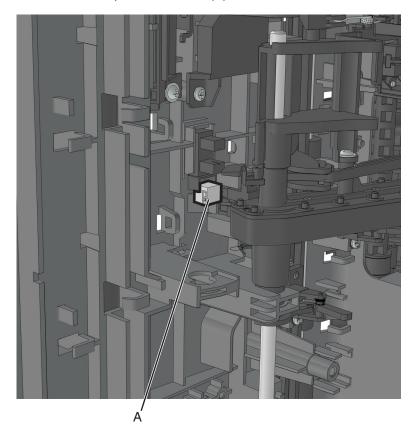


8 From inside the printer, release the three latches (B).

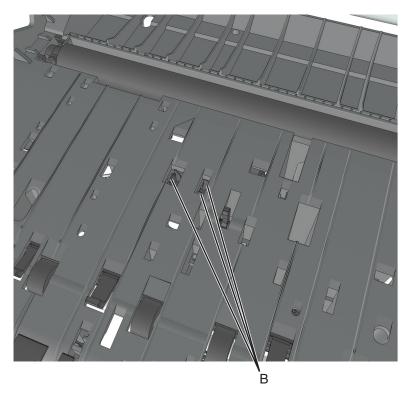

Trailing edge sensor removal


- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the right cover. See "Right cover removal" on page 239.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Remove the power supply. See "Power supply removal" on page 287.
- 5 Remove the power supply shield. See "Power supply shield removal" on page 288.
- 6 Remove the duplex. See "Duplex removal" on page 289.
- **7** Position the printer so that it sits on its left side.
- **8** Disconnect the cable JACM1 from the controller board.
- **9** Release the retainer spring (A) from the bracket (B).
- 10 Remove the screw (C).

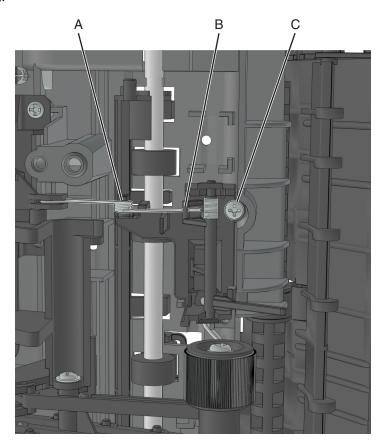


Media present sensor flag removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 3 Remove the power supply. See "Power supply removal" on page 287.
- 4 Remove the power supply shield. See "Power supply shield removal" on page 288.


- Remove the duplex. See "Duplex removal" on page 289.
- Remove the retainer spring (A).
- Remove the two springs (B).
- Remove the two screws (C).

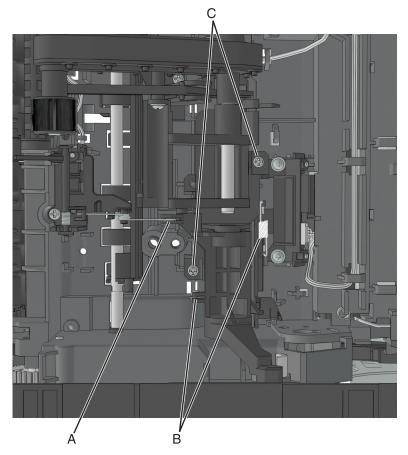

Below are the cam release and bracket.

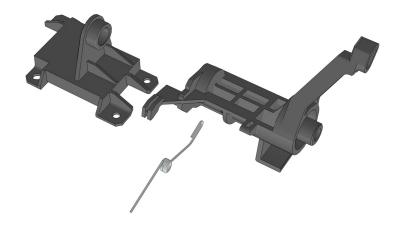


9 Remove the screw (D) securing the ACM lift cam to the ACM housing.

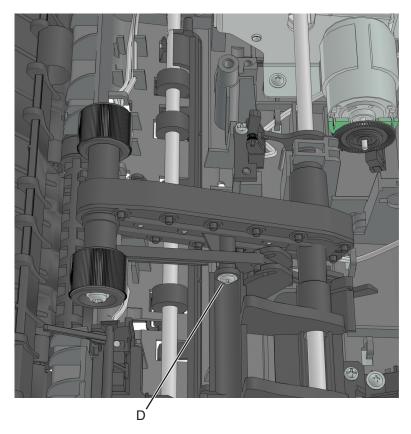


- **10** Remove the ACM lift cam by sliding it off the shaft.
- 11 Remove the screw (E), and then remove the media present sensor flag.

Note: Use a #1 Phillips screwdriver.

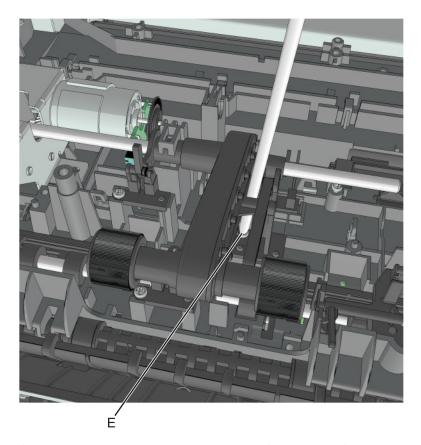


Installation note: Do the following to ensure proper installation of the sensor flag:

1 Lift the ACM.

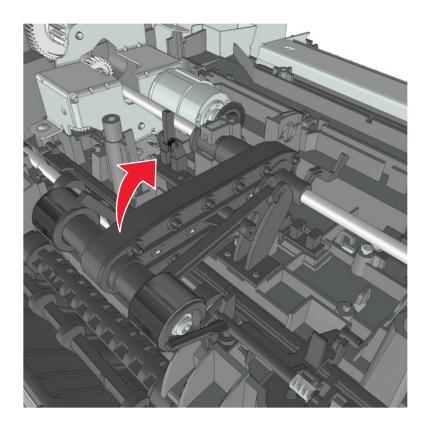

Parts removal


- **2** The protrusion on the ACM must align with the notch on the sensor flag.
- **3** The sensor flag must align with the media present sensor (A).

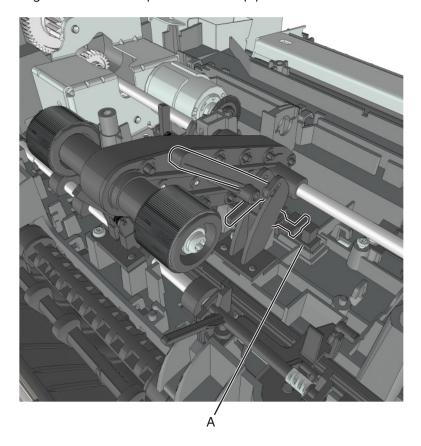


ACM assembly removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 3 Remove the power supply. See "Power supply removal" on page 287.
- 4 Remove the power supply shield. See "Power supply shield removal" on page 288.
- **5** Remove the duplex. See "Duplex removal" on page 289.
- 6 Remove the media present sensor flag. See "Media present sensor flag removal" on page 297.

7 Remove the E-clip (A), and slide the washer (B) from the shaft.

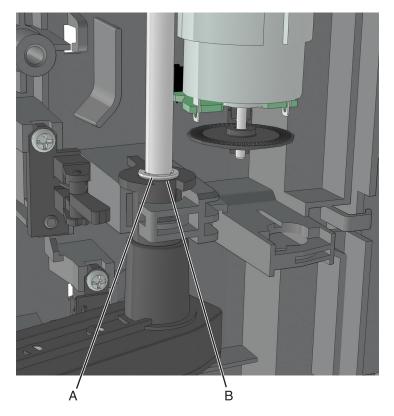

8 Release the lock by sliding the bushing and then rotating it clockwise.

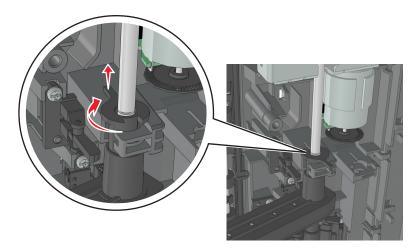

9 Remove the ACM assembly along with its shaft.


Below is the ACM assembly.



Pick/Lift motor gearbox removal

- 1 Remove the left cover. See "Left cover removal" on page 226.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 3 Remove the power supply. See "Power supply removal" on page 287.
- 4 Remove the power supply shield. See "Power supply shield removal" on page 288.
- **5** Remove the duplex. See "Duplex removal" on page 289.
- 6 Remove the ACM assembly. See "ACM assembly removal" on page 301.
- **7** Position the printer so that it sits on its left side.

8 Remove the three screws (A).

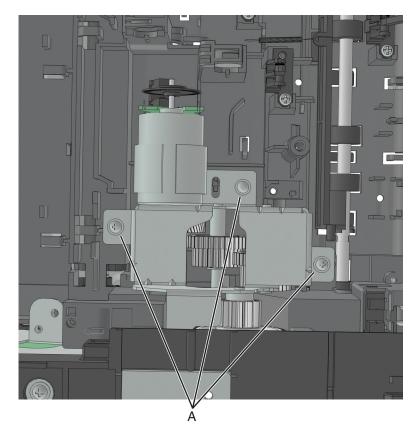


9 Disconnect the cable from the pick/lift motor gearbox.

Rear side removals

Dust cover removal


- **1** Press the latches on each side of the dust cover.
- 2 Remove the dust cover.

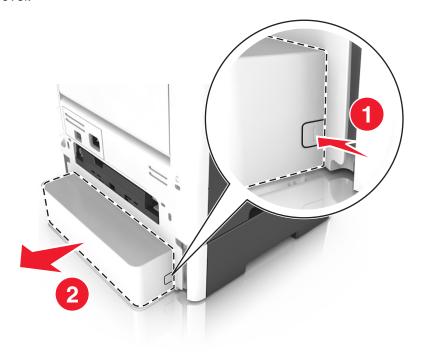


Rear door and cover removal

- **1** Position the printer so that it sits on either its left or right side.
- **2** Open the rear door at an angle of 45 degrees.

3 Pull the rear door to remove.

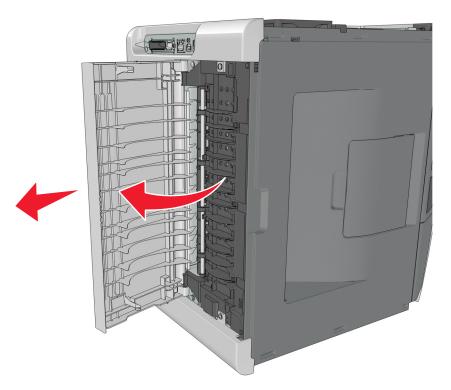


- **4** Remove the two screws (A) securing the rear cover.
- **5** Press the two latches to release the rear cover.

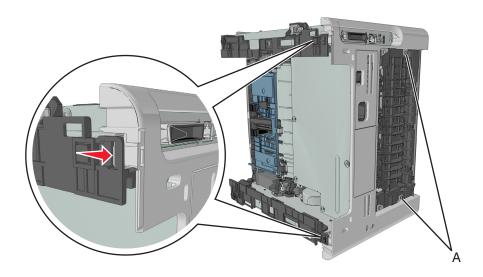


Narrow media/bin full sensor removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the left cover. See "Left cover removal" on page 226.
- **3** Remove the rear door and cover. See <u>"Rear door and cover removal" on page 305</u>.

- 4 Remove the top cover. See "Top cover removal" on page 312.
- **5** Disconnect the cable JNRW1 from the controller board.
- **6** Remove the six screws (A) securing the sensor and upper exit guide to the redrive assembly.

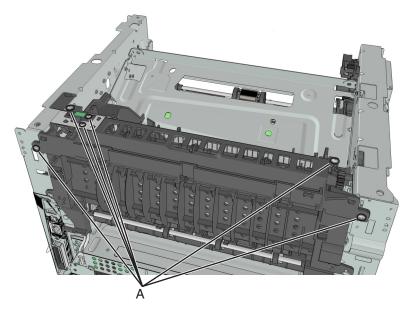


7 Remove the ground (B), sensor (C), and sensor flag (D).

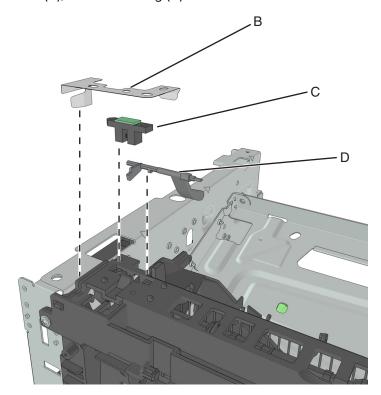


Redrive assembly removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the left cover. See "Left cover removal" on page 226.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Remove the top cover. See "Top cover removal" on page 312.
- **5** Disconnect the cable JNRW1 from the controller board.
- **6** Remove the two screws (A), and then detach the reverse solenoid.

Note: Do not disconnect the reverse solenoid cable from the controller board.

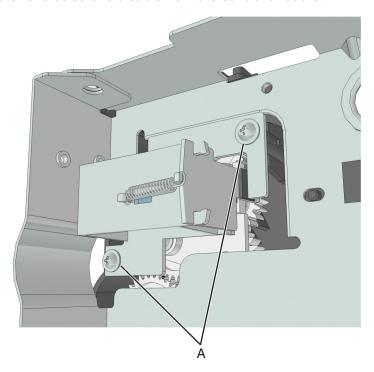


7 Remove the six screws (B) securing the redrive assembly.

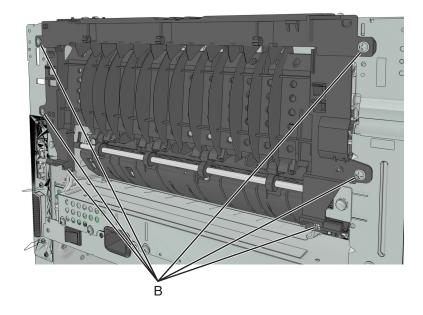

Redrive shaft removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the left cover. See "Left cover removal" on page 226.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- **4** Remove the top cover. See <u>"Top cover removal" on page 312</u>.
- **5** Remove the redrive assembly. See "Redrive assembly removal" on page 308.
- **6** Remove the two screws (A), and then remove the top of the redrive assembly.

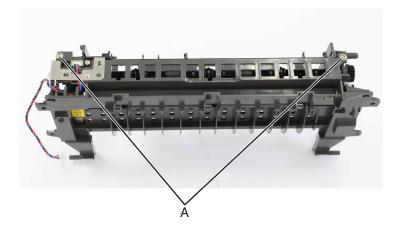


7 Remove the shaft.



8 If necessary, remove the bushing (B) from the redrive assembly.




Installation note: Install the bushing (A) on the redrive assembly before installing the shaft.

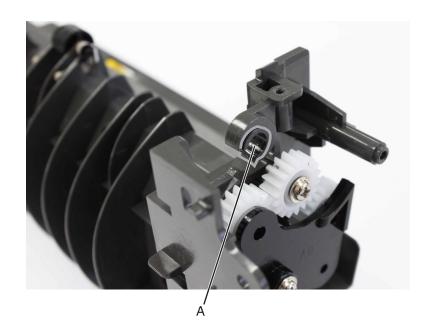

Fuser removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- **3** Remove the redrive assembly. See <u>"Redrive assembly removal" on page 308</u>.
- **4** Disconnect the cable JEXIT1 from the controller board.
- **5** Disconnect the two cables (A).
- **6** Remove the two screws (B) securing the fuser.

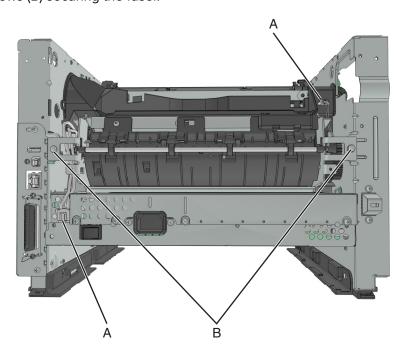


Parts removal


Top side removals

Top cover removal

- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the left cover. See "Left cover removal" on page 226.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Open the front door.
- **5** Remove the two screws (A) in front.

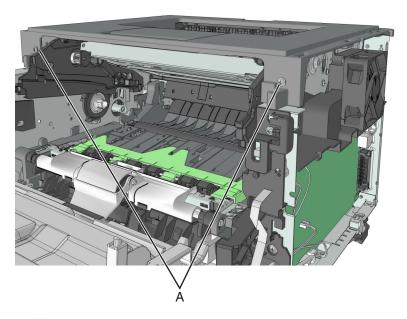

6 Remove the two screws (B) at the rear.

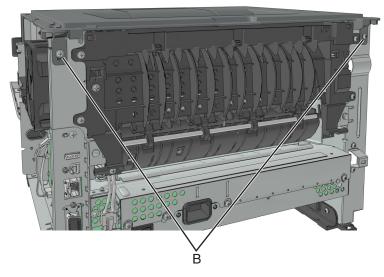

7 Lift the top cover to remove.

Laser scanning unit (LSU) removal

Before performing this task, determine first whether your printer supports a galvo or polygon LSU.


- Check the serial number of the printer. The LSU is galvo if the sixth digit character assigned is in the 0–9 or B–N range (example: **4514 20HH 007CR**). It is polygon if the sixth digit character assigned is in the P–Z range (example: **4514 2ZHH 007CR**).
- 1 Remove the right cover. See "Right cover removal" on page 239.
- 2 Remove the left cover. See "Left cover removal" on page 226.
- 3 Remove the rear door and cover. See "Rear door and cover removal" on page 305.
- 4 Remove the top cover. See "Top cover removal" on page 312.
- 5 Remove the cooling fan. See "Cooling fan removals" on page 241.
- **6** Disconnect the cable JGLV1 or J6 from the controller board.
- **7** Before loosening the screws securing the LSU, use a sharp pencil or a small, flat-blade screwdriver to mark the location of the LSU on the printer frame. This marking helps in positioning the new LSU.




8 Remove the LSU.

The color and location of the cables as well as the screws vary depending on the type of LSU that the printer supports.

• For the Galvo LSU, disconnect the two cables (A), and then remove the three screws (B).

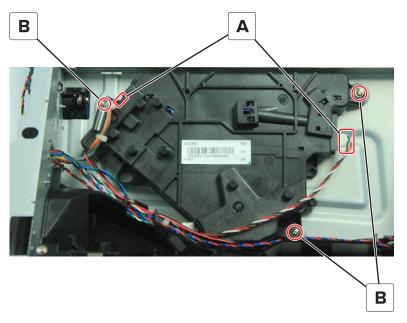


• For the Polygon LSU, disconnect the cable (A), remove the three screws (B), and then disconnect the cable JVIDEO or JLSU1 from the controller board.

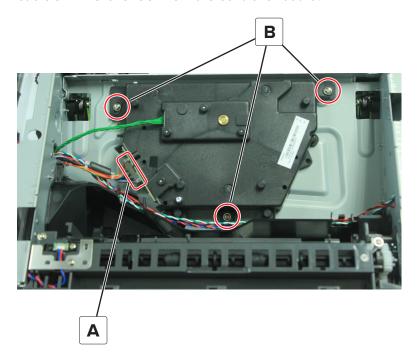

Installation notes:


- Mechanical and electronic LSU adjustments are required to complete the installation of the LSU. See "Printhead assembly adjustments" on page 223.
- When reinstalling the polygon LSU, make sure to follow the sequence, as indicated by the number, in the tightening of the screws; otherwise, 111.xx error would occur.

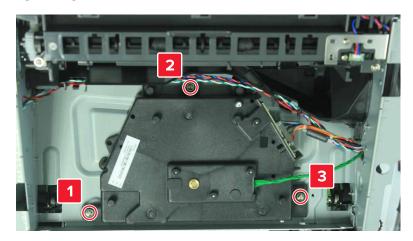

250/550-sheet option tray removals


Pick roller removal

- **1** Press the latches.
- 2 Remove the pick roller.

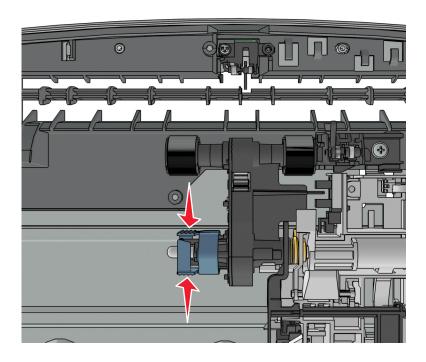


Separator roll assembly removal


1 Remove the screw (A) from under the tray insert.

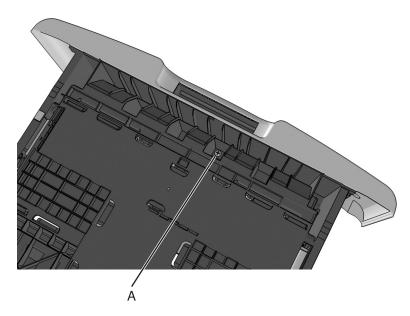


2 Remove the E-clip, and then remove the gear.

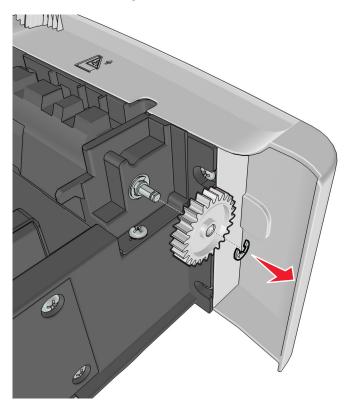

3 Remove the four screws (B).

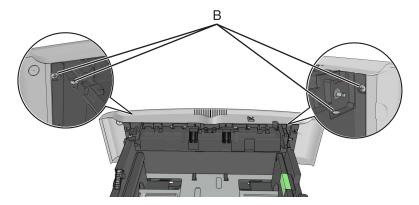


4 Push out the top part of the drawer cover, and then remove the separator roll assembly.

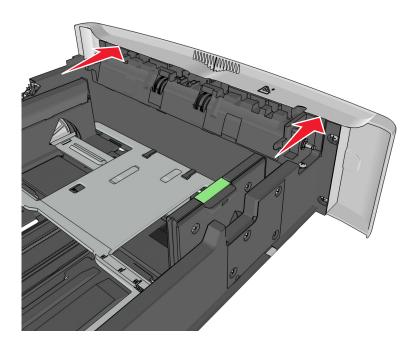


ACM assembly removal


1 Remove the seven screws (A), and release the two latches (B) from the top of the drawer.

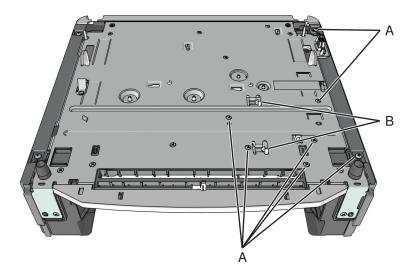


2 Remove the two screws (C), and then release the two latches under the screws.

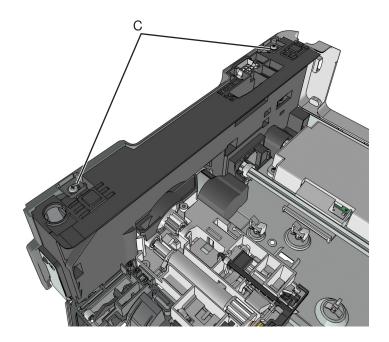


3 Swing the right cover backward to remove.

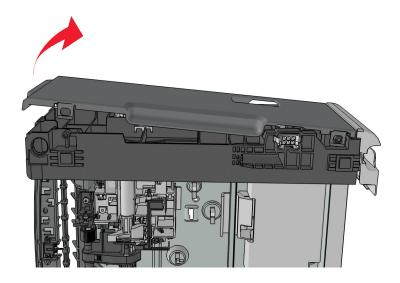


4 Remove the screw (D).

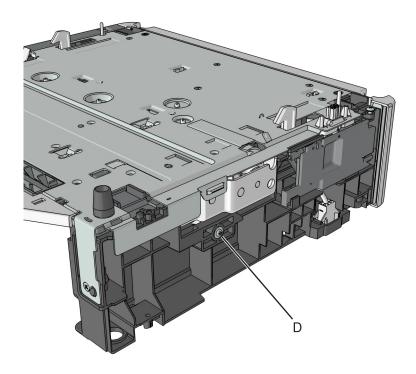

Disconnect the spring (E).

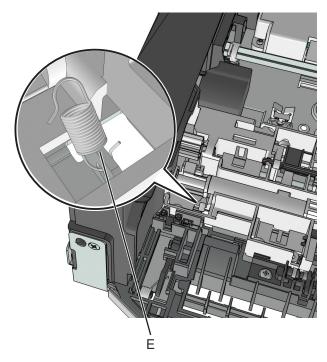

Remove the two screws (F), and then remove the controller card cover.

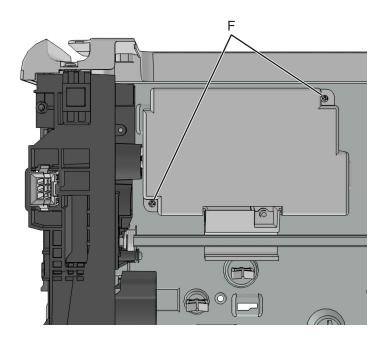


- Disconnect the cable J11 from the controller card.
- Route the cable off the option, and then remove the ACM assembly.

Component locations

Exterior locations


MS510dn and MS610dn exterior locations

Front view

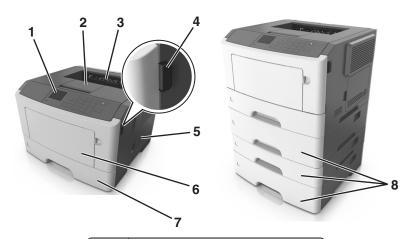

#	Part name
1	Control panel
2	Paper stop
3	Standard bin
4	Front door release button
5	Controller board access door
6	100-sheet multipurpose feeder
7	Standard tray
8	Optional 250- or 550-sheet tray


Rear view

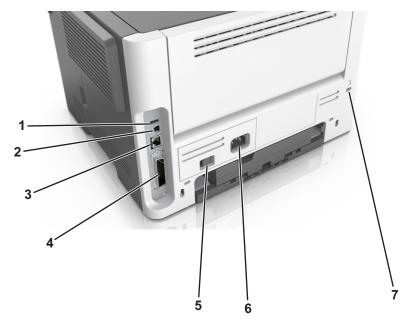

#	Part name
1	USB port
2	USB printer port
3	Ethernet port
4	Parallel port
	Note: This port is available only in select printer models.
5	Power switch
6	Printer power cord socket
7	Security slot


MS610de exterior locations

Front view

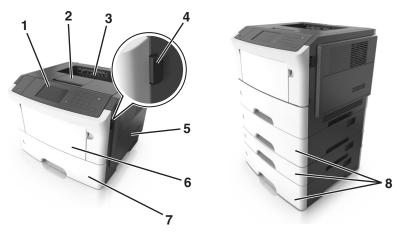

#	Part name
1	Control panel
2	Paper stop
3	Standard bin
4	Front door release button
5	Controller board access door
6	100-sheet multipurpose feeder
7	Standard tray
8	Optional 250- or 550-sheet tray

Rear view

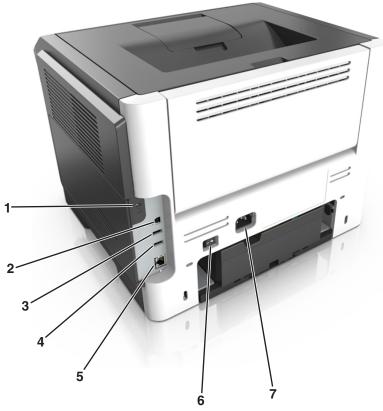

#	Part name
1	Security slot
2	USB printer port
3	USB port
4	USB port
5	Ethernet port
6	Power switch
7	Printer power cord socket

Maintenance

Inspection guide

The purpose of this inspection guide is to aid you in identifying the intervals, based on page count, at which parts must be inspected (for visible physical damage), cleaned, or replaced.

If any unsafe conditions exist, find out how serious the hazard could be and if you can continue before you correct the hazard.

As you service the machine, check for the following:

- Damaged, missing, or altered parts, especially in the area of the On/Off switch and the power supply
- Damaged, missing, or altered covers, especially in the area of the top cover and the power supply cover
- Possible safety exposure from any non-Lexmark attachments

Use the following table to determine when specified parts should be inspected:

	EVERY SERVICE CALL	EVERY 100K	EVERY 200K	NOTES
MEDIA TRAY—ALL				
Tray insert	Inspect	Inspect	Inspect	
Media side guides	Inspect	Inspect	Inspect	Check for correct positioning.
Media end guide	Inspect	Inspect	Inspect	Check for correct positioning.
Separation pad	Inspect	Clean	Clean	Damp cloth
Tray lift gear assembly		Inspect	Inspect	
Separation roller	Inspect	Inspect	Replace	Verify page count before replacing.
MEDIA FEEDERS—ALL				
Pick roller	Inspect	Inspect	Replace	Verify page count before replacing.
MPF feed rollers	Inspect	Inspect	Replace	Water or alcohol
Sensor		Clean	Clean	Brush or blower brush
TRANSFER ROLL				
Transfer roll	Inspect	Inspect	Replace	
FUSER UNIT				
Fuser unit	Inspect	Inspect	Replace	
Sensor (fuser exit)		Clean	Clean	Blower brush
REDRIVE ASSEMBLY				
Redrive assembly		Inspect	Replace	Water

Scheduled maintenance

The control panel displays an 80.xy error when it reaches 200K page counts. It is necessary to install the appropriate maintenance kit to maintain the print quality and reliability of the printer. Reset the maintenance counter after replacing the maintenance kit.

Maintenance kits

Part number and kit	Contents
40X8439—200K Maintenance Kit (MS510dn, 100 V)*	 Fuser (100V) Redrive assembly ACM tires/hubs Transfer roll Tray separator bracket MPF pick roll and separator pad
40X8281—200K Maintenance Kit (MS510dn, 110 V)	 Fuser (110V) Redrive assembly ACM tires/hubs Transfer roll Tray separator bracket MPF pick roll and separator pad
40X8282—200K Maintenance Kit (MS510dn, 220 V)	 Fuser (220V) Redrive assembly ACM tires/hubs Transfer roll Tray separator bracket MPF pick roll and separator pad
40X8440—200K Maintenance Kit (MS610dn, 100 V)*	 Fuser (100V) Redrive assembly ACM tires/hubs Transfer roll Tray separator bracket MPF pick roll and separator pad
40X8433—200K Maintenance Kit (MS610dn, 110 V)	 Fuser (110V) Redrive assembly ACM tires/hubs Transfer roll Tray separator bracket MPF pick roll and separator pad
*This kit is available only in Japan.	

Part number and kit	Contents
40X8435—200K Maintenance Kit (MS610dn, 220 V)	• Fuser (220V)
	Redrive assembly
	ACM tires/hubs
	Transfer roll
	Tray separator bracket
	MPF pick roll and separator pad
40X8441—200K Maintenance Kit (MS610de, 100 V)*	• Fuser (100V)
	Redrive assembly
	ACM tires/hubs
	Transfer roll
	Tray separator bracket
	MPF pick roll and separator pad
40X8434—200K Maintenance Kit (MS610de, 110 V)	• Fuser (110V)
	Redrive assembly
	ACM tires/hubs
	Transfer roll
	Tray separator bracket
	MPF pick roll and separator pad
40X8436—200K Maintenance Kit (MS610de, 220 V)	• Fuser (220V)
	Redrive assembly
	ACM tires/hubs
	Transfer roll
	Tray separator bracket
	MPF pick roll and separator pad
*This kit is available only in Japan.	

Resetting the maintenance counter

Always reset the maintenance counter after installing the maintenance kit.

- **1** POR into the Configuration menu, and navigate to **Reset Maintenance Counter**.
- **2** Depending on the printer model, press **OK** or touch \checkmark to reset the counter, or press **X** to exit without resetting the counter.

Once initiated, the operation cannot be canceled.

Lubrication specification

Lubricate only when the parts are replaced or if necessary, not on a scheduled basis. The use of lubricants other than those specified in this service manual may cause premature failure. Some unauthorized lubricants may chemically attack polycarbonate parts. Use Grease P/N 99A0394 Nyogel 744.

Cleaning the printer

Note: You may need to perform this task after every few months.

Warning—Potential Damage: Damage to the printer caused by improper handling is not covered by the printer warranty.

1 Make sure that the printer is turned off and unplugged from the electrical outlet.



CAUTION—SHOCK HAZARD: To avoid the risk of electrical shock when cleaning the exterior of the printer, unplug the power cord from the electrical outlet and disconnect all cables from the printer before proceeding.

- **2** Remove paper from the standard bin and multipurpose feeder.
- 3 Remove any dust, lint, and pieces of paper around the printer using a soft brush or vacuum.
- 4 Dampen a clean, lint-free cloth with water, and use it to wipe the outside of the printer.


Warning—Potential Damage: Do not use household cleaners or detergents to prevent damage to the exterior of the printer.

5 Make sure all areas of the printer are dry before sending a new print job.

Cleaning the printhead lenses

Note: This is applicable only to models with galvo LSU. To determine whether the LSU is galvo, check the serial number of the printer. The sixth digit character assigned should be in the 0–9 or B–N range (Example: 4514 20HH 007CR).

- 1 Open the front door.
- 2 Remove the toner cartridge and imaging unit.
- **3** From the printhead access opening (A) in the top of the frame at the front of the printer, find the printhead lens.

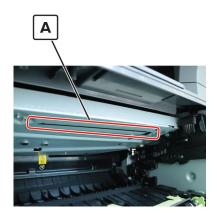

- 4 Insert a soft, lint-free cloth in the opening, and gently move the cloth back and forth along the surface of the lens to clean it.
- **5** Repeat step 4.
- **6** Reinstall the imaging unit and toner cartridge.
- **7** Close the front door.

Parts catalog

Legend


The following column headings are used in the parts catalog:

- Asm-index—Identifies the item in the illustration.
- Part number—Identifies the unique number that correlates with the part.
- Units/mach—Refers to the number of units actually used in the base machine or product.
- Units/FRU—Refers to the number of units in a particular FRU.
- **Description**—A brief description of the part.

The following abbreviations are used in the parts catalog:

- **NS** (not shown) in the Asm-index column indicates that the part is procurable but is not pictured in the illustration.
- PP (parts packet) in the Description column indicates that the part is contained in a parts packet.

Assembly 1: Covers

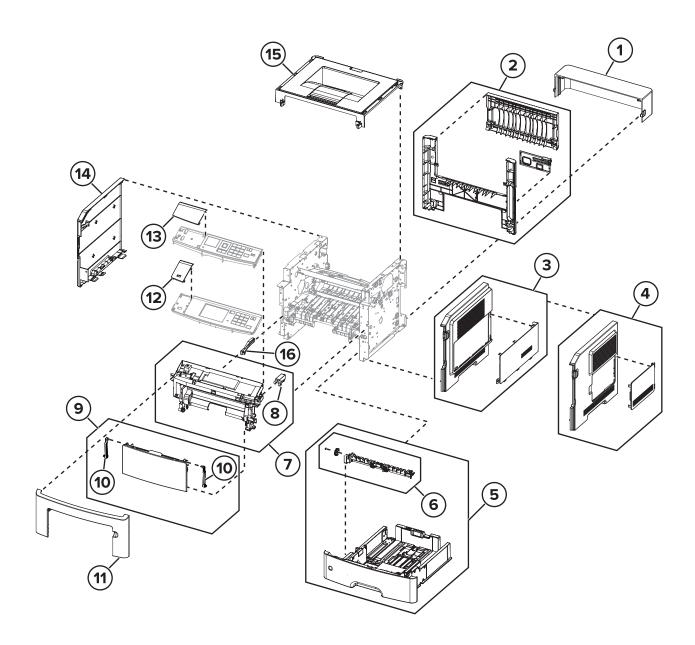


Assembly 1: Covers

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure	
1	40X8520	1	1	Dust cover (250-sheet tray)	"Dust cover removal" on page 305	
1	40X8521	1	1	Dust cover (550-sheet tray)	"Dust cover removal" on page 305	
2	40X8054	1	1	Rear door and cover	"Rear door and cover removal" on	
				(MS510dn, MS517dn and M1145)	page 305	
2	40X8270	1	1	Rear door and cover	"Rear door and cover removal" on	
				(MS610dn, MS617dn and M3150dn)	page 305	
2	41X0239	1	1	Rear door and cover	"Rear door and cover removal" on	
				(MS610de and M3150)	page 305	
3	40X9651	1	1	Right cover	"Right cover removal" on page 239	
				(MS610de and M3150)	page 255	
4	40X8087	1	1	Right cover	"Right cover removal" on page 239	
				(MS610dn, MS617dn and M3150dn)	page 239	
4	40X8052	1	1	Right cover	"Right cover removal" on	
				(MS510dn, MS517dn and M1145)	page 239	
5	40X8305	1	1	250-sheet tray insert	N/A	
5	40X8086	1	1	550-sheet tray	N/A	
6	40X8444	1	1	Separator roll assembly	"Separator roll assembly removal" on page 316	
7	40X8056	1	1	Front access cover	"Front access cover removal" on	
				(MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	page 282	
7	40X8268	1	1	Front access cover	"Front access cover removal" on	
				(MS610de and M3150)	<u>page 282</u>	
8	40X9148	1	1	Cartridge plunger	"Cartridge plunger removal" on page 256	
9	40X9131	1	1	MPF assembly (100 sheets)	"MPF assembly removal" on page 274	
10	41X0994	1	1	MPF tray links	"MPF assembly removal" on page 274	

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
11	40X8051	1	1	Nameplate	"Nameplate removals" on
				(MS510dn, MS517dn and M1145)	page 261
11	41X0005	1	1	Nameplate	"Nameplate removals" on
				(MS610dn, MS617dn and M3150dn)	page 261
11	40X8272	1	1	Nameplate	"Nameplate removals" on
				(MS610de and M3150)	page 261
12	40X8068	1	1	Bezel	"Bezel removals" on page 259
				(MS610de and M3150)	
13	40X8066	1	1	Bezel	"Bezel removals" on page 259
				(MS510dn and M1145)	
13	41X2013	1	1	Bezel	"Bezel removals" on page 259
				(MS517dn)	
13	40X8067	1	1	Bezel	"Bezel removals" on page 259
				(MS610dn and M3150dn)	
13	41X2017	1	1	Bezel	"Bezel removals" on page 259
				(MS617dn)	
14	40X8053	1	1	Left cover (MS510dn, MS517dn and M1145)	"Left cover removal" on page 226
14	40X8269	1	1	Left cover	"Left cover removal" on page
				(MS610dn, MS617dn, MS610de, M3150dn, and M3150)	<u>226</u>
15	40X8055	1	1	Top cover (MS510dn, MS517dn and M1145)	"Top cover removal" on page 312
15	40X8271	1	1	Top cover	"Top cover removal" on page 312
				(MS610dn, MS617dn, MS610de, M3150dn, and M3150)	
16	41X2300	1	1	Access cover link	N/A
NS	40X8273	4	40	Rubber foot	N/A

Assembly 2: Electronics 1

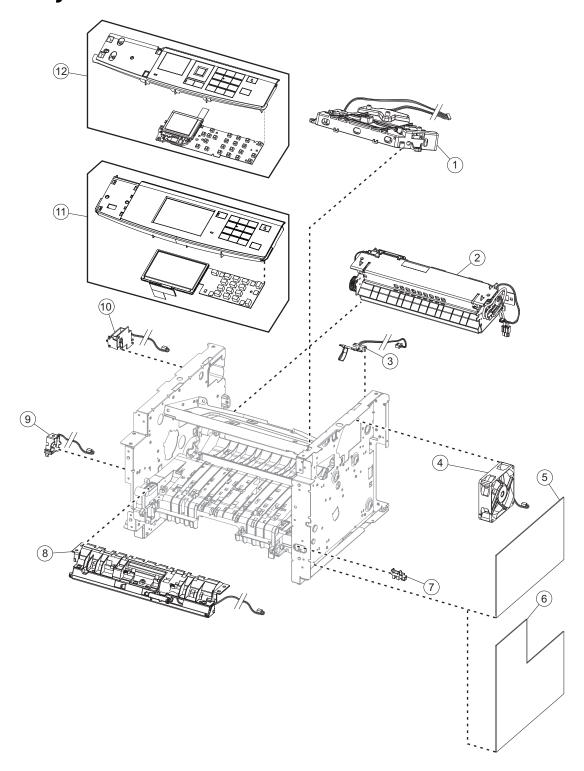

Assembly 2: Electronics 1


Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	41X0363	1	1	Polygon laser scanning unit (LSU) frame*	
1	41X0362	1	1	Polygon LSU*	"Laser scanning unit (LSU) removal" on page 313
1	40X8080	1	1	Galvo LSU*	"Laser scanning unit (LSU)
				(MS510dn, MS517dn and M1145)	removal" on page 313
1	40X8079	1	1	Galvo LSU*	"Laser scanning unit (LSU)
				(MS610dn, MS617dn, MS610de, M3150dn, and M3150)	removal" on page 313
2	40X8343	1	1	Fuser, 100 V	"Fuser removal" on page 311
2	40X8023	1	1	Fuser, 110 V	"Fuser removal" on page 311
2	40X8024	1	1	Fuser, 220 V	"Fuser removal" on page 311
3	40X8050	1	1	Narrow media/bin full sensor	"Narrow media/bin full sensor removal" on page 306
4	40X8276	1	1	Cooling fan	"Cooling fan removals" on
				(MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	page 241
4	40X9181	1	1	Cooling fan	"Cooling fan removals" on page 241
_		_	_	(MS610de and M3150)	
5	41X0366	1	1	Controller board*	<u>"Controller board removals" on</u> page 245
				(applicable only to models MS510dn and MS517dn with polygon LSU)	
5	41X0367	1	1	Controller board*	"Controller board removals" on
				(applicable only to models MS610dn and MS617dn with polygon LSU)	page 245
5	40X8029	1	1	Controller board*	"Controller board removals" on
				(applicable only to models MS510dn, MS517dn and M1145 with galvo LSU)	page 245
5	40X8030	1	1	Controller board*	"Controller board removals" on
				(applicable only to models MS610dn, MS617dn and M3150dn with galvo LSU)	page 245

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
6	40X8388	1	1	Controller board* (applicable only to models MS610de and M3150 with galvo LSU)	"Controller board removals" on page 245
6	41X0988	1	1	Controller board* (applicable only to models MS610de and M3150 with polygon LSU)	"Controller board removals" on page 245
7	40X7592	1	1	Tray present sensor	"Tray present sensor removal" on page 240
8	40X8280	1	1	Front input guide	"Front input guide removal" on page 283
9	40X8300	1	1	MPF solenoid	"MPF solenoid removal" on page 229
10	40X8301	1	1	Reverse solenoid	"Reverse solenoid removal" on page 235
11	40X8285	1	1	Control panel assembly (MS610de and M3150)	"Control panel assembly removals" on page 263
12	40X8292	1	1	Control panel assembly (MS510dn, MS517dn and M1145)	"Control panel assembly removals" on page 263
12	40X8284	1	1	Control panel assembly (MS610dn, MS617dn and M3150dn)	"Control panel assembly removals" on page 263
NS	41X0759	1	1	Polygon LSU cable	
NS	41X0913	1	1	Video cable (applicable only to models with galvo* LSU)	

^{*} To determine what type of LSU (galvo or polygon) the printer supports and whether it is compatible with the controller board:

- Check the serial number of the printer. If the sixth digit character assigned is in the P–Z range, then the LSU is polygon (example: 4514 2ZHH 007CR). If the sixth digit character assigned is in the 0–9 or B–N range, then the LSU is galvo (example: 4514 20HH 007CR7.
- Check the color of the controller board. For polygon LSU, the color of the compatible controller board is blue. For galvo LSU, the color is green.


Assembly 3: Electronics 2

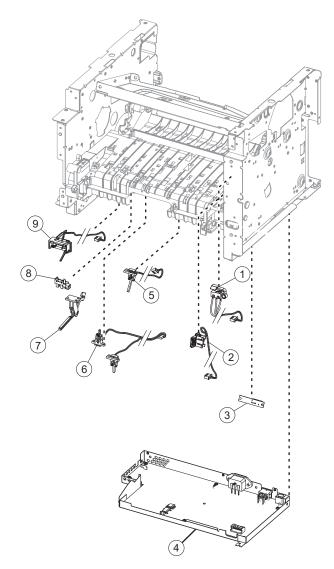

Assembly 3: Electronics 2

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
1	40X8048	1	1	Front door sensor	"Front door sensor removal" on page 282
2	40X8266	1	1	Cartridge smart chip contact	"Toner cartridge smart chip contact removal" on page 249
3	40X8046	1	1	Toner density sensor	"Toner density sensor removal" on page 293
NS	41X1025	1	1	Toner density wiper kit • RheoGel 739 (41X0986)	
				• toner density sensor (40X8406)	
4	40X7797	1	1	Power supply, 100 V/110 V	"Power supply removal" on page 287
4	40X7798	1	1	Power supply, 220 V	"Power supply removal" on page 287
5	40X8044	1	1	Index sensor	"Index sensor removal" on page 293
6	40X8043	1	1	Duplex sensor and input sensor	"Duplex sensor and input sensor removal" on page 290
7	40X8800	1	1	Media present sensor flag	"Media present sensor flag removal" on page 297
8	40X7592	1	1	Media present sensor	"Media present sensor removal" on page 295
9	40X8045	1	1	Trailing edge sensor	"Trailing edge sensor removal" on page 297

Assembly 4: Frame

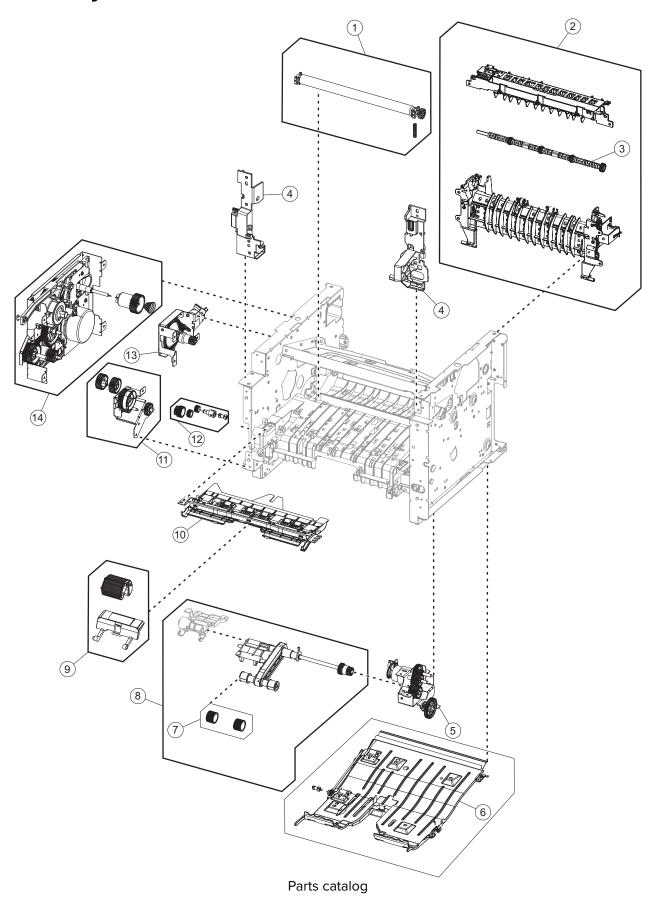


Assembly 4: Frame

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
1	40X8393	1	1	Transfer roll	"Transfer roll removal" on page 255
2	40X8298	1	1	Redrive assembly	"Redrive assembly removal" on
				(MS510dn, MS517dn and M1145)	page 308
2	40X8437	1	1	Redrive assembly	"Redrive assembly removal" on
				(MS610dn, MS617dn and M3150dn)	page 308
2	40X8438	1	1	Redrive assembly	"Redrive assembly removal" on
				(MS610de, and M3150)	page 308
3	40X8850	1	1	Redrive shaft	"Redrive shaft removal" on page 309
4	40X8299	1	1	Front mounts	"Left front mount removal" on page 251
					"Right front mount removal" on page 253
5	40X8084	1	1	Pick/Lift motor gearbox	"Pick/Lift motor gearbox removal" on page 303
6	40X8275	1	1	Duplex assembly	"Duplex removal" on page 289
7	41X0958	2	2	Pick tires	N/A
8	41X0959	1	1	ACM assembly (standard tray only)	"ACM assembly removal" on page 301
9	40X8295	2	2	MPF pick roller and separator pad	"MPF pick roller removal" on page 277
					and
					"Separator pad removal" on page 285
10	40X8279	1	1	Jam access cover	"Jam access cover removal" on page 278
11	40X8777	1	1	MPF gearbox	"MPF gearbox removal" on page 232
12	40X8277	1	1	Duplex gear assembly	"Duplex gear assembly removal" on page 237
13	40X8083	1	1	Cartridge gearbox	"Cartridge gearbox removal" on page 236
14	40X8085	1	1	Main drive gearbox	"Main drive gearbox removal" on page 227

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	40X8394	1	1	Screw kit, contains: • MT3x0.5+8PF-NI—10 pieces • MT3x0.5+6PF-NI—10 pieces • TP2NC-3+6PF-NI—10 pieces	N/A

Assembly 5: Option trays

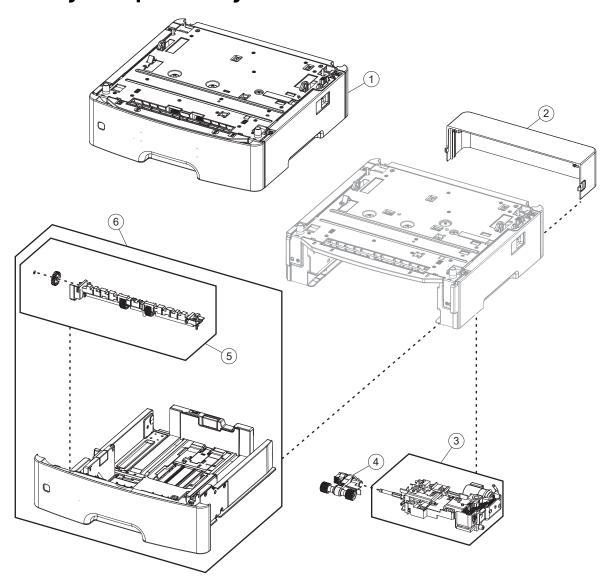

Assembly 5: Option trays

Asm-index	P/N	Units/opt	Units/FRU	Description	Removal procedure
1	40X8287	1	1	250-sheet tray	N/A
1	40X8286	1	1	550-sheet tray	N/A
1	40X9654	1	1	550-sheet tray, lockable	N/A
2	40X8520	1	1	Dust cover, 250-sheet tray	"Dust cover removal" on page 305
2	40X8521	1	1	Dust cover, 550-sheet tray	"Dust cover removal" on page 305
3	40X8262	1	1	ACM assembly (option tray only)	"ACM assembly removal" on page 318
4	40X8443	1	1	Pick roller assembly	"Pick roller removal" on page 315
5	40X8444	1	1	Separator roll assembly	"Separator roll assembly removal" on page 316
6	40X8528	1	1	250-sheet tray insert (option tray only)	N/A
6	40X8529	1	1	550-sheet tray insert (option tray only)	N/A

Assembly 6: Maintenance kits

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	40X8439	1	1	Maintenance kit, 100 V (MS510dn, MS517dn and M1145)	N/A
				• 100 V fuser (40X8343)	
				Paper exit guide (40X8298)	
				ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				Tray separator roll assembly (40X8444)	
				 MPF pick roll and separator pad (40X8295) 	
NS	40X8281	1	1	Maintenance kit, 110 V (MS510dn, MS517dn and M1145)	N/A
				• 110 V fuser (40X8023)	
				Paper exit guide (40X8298)	
				ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				Tray separator roll assembly (40X8444)	
				 MPF pick roll and separator pad (40X8295) 	
NS	40X8282	1	1	Maintenance kit, 220 V (MS510dn, MS517dn and M1145)	N/A
				• 220 V fuser (40X8024)	
				Paper exit guide (40X8298)	
				ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				Tray separator roll assembly (40X8444)	
				 MPF pick roll and separator pad (40X8295) 	
NS	40X8440	1	1	Maintenance kit, 100 V (MS610dn, MS617dn and M3150dn)	N/A
				• 100 V fuser (40X8343)	
				Paper exit guide (40X8437)	
				ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				Tray separator roll assembly (40X8444)	
				MPF pick roll and separator pad (40X8295)	

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	40X8433	1	1	Maintenance kit, 110 V (MS610dn, MS617dn and M3150dn)	N/A
				• 110 V fuser (40X8023)	
				Paper exit guide (40X8437) ACM pick rell (41X0059)	
				ACM pick roll (41X0958)Transfer roll (40X8393)	
				 Tray separator roll assembly (40X8444) 	
				MPF pick roll and separator pad	
				(40X8295)	
NS	40X8435	1	1	Maintenance kit, 220 V (MS610dn, MS617dn and M3150dn)	N/A
				• 220 V fuser (40X8024)	
				Paper exit guide (40X8437)	
				ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				Tray separator roll assembly (40X8444)	
				 MPF pick roll and separator pad (40X8295) 	
NS	40X8441	1	1	Maintenance kit, 100 V (MS610de and M3150)	N/A
				• 100 V fuser (40X8343)	
				Paper exit guide (40X8438)	
				ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				Tray separator roll assembly (40X8444)	
				 MPF pick roll and separator pad (40X8295) 	
NS	40X8434	1	1	Maintenance kit, 110 V (MS610de and M3150)	N/A
				• 110 V fuser (40X8023)	
				Paper exit guide (40X8438)	
				ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				• Tray separator roll assembly (40X8444)	
				 MPF pick roll and separator pad (40X8295) 	

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	40X8436	1	1	Maintenance kit, 220 V (MS610de and M3150)	N/A
				• 220 V fuser (40X8024)	
				Paper exit guide (40X8438)	
				• ACM pick roll (41X0958)	
				Transfer roll (40X8393)	
				• Tray separator roll assembly (40X8444)	
				 MPF pick roll and separator pad (40X8295) 	

Assembly 7: Power cords

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	40X0269	1	1	Power cord, 2.5 m (straight)—USA, Canada	N/A
NS	40X0289	1	1	Power cord, 1.8 m (straight)—USA	N/A
NS	40X3141	1	1	Power cord, 2.5 m (straight)—Europe and others	N/A
NS	40X0288	1	1	Power cord, 2.5 m (straight)—Argentina	N/A
NS	40X0271	1	1	Power cord, 2.5 m (straight)—United Kingdom	N/A
NS	40X0275	1	1	Power cord, 2.5 m (straight)—Israel	N/A
NS	40X1772	1	1	Power cord, 2.5 m (straight)—Switzerland	N/A
NS	40X1773	1	1	Power cord, 2.5 m (straight)—South Africa	N/A
NS	40X0273	1	1	Power cord, 2.5 m (straight)—Traditional ltaly	N/A
NS	40X1774	1	1	Power cord, 2.5 m (straight)—Denmark	N/A
NS	40X4596	1	1	Power cord, 2.5 m (straight)—Brazil	N/A
NS	40X0303	1	1	Power cord, 2.5 m (straight)—China	N/A
NS	40X0270	1	1	Power cord, 2.5 m (straight)—Japan	N/A
NS	40X1792	1	1	Power cord, 2.5 m (straight)—Korea	N/A
NS	40X1791	1	1	Power cord, 2.5 m (straight)—Taiwan	N/A
NS	40X0301	1	1	Power cord, 2.5 m (straight)—Australia	N/A

Assembly 8: Miscellaneous

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	40X8737	1	1	RFID card reader	N/A
NS	40X9939	1	1	MarkNet N8352 802.11 b/g/n Wireless Print Server Kit	N/A
NS	40X4819	1	1	Adapter, RS232C serial	N/A
NS	40X5315	1	1	Screw, Ship with ISP (2)	N/A
NS	40X5316	1	1	Cable, 14 pin JST for ISP	N/A
NS	40X5317	1	1	Standoff, Tee with thumbscrew	N/A
NS	40X4826	1	1	Adapter, N8120 GB INA	N/A
NS	40X4823	1	1	Adapter, Parallel 1284-B	N/A
NS	40X4827	1	1	Adapter, N8130 10/100 Fiber	N/A
NS	40X8523	1	1	RS-232C Serial Interface Card	N/A
NS	40X8524	1	1	1284-B Parallel Interface Card	N/A
NS	40X7445	1	1	2GB DDR3 RAM	N/A
NS	40X7567	1	1	1GB DDR3 RAM	N/A
NS	41X0855	1	1	Forms and Barcode Card	N/A
				(MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	
NS	41X0856	1	1	Forms and Barcode Card (MS610de and M3150)	N/A
NS	41X0857	1	1	Forms and Barcode + Simplified Chinese Font	N/A
				(MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	
NS	41X0859	1	1	Forms and Barcode + Japanese Font	N/A
				(MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	
NS	41X0840	1	1	Prescribe Card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	N/A
NS	41X0860	1	1	Prescribe Card (MS610de and M3150)	N/A
NS	41X0838	1	1	IPDS card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	N/A
NS	41X0858	1	1	IPDS card (MS610de and M3150)	N/A
NS	40X0387	1	1	Interface device, USB-A	N/A
NS	40X8570	1	1	Font card, Arabic	N/A
NS	40X8571	1	1	Font card, Hebrew	N/A

Asm-index	P/N	Units/mach	Units/FRU	Description	Removal procedure
NS	40X8568	1	1	Font card, Korean	N/A
NS	40X8569	1	1	Font card, Japanese	N/A
NS	40X8556	1	1	Font card, Traditional Chinese	N/A
NS	40X8557	1	1	Font card, Simplified Chinese	N/A
NS	40X8555	1	1	256MB flash card	N/A
NS	40X7856	1	1	160GB hard disk (MS610de and M3150)	N/A
NS	40X1368	1	1	USB cable, packaged (2 m)	N/A
NS	40X8695	1	1	Relocation kit (MS510 and MS517dn)	N/A
NS	40X8696	1	1	Relocation kit (MS610dn and MS617dn)	N/A
NS	40X8697	1	1	Relocation kit (MS610de)	N/A
NS	40X8526	1	1	MarkNet N8350 802.11 b/g/n Wireless Print Server (MS610de)	N/A
NS	41X0568	1	1	MarkNet N8350 802.11 b/g/n Wireless Print Server with NFC (MS610de)	N/A
NS	40X9652	1	1	Adapter, N8130 10/100 fiber	N/A
NS	40X9939	1	1	N8352 Wireless Card + NFC	N/A

Printer specifications

Product power consumption

The following table documents the power consumption characteristics of the product.

Note: Some modes may not apply to your product.

Mode	Description	Power consumption (Watts)
Printing	The product is generating hard-copy output from electronic inputs.	600 (MS510dn); 640 (MS610dn, MS610de)
Сору	The product is generating hard-copy output from hard-copy original documents.	NA
Scan	The product is scanning hard-copy documents.	NA
Ready	The product is waiting for a print job.	9
Sleep Mode	The product is in a high-level energy-saving mode.	5
Hibernate	The product is in a low-level energy-saving mode.	1
Off	The product is plugged into an electrical outlet, but the power switch is turned off.	0

The power consumption levels listed in the previous table represent time-averaged measurements. Instantaneous power draws may be substantially higher than the average.

Values are subject to change. See www.lexmark.com for current values.

Electrical specifications


Low-voltage models

- 100 to 127 V ac at 47 to 63 Hz nominal
- 90 to 137 V ac, steady state operational extremes

High-voltage models

- 220 to 240 V ac at 47 to 63 Hz nominal (not available in all countries)
- 198 to 254 V ac, steady state operational extremes

Operating clearances

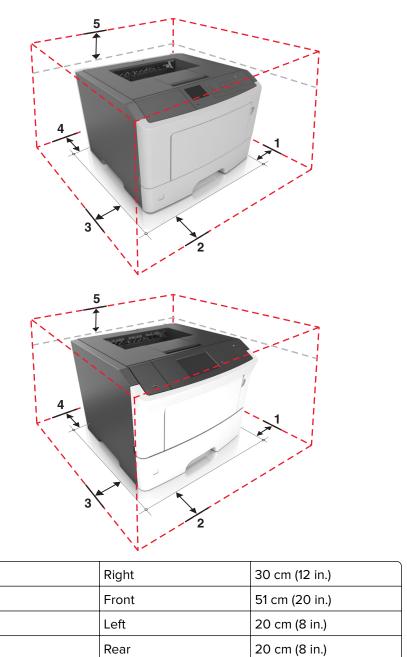

Allow additional clearance around the printer for adding the optional input trays.

30 cm (12 in.)

Acoustics

2

3

All measurements are made in accordance with ISO 7779 and conform with ISO 9296.

Тор

Status	1 meter average sound pressure dBA	Declared sound power level (Bels)			
Idle (Standby)	Inaudible	Inaudible			
Quiet Mode	51 dBA	6.6 Bels			
Simplex Printing	54 dBA	6.9 Bels			
Sleep/Hibernate Mode	Inaudible	Inaudible			
Measurements apply to 300 dpi, 600 dpi and 1200 dpi printing.					

Status	1 meter average sound pressure dBA	Declared sound power level (Bels)			
Idle (Standby)	Inaudible	Inaudible			
Quiet Mode	52 dBA	6.7 Bels			
Simplex Printing	55 dBA	7.0 Bels			
Sleep/Hibernate Mode	Inaudible	Inaudible			
Measurements apply to 300 dpi, 600 dpi and 1200 dpi printing.					

Operating environment

Environment	Specification				
Temperature—printer operating	60 to 90 °F (16 to 32 °C)				
Relative humidity—printer operating	8 to 80%				
Maximum wet bulb temperature—printer operating	73 °F (23 °C)				
Temperature—printer off	50 to 110 °F (10 to 43 °C)				
Relative humidity—printer off	8 to 80%				
Maximum wet bulb temperature—printer off	80 °F (27 °C)				
Temperature—ambient operating environment*	60 to 90 °F (16 to 32 °C)				
Relative humidity—ambient operating environment*	8 to 80%				
Temperature—storage and shipping (packaged printer) with or without print cartridge	-40 to 110 °F (-40 to 43 °C)				
Altitude	10,000 ft (0 to 3,048 m)				
Atmospheric pressure	74.6 kPa				
Tilt	2°				
*In some cases, performance specifications (such as paper OCE ED cartridge usage) are					

^{*}In some cases, performance specifications (such as paper OCF, EP cartridge usage) are measured at an ambient condition.

Enabling the security reset jumper

The security reset jumper can reset a printer that is locked due to a forgotten password or lost network connectivity.

Notes:

- Resetting the printer deletes all security settings.
- Before changing the security settings, ask for permission from your administrator.
- 1 Turn off the printer.
- 2 Access the controller board.
- **3** Move the jumper to cover the middle and exposed prongs.

Note: The small yellow jumper is located beside a lock icon on the controller board.

4 Turn on the printer.

Invalidating the effects of a jumper reset

- 1 From the Embedded Web Server, click **Settings** > **Security** > **Miscellaneous Security Settings**.
- **2** From the Security Reset Jumper menu, select **No Effect**.

Warning: This setting disables access to the security menus of a locked printer. To regain access to the menus, replace the controller board.

3 Click Submit.

Notes:

- Use a cable lock to secure the controller board and prevent a malicious reset.
- For multifunction products, when the controller board is replaced, the security settings are lost and the LDAP configuration and Copy function are no longer protected.

Options and features

Available internal options

- DDR3 DIMM
- Flash memory
 - Fonts
 - Firmware
 - Forms Barcode
 - Prescribe
 - IPDS
 - PrintCryption
- Hard disk*
- Internal Solutions Ports (ISP)*
 - Parallel 1284-B interface
 - MarkNet N8130 10/100 fiber interface
 - RS-232-C serial interface

Media handling options

- Standard output bin
 - 150-sheet bin (MS510)
 - 250-sheet bin (MS610)
- Standard tray
 - 250-sheet tray (MS510)
 - 550-sheet tray (MS610)
- Optional 250-sheet tray*
- Optional 550-sheet tray*
- Multipurpose feeder

^{*} This internal option is available only in the MS610de printer model.

^{*} Any combination of 550-sheet and 250-sheet trays may be installed up to a total of 3 optional trays.

Theory of operation

POR sequence

As the printer is turned on, the engine code goes through a series of tests to verify hardware integrity. If a hardware failure is detected, then it is reported to the printer. If the POR sequence cannot be completed successfully, then the printer may post an error message. The message states that service may be needed.

Printer control

The printer uses a single processor for both RIP and engine functions. The raster image processor (RIP) code performs system responsibilities such as PC connection, LAN, ISP attachments, and bitmap generation. The engine code performs tasks related to the operation of the electrical and mechanical device systems such as motors, lasers, power supplies, and fusers. The NVRAMs are located on the controller board and control panel, replacement of either the controller board or control panel will pull or mirror NVRAM data from each other.


Paper path information

Input tray

Component functions for feeding from the tray:

- Tray present sensor—Detects if the tray is inserted
- Media present sensor—Detects whether the media level is empty or low.
- Pick/Lift motor—Supplies the mechanical power requirements of the lift plate and the pick rollers.

When feeding media, the front part of the lift plate is raised, pressing the media to the pick rollers. The pick rollers rotate to feed the media to the separator rolls. The separator rolls rotate in a direction opposite to the pick rollers. This ensures that sheets are fed one at a time. The media is then fed to the secondary input roller and then to the first input roller.

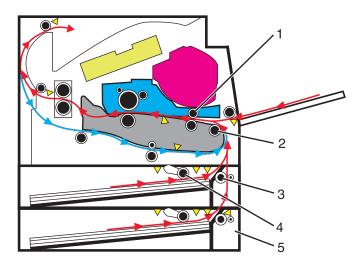


#	Part	
1	First input roller	
2	Secondary input roller	
3	Separator roller	
4	Pick rollers	
5	Option tray	

Multipurpose feeder (MPF)

The driving force from the main drive motor is transmitted through the MPF gearbox. When the MPF solenoid activates, it allows the MPF sector gear linked to the MPF gearbox to rotate. The MPF pick roll shaft is connected to the MPF sector gear.

The MPF can be accessed by opening the MPF tray on the front door. In an MPF paper feed, the MPF paper present sensor detects the media. The instant the MPF pick roll shaft rotates, the cams on each end of the shaft disengage the MPF tray. Each side of the tray is connected to the front access cover by springs. When disengaged from the shaft, the springs pull the tray causing the media to come into contact with the MPF pick roller. At the same time the pick roller rotates, pushing the media to the separator pad. The media does not pass through the secondary input roller, but directly to the first input roller.

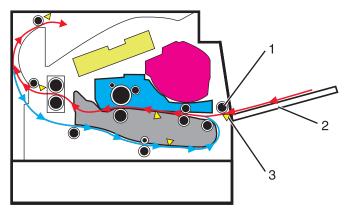


#	Part
1	MPF pick roller
2	MPF tray
3	MPF paper present sensor

Simplex printing

Situated along the first input roller, is the deskew shutter. It subjects the media to a deskewing force based on the media width. The direction of the force is transverse to the feed direction. The leading edge of the media then passes though the input sensor.

After the edge of the media is aligned, the first input roller feeds the media to the transfer roll for toner transfer. At this point, the toner image is already on the photoconductor drum surface. As the media passes between the photoconductor drum and transfer roll, the toner image is transferred to the media.


The media with the embedded toner image goes through the fuser assembly to permanently bond the toner to the media. When it passes between the heat belt and pressure roll of the fuser assembly, the combination of heat and pressure fuses the toner image to the media. The fuser exit roller feeds the media to the paper exit roller and then to the output bin.

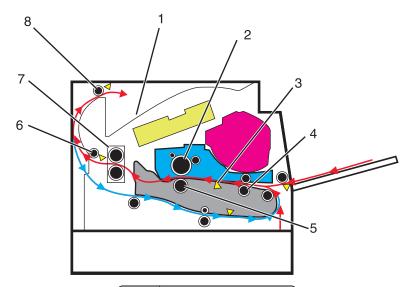

#	Part	
1	Output bin	
2	Photoconductor drum	
3	Input sensor	
4	First input roller	
5	Transfer roller	
6	Fuser exit roller	
7	Fuser assembly	
8	Paper exit roller	

Duplex printing

After the first side of the media has been printed on and is partially fed out to the output bin, the duplex solenoid activates. This causes the exit roller to reverse its rotation and feed the media, with its trailing edge first, back into the redrive assembly and then to the duplex paper path. The duplex front and rear deliver rollers move the media through the duplex paper path, the diverter, the first input roller, and back to the primary paper path. The same process for printing on the first side of the media repeats, this time for the second side of the media.

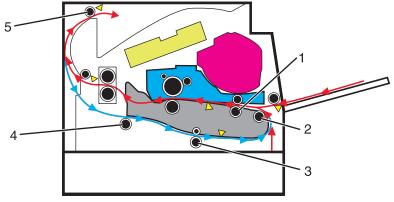

#	Part	
1	First input roller	
2	Secondary input roller	
3	Duplex front deliver roller	
4 Duplex rear deliver roller		
5	Paper exit roller	

Media handling components

Main drive gearbox

The gearbox supplies all mechanical power requirements of the printer. Its motor, through several gears, transfers power to following paths: photoconductor drum, transfer roll, fuser, paper exit, input, duplex, and MPF.

Aside from providing rotational motion to rollers and feeders, the gearbox must also ensure that the print image is not distorted during the whole process. It must also provide easy and effective means to cut or break the transfer of motion when taking the cartridge unit out of the machine, or when clearing jammed sheets through its linkage system.


Autocompensator mechanism (ACM)

The fundamental function of the ACM is to pick and feed a single sheet of media and accurately deliver it to the downstream paper path. The pick arm is counterbalanced to provide a priming force throughout the entire range of paper levels in the tray. When media is picked, a subsequent sheet is not picked until the previous sheet's trailing edge is detected by the trailing edge sensor. Once the trailing edge of the media is detected, and the minimum interpage gap is satisfied, the next sheet will be picked.


Key components

Sensors

MS310/MS410 sensors

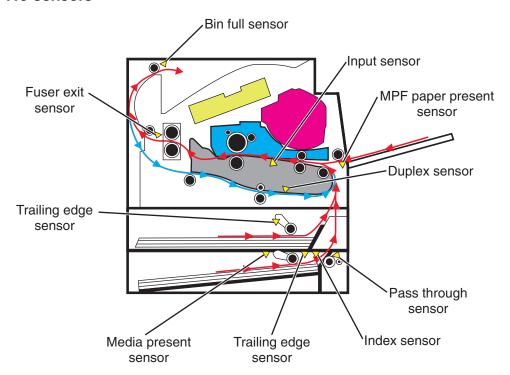

MS510/MS610 sensors

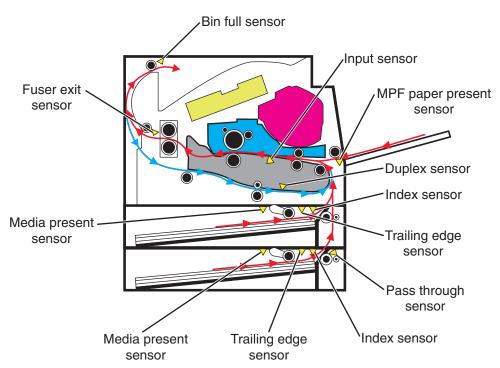

Theory of operation

Trailing edge sensor

Detects the media's trailing edge as it passes the pick tires. Among other capabilities, this sensor can be used to determine the paper size sensor and the media stack height.

MPF sensor

Detects the presence of media in the MPF tray.

Media present sensor

Detects the presence of media in the tray.

Tray present sensor

Detects the presence of the tray in the printer.

Bin full sensor

Detects whether the standard bin is full by moving the actuator up and down.

Toner density sensor

Detects a pre-placed toner patch and image on the photoconductor (drum) and outputs pulses when the central line of the patch image aligns with the central line of the detector. The sensor outputs pulses at the timing the patch image passes the sensor. Therefore, observing changes of intervals at which pulses are output leads to toner density detection.

Pass through sensor (option tray)

Detects when the media from the option tray passes. This will trigger the pick roller to pick the next media.

Capactive Toner Level Sensor (CTLS)

Detects the amount of toner in the imaging unit. If the toner level is low, the cartridge auger motor is triggered to add toner from the toner cartridge to the imaging unit.

Front door sensor

Is a safety switch that cuts off a 5 V DC supply from the controller board to the LSU to prevent the laser from activating when the front door is opened.

Other key components

Cooling fan

Discharges air from the printer to prevent excessive temperature increase.


Power supply

The power supply has two main sections: the HVPS and LVPS. The HVPS card assembly generates AC power and feeds it to the developer roll, the transfer roll assembly and the charge roll assembly. The LVPS card assembly generates low voltages: 5 V DC for logic circuits, 5 V DC for laser diodes and 24 V DC for cooling fans.


Controller board

Controls the printing operation based on the communication with the RIP controller and optional peripherals. It also controls the fuser, toner dispensing, sensor switch feedback, drive motors, clutches and solenoids

MS310/MS410 rollers

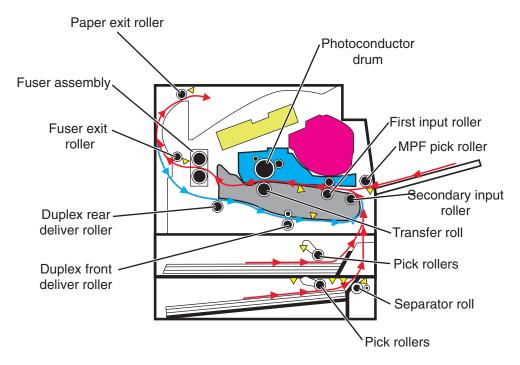

MS510/MS610 rollers

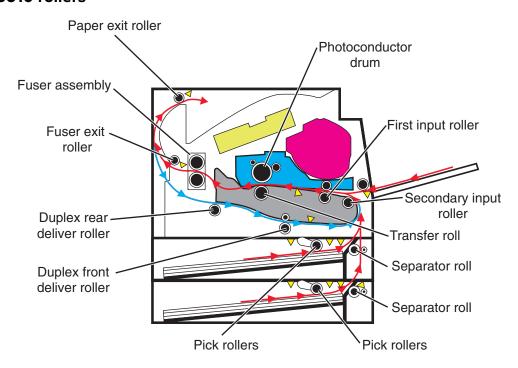

Electrophotographic process (EP process)

Printhead


The printhead scans the photo conductor drum surface with a laser beam. It consists of the following components:

- Laser diode (LD) card assembly
- Oscillator
- Start of scan card assembly

When a laser beam is scanned across the photoconductor drum surface from one end to the other while turning on and off the beam, one line of latent image is created. If the scanning by the laser beam is repeated while rotating the drum, a two-dimensional image is created. The resolution in the scanning direction (from right to left) is determined by the rotational speed of the printhead motor, depending on how quickly the laser is adjusted. The resolution in the process direction (from top to bottom) is determined by the rotational speed of the printhead motor. The higher the scanning speed becomes, the sooner the scanning of the next row can be started.


Step 1: Charge

During the charge step, voltage is sent from the HVPS to the charge roll beside the photoconductor. The charge roll applies a uniform negative charge over the entire surface of the photoconductor to prepare it for the laser beam.

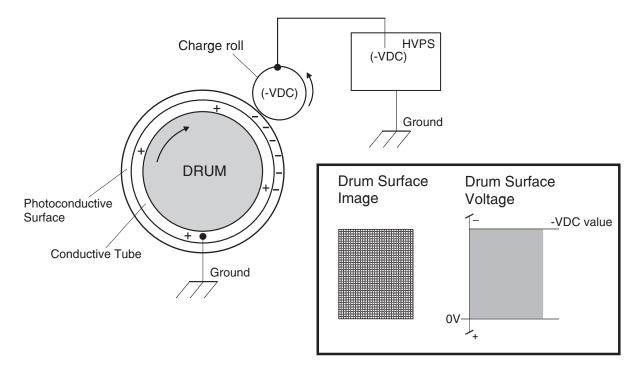

Step 2: Expose


The laser fires a focused beam of light at the surface of the photoconductor and writes an invisible image, called a latent image. The laser beam only discharges the surface where the beam hits the photoconductor. This creates a difference in charge potential between the exposed area and the rest of the photoconductor surface.

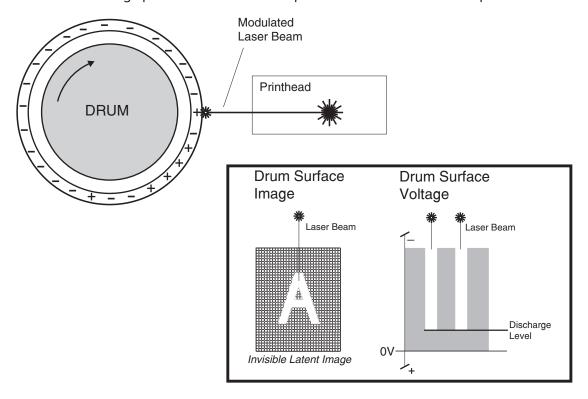

Step 3: Develop


Once the laser exposes the photoconductor, the HVPS sends charge to the developer roll. Because of the charge difference between the toner on the developer roller and the electrostatic image created by the laser, the toner is attracted to areas of the photoconductor surface exposed by the laser.

This process would be similar to using glue to write on a can and then rolling it over glitter. The glitter sticks to the glue but not to the rest of the can.

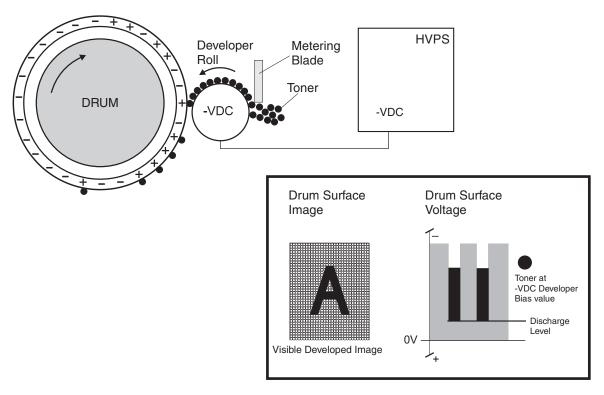

Step 4: Transfer


As the paper travels between the transfer roll and the photoconductor, the transfer roll applies a positive charge to the back of the media. This positive charge attracts the negatively charged toner image from the photoconductor to the top surface of the media.

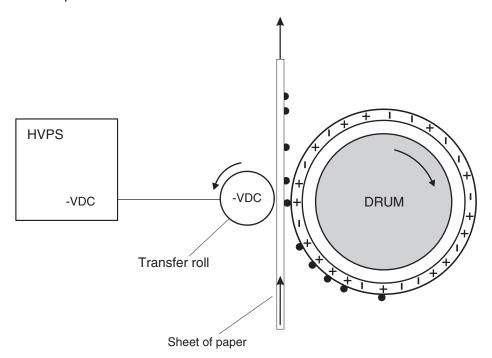

Theory of operation

Step 5: Clean

The cleaning blade removes any toner that remains on the photoconductor after the transfer process. The toner removed is collected inside the imaging unit.

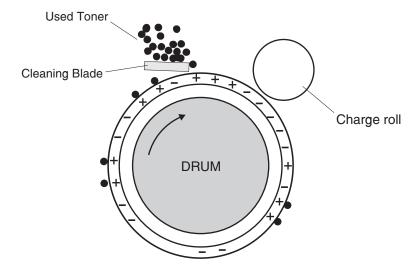

Acronyms

Acronyms

ASIC Application-Specific Integrated Circuit

BLDC Brushless DC Motor
BOR Black Only Retract

C Cyan

CCD Charge Coupled Device
CCP Carbonless Copy Paper
CRC Cyclic Redundancy Check

CSU Customer Setup

CTLS Capacitance Toner Level Sensing

DIMM Dual Inline Memory Module

DRAM Dynamic Random Access Memory

EDO Enhanced Data Out

EP Electrophotographic Process

EPROM Erasable Programmable Read-Only Memory

ESD Electrostatic Discharge
FRU Field Replaceable Unit

GB Gigabyte

HCF High-Capacity Feeder
HCIT High-Capacity Input Tray

HCOF High-Capacity Output Finisher
HVPS High Voltage Power Supply

ITU Image Transfer Unit

K Black

LCD Liquid Crystal Display

LDAP Lightweight Directory Access Protocol

LED Light-Emitting Diode

LVPS Low Voltage Power Supply

M Magenta
MB Megabyte

MFP Multi-Function Printer
MPF Multipurpose Feeder

MROM Masked Read Only Memory

MS Microswitch

NVM Nonvolatile Memory

NVRAM Nonvolatile Random Access Memory

OEM Original Equipment Manufacturer

OPT Optical Sensor

PC Photoconductor

pel, pixel Picture element

POR Power-On Reset

POST Power-On Self Test

PSD Position Sensing Device
PWM Pulse Width Modulation
RIP Raster Imaging Processor

ROM Read Only Memory

SDRAM Synchronous Dual Random Access Memory

SIMM Single Inline Memory Module
SRAM Static Random Access Memory

TPS Toner Patch Sensing
UPR Used Parts Return

V ac Volts alternating current

V dc Volts direct current

VTB Vacuum Transport Belt

Y Yellow

Index

Configuration change, some held jobs were not **Symbols** restored [57] 112 [x]-page jam, clear manual feeder. [25y.xx] 89 configuration menu [x]-page jam, clear standard bin. [20y.xx] 84 A5 loading 196 [x]-page jam, open front door. [20y.xx] 81 accessing 190 [x]-page jam, open rear door. [20y.xx] 84 action for prompts 194 [x]-page jam, open tray 1. [241.xx] 87 automatically display error screens 198 [x]-page jam, open tray [x]. [24y.xx] 88 clear supply usage history 197 [x]-page jam, remove tray 1 to clear duplex. clearing custom status 197 [23y.xx] 86 conserve energy 192 disk encryption 195 Α download emuls 192 ACM, theory 364 envelope prompts 193 acronyms 373 erase hard disk 199 available internal options 359 event log 191 avoiding jams 31 Factory Defaults 192 avoiding paper jams 79 font density 195 font sharpening 195 jobs on disk 194 key repeat initial delay 197 blank pages 43 key repeat rate 197 maintenance counter value 190 menu settings page 191 card stock panel menus 191 tips 32 paper prompts 193 Cartridge low [88.xy] 111 PPDS emulation 191 Cartridge nearly low [88.xy] 111 print quality pages 191 Cartridge very low, [x] estimated pages remain reduced curl 195 [88.xy] 111 require standby 196 Cartridge, imaging unit mismatch [41.xy] 111 reset maintenance counter 190 Change [paper source] to [custom string] load restore settings 198 [paper orientation] 112 safe mode 192 Change [paper source] to [custom type name] load UI automation 196 [orientation] 111 USB pnp 198 Change [paper source] to [paper size] load USB speed 197 [orientation] 112 wipe all settings 195, 199 Change [paper source] to [paper type] [paper size] control panel load [orientation] 112 controller board, removing with 0 change history 21 using 173 cleaning control panel, printer exterior of the printer 328 indicator light 174 printhead lenses 328 Sleep button light 174 cleaning the printer 328 controller board clipped pages or images 72 control panel, removing with 0 Close front door 112 controller board, restoring configuration 203 Complex page, some data may not have printed [39] 112

Index

compressed images appear on prints 74

D

data security notice 36, 201

Defective flash detected [51] 113	top margin 180
device tests	
disk test/clean 184	E
flash test 184	electrical specifications 355
quick disk 184	electrophotographic process, theory 368
diagnostics	electrostatic-sensitive parts 202
registration 176	embedded solutions 208
diagnostics menu	energy
accessing 176	conserving 192
automatic darkness adjustment 188	envelopes
base sensor test 183	tips on using 33
button test 178	environment specifications 357
charge roll voltage 187	EP process, theory 368
clear event log 189	EP setup
defaults 185	automatic darkness adjustment 188
disk test/clean 184	charge roll voltage 187
display event log 189	EP defaults 186
DRAM test 179	fuser temperature 187
duplex feed 1 test 181	gap adjust 188
duplex left margin 180	print contrast 187
duplex quick test 179	transfer adjust 187
duplex sensor test 181	•
duplex top margin 180	error codes 0-99.99 123
edge to edge 186	
engine settings 186	111 error messages 133
EP defaults 186	121 error messages 137
exit diagnostics 190	126 error messages 139
flash test 184	132 error messages 140
fuser temperature 187	133 error messages 141
gap adjust 188	140 error messages 142
input tray feed test 181	146 error messages 143
input tray sensor tests 182	155 error messages 143
menu settings page 188	171 error messages 145
output bin feed tests 182	200 paper jam messages 90
output bin sensor test 183	201 paper jam messages 95
panel test 178	202 paper jam messages 96
parallel strobe adjustment 186	23y.xx paper jam messages 98
permanent page count 186	241 paper jam messages 99
print contrast 187	242 paper jam messages 103
print event log 189	243 aper jam messages 105
print quality pages 177	244 paper jam messages 106
print tests 177	25y.xx paper jam messages 109
printed page count 186	3yy error messages 161
processor ID 186	900 errror messages 148
quick disk 184	912 errror messages 153
transfer adjust 187	94y errror messages 153
USB HS test mode 179	950–958 error messages 153
duplex tests	959 errror messages 156
feed 1 test 181	96y errror messages 157
left margin 180	97y errror messages 158
quick test 179	98y errror messages 159
sensor test 181	99y errror messages 160
SCHOOL COL TOT	Error reading USB drive. Remove USB. 113

Error reading USB hub. Remove hub. 113 J ESD-sensitive parts 202 jams eSF solutions 208 accessing 80 event loa avoiding 79 print log 189 understanding messages 80 exterior of the printer jams, clearing cleaning 328 behind rear door 84 in duplex area 86 F in front door 81 fine lines are not printed correctly 71 in manual feeder 89 firmware card 359 in standard bin 84 folded or wrinkled paper 58 in tray 1 87 in tray [x] 88 Н L hardware tests button test 178 labels, paper DRAM test 179 tips on using 33 panel test 178 laser notices 13 USB HS test mode 179 Load [paper source] with [custom string] [paper horizontal bottom contact connector 213 orientation] 115 horizontal light bands 63 Load [paper source] with [custom type name] horizontal sliding contact connector 219 [paper orientation] 115 horizontal top contact connector 210 Load [paper source] with [paper size] [paper orientation] 115 Load [paper source] with [paper type] [paper size] [paper orientation] 116 Imaging unit low [84.xy] 113 Load manual feeder with [custom string] [paper Imaging unit nearly low [84.xy] 113 orientation] 116 Imaging unit very low, [x] estimated pages remain Load manual feeder with [custom type name] [84.xy] 113 [paper orientation] 116 incorrect margins on print 75 Load manual feeder with [paper size] [paper Incorrect paper size, open [paper source] [34] 114 orientation] 116 input tray tests Load manual feeder with [paper type] [paper size] feed tests 181 [paper orientation] 117 sensor tests 182 locations input tray, theory 361 exterior views 321, 323 Insert Tray [x] 114 low insertion force (LIF) connector 222 inspection guide 325 lubrication Insufficient memory for Flash Memory Defragment guidelines 327 operation [37] 114 Insufficient memory to collate job [37] 114 М Insufficient memory to support Resource Save feature [35] 114 main drive gearbox, theory 364 Insufficient memory, some Held Jobs were deleted maintenance counter 327 maintenance kit Insufficient memory, some held jobs will not be resetting the counter 327 restored [37] 115 Maintenance kit low [80.xy] 117 internal options 359 Maintenance kit nearly low [80.xy] 117 invalid code, fixing 199 Maintenance kit very low, [x] estimated pages invalid engine mode remain [80.xy] 117 accessing 199 memory card 359 Memory full [38] 117

Notework [x] software error [54] 118 network [x] software error [54] 118 network SE menu accessing 199 print is too dark 52 print is too light 54 print quality initial check 40 print quality initial check 40 print quality troubleshooting blank pages 43 clipped pages or images 72 compressed images appear on prints 74 fine lines are not printed correctly 71 folded or wrinkled pages 58 gray background on prints 41 horizontal light bands 63 incorrect margins on print 75 pager curl 56 print is too dark 52 print is too light 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 vertical dark streaks with print missing 66 vertical light bands 64 white streaks and voided areas 69 printer control panel indicator light 174 Printer had to restart. Last job may be incomplete. 19 printer messages paper manual feeder 89 in tayl [x] apge jam, clear standard bin 84 in manual feeder 89 in trayl [x] apge jam, pene tray 1 to clear duplex. [23,xxx] 88 paper support 35 load [netation] 112 Cartridge very low, [x] estimated pages remain load [orientation] 111 Cartridge very low, [x] estimated pages remain load [orientation] 111	menus	where to load 35
Notework [x] software error [54] 118 network [x] software error [54] 118 network SE menu accessing 199 print is too dark 52 print is too light 54 print quality initial check 40 print quality initial check 40 print quality troubleshooting blank pages 43 clipped pages or images 72 compressed images appear on prints 74 fine lines are not printed correctly 71 folded or wrinkled pages 58 gray background on prints 41 horizontal light bands 63 incorrect margins on print 75 pager curl 56 print is too dark 52 print is too light 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 vertical dark streaks with print missing 66 vertical light bands 64 white streaks and voided areas 69 printer control panel indicator light 174 Printer had to restart. Last job may be incomplete. 19 printer messages paper manual feeder 89 in tayl [x] apge jam, clear standard bin 84 in manual feeder 89 in trayl [x] apge jam, pene tray 1 to clear duplex. [23,xxx] 88 paper support 35 load [netation] 112 Cartridge very low, [x] estimated pages remain load [orientation] 111 Cartridge very low, [x] estimated pages remain load [orientation] 111	list of 175	parts catalog legend 330
Network [x] software error [54] 118 network SE menu accessing 199	MPF, theory 362	POR sequence 39
Network [x] software error [54] 118 network SE menu accessing 199 Non-Lexmark [supply type], see User's Guide [33 xy] 118 Not enough free space in flash memory for resources [52] 118 notices 355 O O O O G G G G G G G G G		power-on reset sequence 39
print quality accessing 199 Non-Lexmark [supply type], see User's Guide [33.xy] 18 Not enough free space in flash memory for resources [52] 118 notices 355 O options firmware cards 359 media handling options 359 memory cards 359 output bin tests feed tests 182 sensor test 183 P paper characteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams avoiding 79 paper jams avoiding 79 paper jams avoiding 79 paper manual feeder 89 in tray 1 87 apper dure duplex support 35 prints to clark 40 print quality initial check 40 print quality troubleshooting blank pages 43 clipped pages or images 72 compressed images appear on prints 74 fine lines are not printed correctly 71 folded or wrinkled paper 58 gray background on prints 41 horizontal light bands 63 incorrect margins on print 75 paper curl 56 print is too light 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark branks 65 vertical dark streaks with print missing 66 vertical light bands 64 white streaks and voided areas 69 printer control panel indicator light 174 Sleep button light 174 Sleep page jam, clear manual feeder, [25y.xx] 89 [x]-page jam, open front door, [20y.xx] 84 [x]-page jam, open front door, [20y.xx] 84 [x]-page jam, open front door, [20y.xx] 81 [x]-page jam, open front do	N	print is too dark 52
network SE menu accessing 199 Non-Lexmark [supply type], see User's Guide [33.xy] 118 Not enough free space in flash memory for resources [52] 118 notices 355 O O Options firmware cards 359 media handling options 359 media handling options 359 memory cards 359 output bin tests feed tests 182 sensor test 183 P P P P P P P P P P P P P	Network [x] software error [54] 118	print is too light 54
accessing 199 Non-Lexmark (supply type), see User's Guide (33.xy) 118 Not enough free space in flash memory for resources [52] 118 notices 355 O options firmware cards 359 media handling options 359 media handling options 359 media handling options 359 media handling options 359 output bin tests feed tests 182 sensor test 183 P paper characteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper curd 56 paper jams avoiding 79 paper gamper gamper sages paper jams avoiding 79 paper gamper, sclearing behind rear door 84 in front door 81 in tray 1 87 in tang las 88 paper sures duplex support 35 infitial check 40 print quality troubleshooting blank pages 43 clipped pages or images 72 compressed images appear on prints 74 fine lines are not printed correctly 71 folded or wrinkled paper 58 gray background on prints 41 horizontal light bands 63 incorrect margins on print 75 paper curd 56 print is too dark 52 print is too light 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark streaks with print missing 66 vertical light bands 65 vertical dark streaks with print missing 66 vertical light bands 64 white streaks and voided areas 69 printer control panel indicator light 174 Sleep button light 174 Sleep button light 174 Sleep button light 174 Sleep button light 274 Sleep button light 174 Sleep button light 274 Sleep button light 174 Sleep page jam, open rear door, [20y.xx] 84 [x]-page jam, open front door, [20y.xx] 84 [x]-page jam, open tray 1, [241.xx] 87 [x]-page jam, open tray 1, [2		print quality
Non-Lexmark (supply type), see User's Guide [33.xy] 118 Not enough free space in flash memory for resources [52] 118 notices 355 O O O O O O O O O O O O		initial check 40
Saxy 118 Slank pages 43 Clipped pages or images 72 Compressed images appear on prints 74 fine lines are not printed correctly 71 folded or wrinkled paper 58 gray background on prints 41 horizontal light bands 63 incorrect margins on print 75 paper curl 56 print is too dark 52 print is too dark 52 print is too light 54 repeating defects 59 skewed print 60		print quality troubleshooting
Not enough free space in flash memory for resources [52] 118 notices 355 compressed images appear on prints 74 fine lines are not printed correctly 71 folded or wrinkled paper 58 gray background on prints 41 horizontal light bands 63 incorrect margins on print 75 paper curl 56 print is too dark 52 print is too dark 52 print is too dark 52 print is too light 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 77 vertical dark bands 65 vertical dark bands 65 vertical dark bands 65 vertical dark streaks with print missing 66 vertical dark streaks with print missing 66 vertical dark streaks and voided areas 69 printer control panel indicator light 174 sleep button light 174 sleep button light 174 paper jams avoiding 79 paper jams, clearing behind rear door 84 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [1 88 paper messages supported by the printer 34 paper duplex support 35 load forientation] ffl.		blank pages 43
resources [52] 118 notices 355 O O options firmware cards 359 media handling options 359 media handling options 359 media handling options 359 media handling options 359 memory cards 359 output bin tests feed tests 182 sensor test 183 P paper theracteristics 29 letterhead 31 preprinted forms 31 prep		clipped pages or images 72
notices 355 O O options firmware cards 359 media handling options 359 metia handling options 359 output bin tests feed tests 182 sensor test 183 P p p toharacteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams avoiding 79 paper jams avoiding 79 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in tray 1 87 in standard bin 84 in tray 1 87 in tray 1 87 in tray 1 87 in paper lange fundament (X)-page jam, penen tray 1 to clear duplex. (X)-page jam, memove tray 1 to clear duplex. (X)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penen tray (x), (x) estimated pages remain (x)-page jam, penentray (x), (x) estimated pages rem		compressed images appear on prints 74
on the potential of the prints of the properties of the prints of the		fine lines are not printed correctly 71
poptions firmware cards 359 media handling options 359 memory cards 359 memory 56 pint is too dark 52 print is too dark 65 vertical light bads 65 vertical light		
options firmware cards 359 media handling options 359 media handling options 359 memory cards 359 output bin tests feed tests 182 sensor test 183 P apper characteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in tray 1 87 in standard bin 84 in tray 1 87 in tray 1 88 paper messages (X)-page jam, remove tray 1 to clear duplex. (23y.xx) 86 cartridge, imaging unit mismatch [41.xy] 111 change [paper source] to [custom type name] duplex support 35 lincorrect margins on print 75 paper curl 56 print is too dark 52 print is too dark 52 print is too dight 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark streaks with print missing 66 vertical light bands 65 vertical dark streaks with print missing 66 vertical dark streaks with print in 172 toner ubs of 76 toner specks appear on prints 77 vertical dark streaks with prints 62 toner ubs of 65 vertical dark streaks with prints 62 toner ubs of 65 vertical dark streaks with prints 77 vertical dark streaks with prints 62 toner ubs of 65 vertical dark streaks with prints 62	0	
firmware cards 359 media handling options 359 memory cards 359 output bin tests feed tests 182 sensor test 183 P toner rubs off 76 paper characteristics 29 tetterhead 31 preprinted forms 31 recycled 32 selecting 31 unacceptable 30 paper curl 56 paper gims and violed areas 69 printer robs off 76 paper lindicator light 174 sleep button light		_
media handling options 359 memory cards 359 output bin tests feed tests 182 sensor test 183 P paper characteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper lams selection 112 cupted to dark 52 print is too light 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 vertical dark streaks with print missing 66 vertical light bands 64 vertical light bands 64 vertical light bands 65 vertical dark streaks with print missing 66 vertical light toans 69 printer control panel indicator light 174 Sleep button light 174 Printer had to restart. Last job may be incomplete. 119 printer messages [x]-page jam, clear manual feeder. [25y.xx] 89 [x]-page jam, clear manual feeder. [25y.xx] 89 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open front door. [20y.x	•	· · · · · · · · · · · · · · · · · · ·
memory cards 359 output bin tests feed tests 182 sensor test 183 P toner rubs off 76 toner specks appear on prints 77 characteristics 29 letterhead 31 recycled 32 selecting 31 storing 31 varied forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper curl 56 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [24y.xx] 84 in tray 1 87 in tray [x] 88 paper messages (x]-page jam, remove tray 1 to clear duplex. (z3y,xx) 86 quipex support 35 load gorentation] 111 prints to o light 54 repeating 54 repeating 45 repeating 45 repeating 45 repeating defects 59 skewed print 60 solight 54 repeating defects 59 skewed print 60 solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 vertical dark streaks with print missing 66 vertical dark streaks with print missing 66 vertical dark streaks with print missing 66 vertical dark bands 65 vertical dark streaks with print missing 66 vertical dark bands bin 52 vertical dark bands bin 84 indicator light 174 sleep button light 174 printer had to restart. Last job may be indicator light 174 printer had to restart. Last job may be indicator light 174 printer had to restart. Last job may be indicator light 174 printer had to restart. Last job may be indicator light 174 printer had to restart. Last job may be indicator light 174 sleep button light 174 printer outrol panel indicator light 174 sleep button light 174 printer outrol panel indicator light 174 sleep button lig		• •
output bin tests feed tests 182 sensor test 183 P streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 letterhead 31 recycled 32 selecting 31 storing 31 vertical light bands 64 vertical light 174 unacceptable 30 solid black pages 49 streaked vertical lines appear on prints 77 vertical dark bands 65 vertical dark streaks with print missing 66 vertical light bands 64 white streaks and voided areas 69 printer control panel indicator light 174 sleep button light 174 Printer had to restart. Last job may be incomplete. 119 printer messages paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray 1. [241.xx] 87 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35		print is too dark 52
feed tests 182 sensor test 183 P paper characteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper curl 56 paper gams avoiding 79 paper jams avoiding 79 paper jams, clearing in front door 84 in duplex area 86 in tray 1 87 in tray 1 87 paper messages (x]-page jam, pemove tray 1 to clear duplex. (23y.xx) 86 paper sizes under the selection and process of the selection of the process of th		•
sensor test 183 p solid black pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 letterhead 31 preprinted forms 31 preprinted forms 31 printer control panel storing 31 printer had to restart. Last job may be incomplete. 119 printer messages [X]-page jam, clear manual feeder. [25y.xx] 89 behind rear door 84 paper jams, clearing printer messages [X]-page jam, clear standard bin. [20y.xx] 84 in duplex area 86 printer door 81 printer messages [X]-page jam, open front door. [20y.xx] 84 in manual feeder 89 printer messages [X]-page jam, open front door. [20y.xx] 84 print 38 paper messages [X]-page jam, open tray 1. [241.xx] 87 printer messages [X]-page jam, open tray [X]. [24y.xx] 88 print 34 print 34 print 34 print 34 print 34 print 37 printer control dor. [X]-page jam, open tray [X]. [24y.xx] 88 print 34 print 34 print 34 print 35 printer cutical lines appear on prints 77 vertical dark bands 65 priction definition in 111 printer psecks appear on prints 77 printer nads bands 65 printer control panel printer control panel printer alax bands 64 printer alax bands 65 printer control panel printer control panel printer control panel printer control panel printer alax bands 65 printer alax bands 64 printer alax bands 64 print abands 64 print abands 64 print abands 65 priction date bands 65 print alax bands 64 print abands 65 print abands 65 print abands 65 print abands 65 print abands 64 print abands 65 print abands 65 print abands 65 print abands 64 print abands 64 print abands 64 print abands 64 print abands 6	•	
stolled black, pages 49 streaked vertical lines appear on prints 62 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 paper sizes [X]-page jam, open tray 1. [241.xx] 87 in standard bin 84 in tray 1 87 paper sizes [X]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes duplex support 35 storiag 76 toner rubs off 76 toner specks appear on prints 77 vertical dark bands 65 vertical dark band		·
paper characteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams, clearing behind rear door 84 in front door 81 in front door 81 in front door 81 in tray 1 87 in standard bin 84 in tray 1 87 in tray [X] 88 paper messages [X]-page jam, open tray [X]. [241,xx] 87 in standard bin 84 in tray 1 87 paper jams [X]-page jam, open tray [X]. [249,xx] 88 cartridge low [88.xy] 111 Cartridge every low, [X] estimated pages remain [X]-page jam, remove tray 1 to clear duplex. [23y,xx] 86 paper sizes duplex support 35 toner specks appear on prints 77 vertical dark bands 65 toner specks appear on prints 77 vertical dark bands 65 vertical dark bands 65 vertical dark bands 65 vertical dark bands 64 vertical dark bands 64 white streaks and voided areas 69 printer control panel indicator light 174 Sleep button light 174 Sleep button light 174 Printer had to restart. Last job may be incomplete. 119 printer messages [X]-page jam, clear standard bin. [20y.xx] 89 [X]-page jam, clear standard bin. [20y.xx] 84 [X]-page jam, open front door. [20y.xx] 84 [X]-page jam, open tray [X]. [24y.xx] 87 [X]-page jam, open tray [X]. [24y.xx] 88 Cartridge low [88.xy] 111 Cartridge very low, [X] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 paper types duplex support 35	Selisor test 103	·
toner specks appear on prints 77 characteristics 29 letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in standard bin 84 in tray 1 87 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 preprinted forms 31 pretical dark streaks with print missing 66 vertical dark streaks and voided vertical light 16 vertical dark streaks with print missing 66 vertical light 16 vertical light 16 vertical light 16 vertical dark streaks and voided areas 69 selecting 31 storing 172 selecting 16 vertical light 174 white streaks and voided areas 69 vertical light 174 white streaks and voided areas 69 printer control panel indicator light 174 white streaks and voided areas 69 printer control panel indicator light 174 paper bane displayed and paper season 69 printer control light 174 printer nessages print	В	
characteristics 29 letterhead 31 vertical dark streaks with print missing 66 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper curl 56 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in standard bin 84 in tray 1 87 in tray 1 87 in tray 1 87 paper messages (x]-page jam, clear duplex. (z]-yays jam, remove tray 1 to clear duplex. (z]-yays duplex support 35 vertical dark streaks with print missing 66 vertical light bands 64 vertical light bands 64 vertical light bands 64 vertical dark streaks with print missing 66 vertical dark streaks with print missing 66 vertical ldark streaks with print missing 66 vertical light bands 64 white streaks with print missing 66 vertical ldark streaks with print missing 66 vertical light bands 64 white streaks with print missing 66 vertical light bands 64 vertical light bands 64 vertical light bands 64 vertical light bands 64 white streaks with print rissing 66 vertical light bands 64 vertical light and vertical light series 69 selecting 174 series 49 printer control panel indicator light 174 shift streaks and voide areas 69 printer control panel indicator light 174 shift streaks and voide areas 69 printer control panel indicator light 174 shift streaks and voide areas 69 printer control panel indicator light 174 shift streaks and voide areas 69 printer control panel indicator light 174 shifted panel 69 printer control panel indicator light 174 paper streaks and voide areas 69 printer control panel indicator light 174 paper streaks and voide areas for indicator light 174 paper streaks and voide areas for indicator light 17	P	
letterhead 31 preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 paper jams avoiding 79 paper jams, clearing behind rear door 84 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-yage jam, open tray [x]. [241,xx] 88 in tray 1 87 in tray [x] 88 paper messages [x]-yage jam, open tray [x]. [249,xx] 88 in tray 1 87 in tray [x] 88 paper messages [x]-yage jam, open front door [x] (x]-yage jam, open tray [x]. [241,xx] 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [241,xx] 88 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [241,xx] 88 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [241,xx] 88 Cartridge low [88,xy] 111 Cartridge nearly low [88,xy] 111 Cartridge very low, [x] estimated pages remain [88,xy] 311 Cartridge, imaging unit mismatch [41,xy] 111 paper sizes supported by the printer 34 paper types duplex support 35 load [orientation] 111	paper	
preprinted forms 31 recycled 32 selecting 31 storing 31 unacceptable 30 printer control panel indicator light 174 paper curl 56 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [241.xx] 87 in tray [x] 88 paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 supported by the printer 34 duplex support 35 vertical light bands 64 white streaks and voided areas 69 printer control panel indicator light 174 Sleep button light 174 Printer had to restart. Last job may be incomplete. 119 printer messages [x]-page jam, clear manual feeder. [25y.xx] 89 [x]-page jam, clear standard bin. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open rear door. [20y.xx] 84 [x]-page jam, open tray 1. [241.xx] 87 [x]-page jam, open tray [x]. [24y.xx] 88 [x]-page jam, open tray [x]. [24y.xx] 81 [x]-page jam, open tray [x]. [x]-page jam, open tray [x]-page jam,		
recycled 32 selecting 31 storing 31 unacceptable 30 selecting 31 svoiding 79 seper jams soleding rear door 84 in duplex area 86 in front door 81 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [241.xx] 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [241.xx] 88 paper messages [x]-page jam, open tray [x]. [241.xx] 87 Cartridge low [88.xy] 111 [23y.xx] 86 Cartridge very low, [x] estimated pages remain [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 Supported by the printer 34 duplex support 35 white streaks and voided areas 69 printer control panel indicator light 174 Sleep button light 16 Figure restar. Last job may be incomplete incom		
selecting 31 storing 31 unacceptable 30 printer control panel indicator light 174 Sleep button light 174 paper curl 56 paper jams avoiding 79 paper jams, clearing pehind rear door 84 in duplex area 86 in front door 81 in standard bin 84 in tray 1 87 in tray [x] 88 in tray 1 87 paper messages [x]-page jam, open tray [x]. [24y.xx] 88 in tray 1 87 paper messages [x]-page jam, open tray [x]. [24y.xx] 88 Cartridge low [88.xy] 111 paper messages [x]-page jam, open tray [x]. [24y.xx] 88 in tray 1 87 cartridge nearly low [88.xy] 111 paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 Cartridge, imaging unit mismatch [41.xy] 111 paper types duplex support 35 Change [paper source] to [custom type name] duplex support 35 Cartidge igaper source] to [custom type name] load [orientation] 111	·	<u>-</u>
storing 31 unacceptable 30 sleep button light 174 paper curl 56 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, clear standard bin. [20y.xx] 84 in tray 1 87 parper messages [x]-page jam, open front door. [20y.xx] 84 in tray 1 87 cartridge low [88.xy] 111 paper messages [x]-page jam, open tray 1, [241.xx] 87 Cartridge very low, [x] estimated pages remain [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes change [paper source] to [custom string] load guplex support 35 load [orientation] 111		
unacceptable 30 paper curl 56 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [24y.xx] 88 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [24y.xx] 88 Cartridge low [88.xy] 111 Cartridge very low, [x] estimated pages remain [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 Sleep button light 174 Printer had to restart. Last job may be incomplete. 119 printer messages [x]-page jam, clear manual feeder. [25y.xx] 89 [x]-page jam, clear standard bin. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open rear door. [20y.xx] 84 [x]-page jam, open tray 1. [241.xx] 87 [x]-page jam, open tray [x]. [24y.xx] 88 Cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 paper sizes supported by the printer 34 paper types duplex support 35 Change [paper source] to [custom type name] load [orientation] 111	<u> </u>	·
paper curl 56 paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [241.xx] 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [244.xx] 88 in tray 1 87 cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35 Printer had to restart. Last job may be incomplete. 119 printer messages [x]-page jam, clear manual feeder. [25y.xx] 89 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open tray 1. [241.xx] 87 [x]-page jam, open tray [x]. [24y.xx] 88 [x]-page jam, open tray [x]. [24y.xx] 81 [x]-page jam, open tray [x]. [24y.xx] 87 [x]-page jam, open tray [x]. [24y.xx] 81 [x]-page jam, open tray [x]. [24y.xx] 84 [x]-page jam, open tray [x]. [24y.xx] 81 [x]-page jam, open tray [x]. [24y.xx] 81 [x]-page jam, open tray [x]. [24y.xx] 88 [x]-page jam, open tray [x]. [24y.xx] 81 [x]-page j	-	<u> </u>
paper jams avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 paper messages paper messages paper messages per jams, clear in manual feeder [25y.xx] 89 in standard bin 84 in tray [x] 88 paper messages [x]-page jam, open front door. [20y.xx] 81 in front door 81 [x]-page jam, open tray 1. [241.xx] 87 in standard bin 84 in tray 1 87 Cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [8]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35 incomplete. 119 printer messages [x]-page jam, clear manual feeder. [25y.xx] 89 [x]-page jam, clear manual feeder. [25y.xx] 84 [x]-page jam, open front door. [20y.xx] 81 [x]-page jam, open tray 1. [241.xx] 87 Cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111	•	
avoiding 79 paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, clear standard bin. [20y.xx] 84 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open rear door. [20y.xx] 84 [x]-page jam, open tray 1. [241.xx] 87 [x]-page jam, open tray [x]. [24y.xx] 88 [x]-page jam, open tray 1. [24y.xx] 87 [x]-page jam, open tray 1. [20y.xx] 84 [x]-page jam, open tray 1. [20y.xx] 88 [x]-page jam, open tray 1. [20y.xx] 89		
paper jams, clearing behind rear door 84 in duplex area 86 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open front door. [20y.xx] 84 in tray 1 87 cartridge low [88.xy] 111 paper messages [x]-page jam, open tray 1. [24y.xx] 88 Cartridge low [88.xy] 111 Cartridge very low, [x] estimated pages remain [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35 [x]-page jam, clear manual feeder. [25y.xx] 89 [x]-page jam, open front door. [20y.xx] 84 [x]-page jam, open tray 1. [24y.xx] 87 [cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111		•
behind rear door 84 in duplex area 86 in front door 81 in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray 1. [241.xx] 87 cartridge nearly low [88.xy] 111 [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35 [x]-page jam, open tray 1. [24y.xx] 84 [x]-page jam, open tray 1. [241.xx] 87 [x]-page jam, open tray [x]. [24y.xx] 88 Cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111		
in duplex area 86		
in front door 81 in manual feeder 89 in standard bin 84 in tray 1 87 in tray 2 88 in tray 1 88 paper messages [x]-page jam, open tray 1. [241.xx] 88 in tray 2 88 Cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load supported by the printer 34 paper types duplex support 35 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom type name] load [orientation] 111		
in manual feeder 89 in standard bin 84 in tray 1 87 in tray 2 88 in tray 3 88 paper messages [x]-page jam, open tray 1. [241.xx] 88 Cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 Cartridge, imaging unit mismatch [41.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load supported by the printer 34 paper types duplex support 35 Change [paper source] to [custom type name] load [orientation] 111	•	
in standard bin 84 in tray 1 87 in tray [x] 88 paper messages [x]-page jam, open tray [x]. [24y.xx] 88 Cartridge low [88.xy] 111 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 paper sizes supported by the printer 34 paper types duplex support 35 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111		
in tray 1 87 in tray [x] 88 Cartridge low [88.xy] 111 paper messages Cartridge very low, [x] estimated pages remain [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge low [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge low [88.xy] 111 Cartridge low [88.xy] 111 Cartridge low [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge low [8.xy] 111 Cartridge low [88.xy] 111 Cartridge low [8.xy] 111 Ca		
in tray [x] 88 paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35 Cartridge nearly low [88.xy] 111 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111		
paper messages [x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35 Cartridge very low, [x] estimated pages remain [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111	•	
[x]-page jam, remove tray 1 to clear duplex. [23y.xx] 86 paper sizes supported by the printer 34 paper types duplex support 35 [88.xy] 111 Cartridge, imaging unit mismatch [41.xy] 111 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111		
[23y.xx] 86 Cartridge, imaging unit mismatch [41.xy] 111 paper sizes Change [paper source] to [custom string] load supported by the printer 34 [paper orientation] 112 paper types Change [paper source] to [custom type name] duplex support 35 load [orientation] 111		
paper sizes supported by the printer 34 paper types duplex support 35 Change [paper source] to [custom string] load [paper orientation] 112 Change [paper source] to [custom type name] load [orientation] 111		
supported by the printer 34[paper orientation] 112paper typesChange [paper source] to [custom type name]duplex support 35load [orientation] 111		
paper types Change [paper source] to [custom type name] duplex support 35 load [orientation] 111	·	
duplex support 35 load [orientation] 111	• • • • • • • • • • • • • • • • • • • •	- : •
	supported by printer 35	ioda [onomation] in

Change [paper source] to [paper size] load Not enough free space in flash memory for [orientation] 112 resources [52] 118 Change [paper source] to [paper type] [paper size] Printer had to restart. Last job may be load [orientation] 112 incomplete. 119 Close front door 112 Reinstall missing or unresponsive cartridge Complex page, some data may not have printed [31.xy] 119 [39] 112 Reinstall missing or unresponsive imaging unit Configuration change, some held jobs were not [31.xy] 119 Remove paper from standard output bin 119 restored [57] 112 Defective flash detected [51] 113 Replace cartridge, 0 estimated pages remain Error reading USB drive. Remove USB. 113 [88.xy] 119 Error reading USB hub. Remove hub. 113 Replace cartridge, printer region mismatch Imaging unit low [84.xy] 113 [42.xy] 119 Imaging unit nearly low [84.xy] 113 Replace imaging unit, 0 estimated pages remain Imaging unit very low, [x] estimated pages remain [84.xy] 120 [84.xy] 113 Replace maintenance kit, 0 estimated pages Incorrect paper size, open [paper source] [34] 114 remain [80.xy] 120 Insert Tray [x] 114 Replace unsupported cartridge [32.xy] 120 Insufficient memory for Flash Memory Defragment Replace unsupported imaging unit [32.xy] 120 operation [37] 114 Serial option [x] error [54] 121 Insufficient memory to collate job [37] 114 SMTP server not set up. Contact system Insufficient memory to support Resource Save administrator. 121, 122 feature [35] 114 Standard network software error [54] 121 Insufficient memory, some Held Jobs were Standard parallel port disabled [56] 121 deleted [37] 114 Standard USB port disabled [56] 121 Insufficient memory, some held jobs will not be Too many flash options installed [58] 122 restored [37] 115 Too many trays attached [58] 122 Load [paper source] with [custom string] [paper Unformatted flash detected [53] 122 Unsupported option in slot [x] [55] 122 orientation] 115 Load [paper source] with [custom type name] Unsupported USB hub, please remove 113 [paper orientation] 115 printer setup Load [paper source] with [paper size] [paper defaults 185 edge to edge 186 orientation] 115 Load [paper source] with [paper type] [paper size] parallel strobe adjustment 186 [paper orientation] 116 permanent page count 186 Load manual feeder with [custom string] [paper printed page count 186 orientation] 116 printhead lenses Load manual feeder with [custom type name] cleaning 328 [paper orientation] 116 Load manual feeder with [paper size] [paper R orientation] 116 recovery mode Load manual feeder with [paper type] [paper size] accessing 199 [paper orientation] 117 recycled paper Maintenance kit low [80.xy] 117 using 32 Maintenance kit nearly low [80.xy] 117 registration 176 Maintenance kit very low, [x] estimated pages Reinstall missing or unresponsive cartridge remain [80.xy] 117 [31.xy] 119 Memory full [38] 117 Reinstall missing or unresponsive imaging unit Network [x] software error [54] 118 [31.xy] 119 Non-Lexmark [supply type], see User's Guide removal procedures [33.xy] 118 tips 226

removals	separator pad 285
ACM assembly 301	separator roll assembly 316
ACM assembly, option tray 318	speaker 273
bail 278	toner cartridge smart chip contact 249
bezel 259	toner density sensor 293
cartridge gearbox 236	top cover 312
cartridge plunger 256	trailing edge sensor 297
control panel removal 263	transfer roll 255
control panel USB port (MS610de) 273	tray present sensor 240
control panel USB port (MS610dn) 272	UICC 269
controller board 245	Remove paper from standard output bin 119
controller board shield 245	Replace cartridge, 0 estimated pages remain
cooling fan 241	[88.xy] 119
cooling fan duct 241	Replace cartridge, printer region mismatch
cooling fan mount 243	[42.xy] 119
duplex 289	Replace imaging unit, 0 estimated pages remain
duplex gear assembly 237	[84.xy] 120
duplex sensor and input sensor 290	Replace maintenance kit, 0 estimated pages
dust cover 305	remain [80.xy] 120
front access cover 282	Replace unsupported cartridge [32.xy] 120
front access sensor 282	Replace unsupported imaging unit [32.xy] 120
front door 279	reports
front input guide 283	event log 191
fuser 311	menu settings page 191
index sensor 293	
	restoring
jam access cover 278	configuration file 206 license file 206
laser scanning unit 313	license lile 206
left cover 226	6
left front mount 251	S
main drive gearbox 227	safety information 16
media present sensor 295	scheduled maintenance 326
media present sensor flag 297	security reset jumper
MPF assembly 274	enabling 357
MPF gearbox 232	selecting paper 31
MPF pick tire 277	Serial option [x] error [54] 121
MPF pick tire cover 277	service checks troubleshooting
MPF selson 283	network service check 170
MPF solenoid 229	service engineer (SE) menu 200
nameplate removal 261	accessing 200
narrow media/bin full sensor 306	service manual conventions 0
pick roller 315	SMTP server not set up. Contact system
pick/lift motor gearbox 303	administrator. 121, 122
power supply 287	solid black pages 49
power supply shield 288	specifications
rear cover 305	acoustics 356
rear door 305	electrical 355
redrive assembly 308	environment 357
redrive shaft 309	operating clearances 356
reverse solenoid 235	Standard network software error [54] 121
right cover 239	Standard parallel port disabled [56] 121
right cover (MS610de) 239	Standard USB port disabled [56] 121
right front mount 253	, , ,

storing paper 31 streaked vertical lines appear on prints 62 supported paper sizes 34 supported paper types and weights 35 symptoms printer 165
Т
theory of operation
ACM 364
duplex printing 363 electrophotographic process 368
input tray 361
main drive gearbox 364
MPF 362
other key components 366
POR sequence 361
printer control 361 sensors 365
simplex printing 362
tips
card stock 32
on using envelopes 33
on using labels 33
transparencies 34
tips on using envelopes 33 toner rubs off 76
toner specks appear on prints 77
Too many flash options installed [58] 122
Too many trays attached [58] 122
tools, required 37
transparencies
tips 34
troubleshooting initial check 39
troubleshooting, print quality
blank pages 43
clipped pages or images 72
compressed images appear on prints 74
fine lines are not printed correctly 71
folded or wrinkled paper 58
gray background on prints 41
horizontal light bands 63 incorrect margins on print 75
paper curl 56
print is too dark 52
print is too light 54
repeating defects 59
skewed print 60
solid black pages 49 streaked vertical lines appear on prints 62
su carca vertical illies appeal off prints 02

toner rubs off 76
toner specks appear on prints 77
vertical dark bands 65
vertical dark streaks with print missing 66
vertical light bands 64
white streaks and voided areas 69
troubleshooting, service checks
network service check 170

U

unacceptable paper 30
Unformatted flash detected [53] 122
Unsupported option in slot [x] [55] 122
Unsupported USB hub, please remove 113
updating the printer firmware
using a flash drive 207
using a network computer 207

V

vertical dark bands 65 vertical dark streaks with print missing 66 vertical mount contact connector 216

W

white streaks and voided areas 69

Z

zero insertion force (ZIF) connectors 209

Part number index

P/N	Part name	Page
40X0269	Power cord, 2.5 m (straight)—USA, Canada	351
40X0270	Power cord, 2.5 m (straight)—Japan	351
40X0271	Power cord, 2.5 m (straight)—United Kingdom	351
40X0273	Power cord, 2.5 m (straight)—Traditional Italy	351
40X0275	Power cord, 2.5 m (straight)—Israel	351
40X0288	Power cord, 2.5 m (straight)—Argentina	351
40X0289	Power cord, 1.8 m (straight)—USA	351
40X0301	Power cord, 2.5 m (straight)—Australia	351
40X0303	Power cord, 2.5 m (straight)—China	351
40X0387	Interface device, USB-A	353
40X1368	USB cable, packaged (2 m)	354
40X1772	Power cord, 2.5 m (straight)—Switzerland	351
40X1773	Power cord, 2.5 m (straight)—South Africa	351
40X1774	Power cord, 2.5 m (straight)—Denmark	351
40X1791	Power cord, 2.5 m (straight)—Taiwan	351
40X1792	Power cord, 2.5 m (straight)—Korea	351
40X3141	Power cord, 2.5 m (straight)—Europe and others	351
40X4596	Power cord, 2.5 m (straight)—Brazil	351
40X4819	Adapter, RS232C serial	353
40X4823	Adapter, Parallel 1284-B	353
40X4826	Adapter, N8120 GB INA	353
40X4827	Adapter, N8130 10/100 Fiber	353
40X5315	Screw, Ship with ISP (2)	353
40X5316	Cable, 14 pin JST for ISP	353
40X5317	Standoff, Tee with thumbscrew	353
40X7445	2GB DDR3 RAM	353
40X7567	1GB DDR3 RAM	353
40X7592	Media present sensor	340
40X7592	Tray present sensor	337
40X7797	Power supply, 100 V/110 V	340
40X7798	Power supply, 220 V	340
40X7856	160GB hard disk (MS610de and M3150)	354

P/N	Part name	Page
40X8023	Fuser, 110 V	336
40X8024	Fuser, 220 V	336
40X8029	Controller board* (applicable only to models MS510dn, MS517dn and M1145 with galvo LSU)	336
40X8030	Controller board* (applicable only to models MS610dn, MS617dn and M3150dn with galvo LSU)	336
40X8043	Duplex sensor and input sensor	340
40X8044	Index sensor	340
40X8045	Trailing edge sensor	340
40X8046	Toner density sensor	340
40X8048	Front door sensor	340
40X8050	Narrow media/bin full sensor	336
40X8051	Nameplate (MS510dn, MS517dn and M1145)	333
40X8052	Right cover (MS510dn, MS517dn and M1145)	332
40X8053	Left cover (MS510dn, MS517dn and M1145)	333
40X8054	Rear door and cover (MS510dn, MS517dn and M1145)	332
40X8055	Top cover (MS510dn, MS517dn and M1145)	333
40X8056	Front access cover (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	332
40X8066	Bezel (MS510dn and M1145)	333
40X8067	Bezel (MS610dn and M3150dn)	333
40X8068	Bezel (MS610de and M3150)	333
40X8079	Galvo LSU* (MS610dn, MS617dn, MS610de, M3150dn, and M3150)	336
40X8080	Galvo LSU* (MS510dn, MS517dn and M1145)	336
40X8083	Cartridge gearbox	343
40X8084	Pick/Lift motor gearbox	343
40X8085	Main drive gearbox	343
40X8086	550-sheet tray	332
40X8087	Right cover (MS610dn, MS617dn and M3150dn)	332
40X8262	ACM assembly (option tray only)	346
40X8266	Cartridge smart chip contact	340
40X8268	Front access cover (MS610de and M3150)	332
40X8269	Left cover (MS610dn, MS617dn, MS610de, M3150dn, and M3150)	333
40X8270	Rear door and cover (MS610dn, MS617dn and M3150dn)	332
40X8271	Top cover (MS610dn, MS617dn, MS610de, M3150dn, and M3150)	333
40X8272	Nameplate (MS610de and M3150)	333

P/N	Part name	Page
40X8273	Rubber foot	333
40X8275	Duplex assembly	343
40X8276	Cooling fan (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	336
40X8277	Duplex gear assembly	343
40X8279	Jam access cover	343
40X8280	Front input guide	337
40X8281	Maintenance kit, 110 V (MS510dn, MS517dn and M1145)	347
40X8282	Maintenance kit, 220 V (MS510dn, MS517dn and M1145)	347
40X8284	Control panel assembly (MS610dn, MS617dn and M3150dn)	337
40X8285	Control panel assembly (MS610de and M3150)	337
40X8286	550-sheet tray	346
40X8287	250-sheet tray	346
40X8292	Control panel assembly (MS510dn, MS517dn and M1145)	337
40X8295	MPF pick roller and separator pad	343
40X8298	Redrive assembly (MS510dn, MS517dn and M1145)	343
40X8299	Front mounts	343
40X8300	MPF solenoid	337
40X8301	Reverse solenoid	337
40X8305	250-sheet tray insert	332
40X8343	Fuser, 100 V	336
40X8388	Controller board* (applicable only to models MS610de and M3150 with galvo LSU)	337
40X8393	Transfer roll	343
40X8394	Screw kit	344
40X8433	Maintenance kit, 110 V (MS610dn, MS617dn and M3150dn)	348
40X8434	Maintenance kit, 110 V (MS610de and M3150)	348
40X8435	Maintenance kit, 220 V (MS610dn, MS617dn and M3150dn)	348
40X8436	Maintenance kit, 220 V (MS610de and M3150)	349
40X8437	Redrive assembly (MS610dn, MS617dn and M3150dn)	343
40X8438	Redrive assembly (MS610de and M3150)	343
40X8439	Maintenance kit, 100 V (MS510dn, MS517dn and M1145)	347
40X8440	Maintenance kit, 100 V (MS610dn, MS617dn and M3150dn)	347
40X8441	Maintenance kit, 100 V (MS610de and M3150)	348
40X8443	Pick roller assembly	346
40X8444	Separator roll assembly	. 332, 346

P/N	Part name	Page
40X8520	Dust cover (250-sheet tray)	332
40X8520	Dust cover, 250-sheet tray	346
40X8521	Dust cover (550-sheet tray)	332
40X8521	Dust cover, 550-sheet tray	346
40X8523	RS-232C Serial Interface Card	353
40X8524	1284-B Parallel Interface Card	353
40X8526	MarkNet N8350 802.11 b/g/n Wireless Print Server (MS610de)	354
40X8528	250-sheet tray insert (option tray only)	346
40X8529	550-sheet tray insert (option tray only)	346
40X8555	256MB flash card	354
40X8556	Font card, Traditional Chinese	354
40X8557	Font card, Simplified Chinese	354
40X8568	Font card, Korean	354
40X8569	Font card, Japanese	354
40X8570	Font card, Arabic	353
40X8571	Font card, Hebrew	353
40X8695	Relocation kit (MS510 and MS517dn)	354
40X8696	Relocation kit (MS610dn and MS617dn)	354
40X8697	Relocation kit (MS610de)	354
40X8737	RFID card reader	353
40X8777	MPF gearbox	343
40X8800	Media present sensor flag	340
40X8850	Redrive shaft	343
40X9131	MPF assembly (100 sheets)	332
40X9148	Cartridge plunger	332
40X9181	Cooling fan (MS610de and M3150)	336
40X9651	Right cover (MS610de and M3150)	332
40X9652	Adapter, N8130 10/100 fiber	354
40X9654	550-sheet tray, lockable	346
40X9939	MarkNet N8352 802.11 b/g/n Wireless Print Server Kit	353
40X9939	N8352 Wireless Card + NFC	354
41X0005	Nameplate (MS610dn, MS617dn and M3150dn)	333
41X0239	Rear door and cover (MS610de and M3150)	332
41X0362	Polygon LSU*	336

P/N	Part name	Page
41X0363	Polygon laser scanning unit (LSU) frame*	336
41X0366	Controller board* (applicable only to models MS510dn and MS517dn with polygon LSU)	336
41X0367	Controller board* (applicable only to models MS610dn and MS617dn with polygon LSU)	336
41X0568	MarkNet N8350 802.11 b/g/n Wireless Print Server with NFC (MS610de)	354
41X0759	Polygon LSU cable*	337
41X0838	IPDS card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0840	Prescribe Card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0855	Forms and Barcode Card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0856	Forms and Barcode Card (MS610de and M3150)	353
41X0857	Forms and Barcode + Simplified Chinese Font (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0858	IPDS card (MS610de and M3150)	353
41X0859	Forms and Barcode + Japanese Font (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0860	Prescribe Card (MS610de and M3150)	353
41X0913	Video cable (applicable only to models with galvo* LSU)	337
41X0958	Pick tires	343
41X0959	ACM assembly (standard tray only)	343
41X0988	Controller board* (applicable only to models MS610de and M3150 with polygon LSU)	337
41X0994	MPF tray links	332
41X1025	Toner density wiper kit	340
41X2013	Bezel (MS517dn)	333
41X2017	Bezel (MS617dn)	333
41X2300	Access cover link	333

Part name index

P/N	Part name	Page
40X8524	1284-B Parallel Interface Card	353
40X7856	160GB hard disk (MS610de and M3150)	354
40X7567	1GB DDR3 RAM	353
40X8287	250-sheet tray	346
40X8305	250-sheet tray insert	332
40X8528	250-sheet tray insert (option tray only)	346
40X8555	256MB flash card	354
40X7445	2GB DDR3 RAM	353
40X8086	550-sheet tray	332
40X8286	550-sheet tray	346
40X8529	550-sheet tray insert (option tray only)	346
40X9654	550-sheet tray, lockable	346
41X2300	Access cover link	333
40X8262	ACM assembly (option tray only)	346
41X0959	ACM assembly (standard tray only)	343
40X4826	Adapter, N8120 GB INA	353
40X4827	Adapter, N8130 10/100 Fiber	353
40X9652	Adapter, N8130 10/100 fiber	354
40X4823	Adapter, Parallel 1284-B	353
40X4819	Adapter, RS232C serial	353
40X8066	Bezel (MS510dn and M1145)	333
41X2013	Bezel (MS517dn)	333
40X8068	Bezel (MS610de and M3150)	333
40X8067	Bezel (MS610dn and M3150dn)	333
41X2017	Bezel (MS617dn)	333
40X5316	Cable, 14 pin JST for ISP	353
40X8083	Cartridge gearbox	343
40X9148	Cartridge plunger	332
40X8266	Cartridge smart chip contact	340
40X8292	Control panel assembly (MS510dn, MS517dn and M1145)	337
40X8285	Control panel assembly (MS610de and M3150)	337
40X8284	Control panel assembly (MS610dn, MS617dn and M3150dn)	337

P/N	Part name	Page
41X0366	Controller board* (applicable only to models MS510dn and MS517dn with polygon LSU).	336
40X8029	Controller board* (applicable only to models MS510dn, MS517dn and M1145 with galvo LSU)	336
40X8388	Controller board* (applicable only to models MS610de and M3150 with galvo LSU)	337
41X0988	Controller board* (applicable only to models MS610de and M3150 with polygon LSU)	337
41X0367	Controller board* (applicable only to models MS610dn and MS617dn with polygon LSU).	336
40X8030	Controller board* (applicable only to models MS610dn, MS617dn and M3150dn with galvo LSU)	336
40X8276	Cooling fan (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	336
40X9181	Cooling fan (MS610de and M3150)	336
40X8275	Duplex assembly	343
40X8277	Duplex gear assembly	343
40X8043	Duplex sensor and input sensor	340
40X8520	Dust cover (250-sheet tray)	332
40X8521	Dust cover (550-sheet tray)	332
40X8520	Dust cover, 250-sheet tray	346
40X8521	Dust cover, 550-sheet tray	346
40X8570	Font card, Arabic	353
40X8571	Font card, Hebrew	353
40X8569	Font card, Japanese	354
40X8568	Font card, Korean	354
40X8557	Font card, Simplified Chinese	354
40X8556	Font card, Traditional Chinese	354
41X0859	Forms and Barcode + Japanese Font (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0857	Forms and Barcode + Simplified Chinese Font (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0855	Forms and Barcode Card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0856	Forms and Barcode Card (MS610de and M3150)	353
40X8056	Front access cover (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	332
40X8268	Front access cover (MS610de and M3150)	332
40X8048	Front door sensor	340
40X8280	Front input guide	337
40X8299	Front mounts	343
40X8343	Fuser, 100 V	336

P/N	Part name	Page
40X8023	Fuser, 110 V	336
40X8024	Fuser, 220 V	336
40X8080	Galvo LSU* (MS510dn, MS517dn and M1145)	336
40X8079	Galvo LSU* (MS610dn, MS617dn, MS610de, M3150dn, and M3150)	336
40X8044	Index sensor	340
40X0387	Interface device, USB-A	353
41X0838	IPDS card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0858	IPDS card (MS610de and M3150)	353
40X8279	Jam access cover	343
40X8053	Left cover (MS510dn, MS517dn and M1145)	333
40X8269	Left cover (MS610dn, MS617dn, MS610de, M3150dn, and M3150)	333
40X8085	Main drive gearbox	343
40X8439	Maintenance kit, 100 V (MS510dn, MS517dn and M1145)	347
40X8441	Maintenance kit, 100 V (MS610de and M3150)	348
40X8440	Maintenance kit, 100 V (MS610dn, MS617dn and M3150dn)	347
40X8281	Maintenance kit, 110 V (MS510dn, MS517dn and M1145)	347
40X8434	Maintenance kit, 110 V (MS610de and M3150)	348
40X8433	Maintenance kit, 110 V (MS610dn, MS617dn and M3150dn)	348
40X8282	Maintenance kit, 220 V (MS510dn, MS517dn and M1145)	347
40X8436	Maintenance kit, 220 V (MS610de and M3150)	349
40X8435	Maintenance kit, 220 V (MS610dn, MS617dn and M3150dn)	348
40X8526	MarkNet N8350 802.11 b/g/n Wireless Print Server (MS610de)	354
41X0568	MarkNet N8350 802.11 b/g/n Wireless Print Server with NFC (MS610de)	354
40X9939	MarkNet N8352 802.11 b/g/n Wireless Print Server Kit	353
40X7592	Media present sensor	340
40X8800	Media present sensor flag	340
40X9131	MPF assembly (100 sheets)	332
40X8777	MPF gearbox	343
40X8295	MPF pick roller and separator pad	343
40X8300	MPF solenoid	337
41X0994	MPF tray links	332
40X9939	N8352 Wireless Card + NFC	354
40X8051	Nameplate (MS510dn, MS517dn and M1145)	333
40X8272	Nameplate (MS610de and M3150)	333

P/N	Part name	Page
41X0005	Nameplate (MS610dn, MS617dn and M3150dn)	333
40X8050	Narrow media/bin full sensor	336
40X8443	Pick roller assembly	346
41X0958	Pick tires	343
40X8084	Pick/Lift motor gearbox	343
41X0363	Polygon laser scanning unit (LSU) frame*	336
41X0759	Polygon LSU cable*	337
41X0362	Polygon LSU*	336
40X0289	Power cord, 1.8 m (straight)—USA	351
40X0288	Power cord, 2.5 m (straight)—Argentina	351
40X0301	Power cord, 2.5 m (straight)—Australia	351
40X4596	Power cord, 2.5 m (straight)—Brazil	351
40X0303	Power cord, 2.5 m (straight)—China	351
40X1774	Power cord, 2.5 m (straight)—Denmark	351
40X3141	Power cord, 2.5 m (straight)—Europe and others	351
40X0275	Power cord, 2.5 m (straight)—Israel	351
40X0270	Power cord, 2.5 m (straight)—Japan	351
40X1792	Power cord, 2.5 m (straight)—Korea	351
40X1773	Power cord, 2.5 m (straight)—South Africa	351
40X1772	Power cord, 2.5 m (straight)—Switzerland	351
40X1791	Power cord, 2.5 m (straight)—Taiwan	351
40X0273	Power cord, 2.5 m (straight)—Traditional Italy	351
40X0271	Power cord, 2.5 m (straight)—United Kingdom	351
40X0269	Power cord, 2.5 m (straight)—USA, Canada	351
40X7797	Power supply, 100 V/110 V	340
40X7798	Power supply, 220 V	340
41X0840	Prescribe Card (MS510dn, MS517dn, MS610dn, MS617dn, M1145, and M3150dn)	353
41X0860	Prescribe Card (MS610de and M3150)	353
40X8054	Rear door and cover (MS510dn, MS517dn and M1145)	332
41X0239	Rear door and cover (MS610de and M3150)	332
40X8270	Rear door and cover (MS610dn, MS617dn and M3150dn)	332
40X8298	Redrive assembly (MS510dn, MS517dn and M1145)	343
40X8438	Redrive assembly (MS610de and M3150)	343
40X8437	Redrive assembly (MS610dn, MS617dn and M3150dn)	343

P/N	Part name	Page
40X8850	Redrive shaft	343
40X8695	Relocation kit (MS510 and MS517dn)	354
40X8697	Relocation kit (MS610de)	354
40X8696	Relocation kit (MS610dn and MS617dn)	354
40X8301	Reverse solenoid	337
40X8737	RFID card reader	353
40X8052	Right cover (MS510dn, MS517dn and M1145)	332
40X9651	Right cover (MS610de and M3150)	332
40X8087	Right cover (MS610dn, MS617dn and M3150dn)	332
40X8523	RS-232C Serial Interface Card	353
40X8273	Rubber foot	333
40X8394	Screw kit	344
40X5315	Screw, Ship with ISP (2)	353
40X8444	Separator roll assembly	332, 346
40X5317	Standoff, Tee with thumbscrew	353
40X8046	Toner density sensor	340
41X1025	Toner density wiper kit	340
40X8055	Top cover (MS510dn, MS517dn and M1145)	333
40X8271	Top cover (MS610dn, MS617dn, MS610de, M3150dn, and M3150)	333
40X8045	Trailing edge sensor	340
40X8393	Transfer roll	343
40X7592	Tray present sensor	337
40X1368	USB cable, packaged (2 m)	354
41X0913	Video cable (applicable only to models with galvo* LSU)	337


MS31X MS41X MS510 MS610dn



CAUTION—SHOCK HAZARD: This type of caution indicates a danger from hazardous voltage in the area of the product where you are working. Unplug the product before you start working, or use caution if the product must receive power to perform the task.



CAUTION—POTENTIAL INJURY: The lithium battery in this product is not intended to be replaced. There is a danger of explosion if a lithium battery is incorrectly replaced. Do not recharge, disassemble, or incinerate a lithium battery. Discard used lit hium batteries according to the manufacturer's instructions and local regulations.

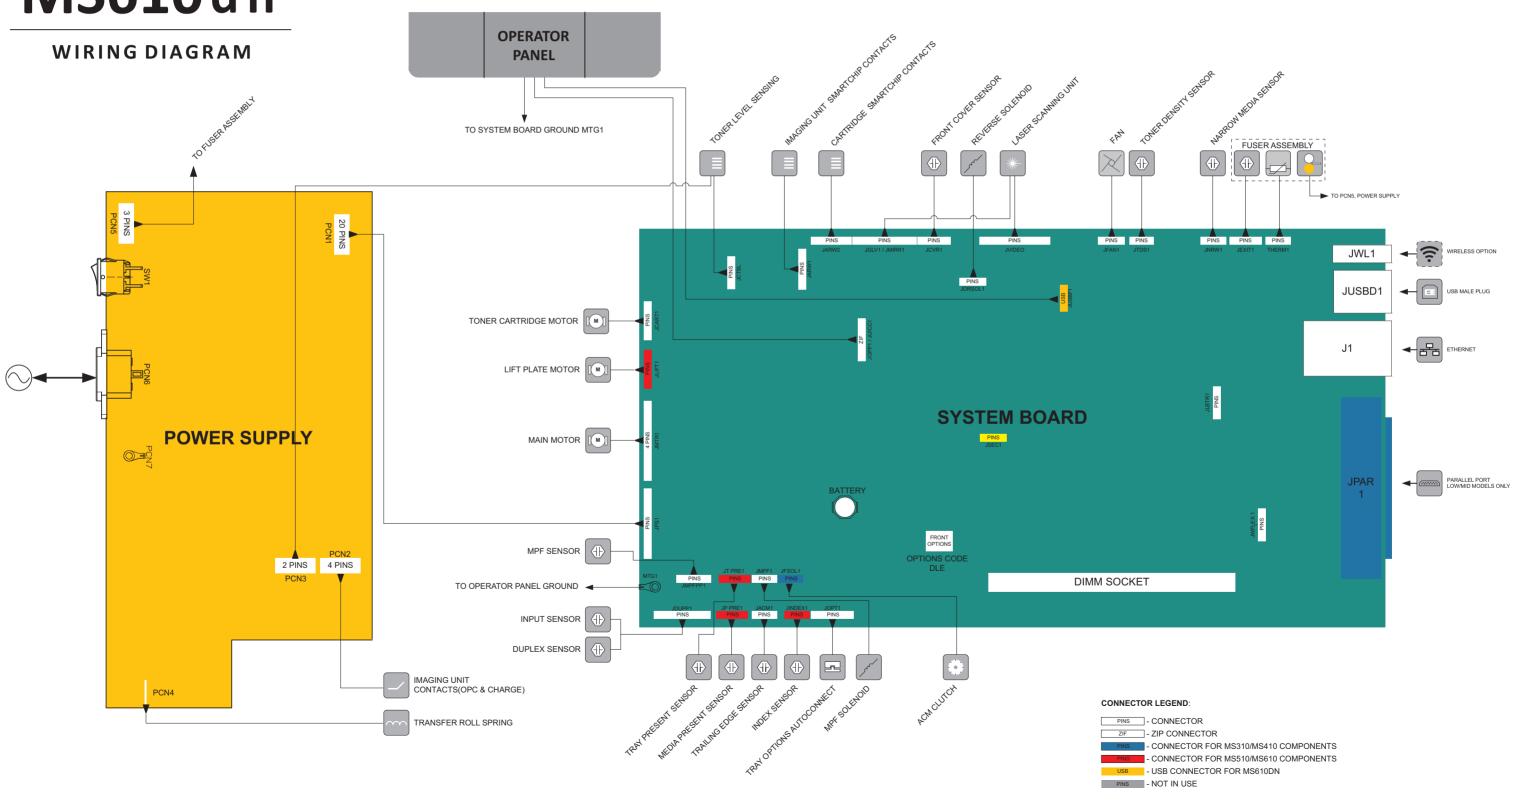

MS610de WIRING DIAGRAM

