



Replace Front Fender Garnishes

Classification	Repair Bulletin	Section/Group	12 - Exterior Fittings	Country/Region	United States
Year	2016	Model	Model X	Version	All

Bulletin Classification: *This repair bulletin provides instructions and guidelines for a noted condition or a customer concern. The information provided can address a broad range of known or perceived issues with the operation of Tesla vehicles. This bulletin might not be VIN-specific. These instructions assume knowledge of motor vehicle and high voltage electrical component repairs, and should only be executed by trained professionals. Tesla Motors assumes no liability for injury or property damage due to a failure to properly follow these instructions or repairs attempted by unqualified individuals.*

Condition

The parking sensors might not be flush with the front fender garnishes (Figure 1) on some Model X vehicles, causing a perceived quality issue.

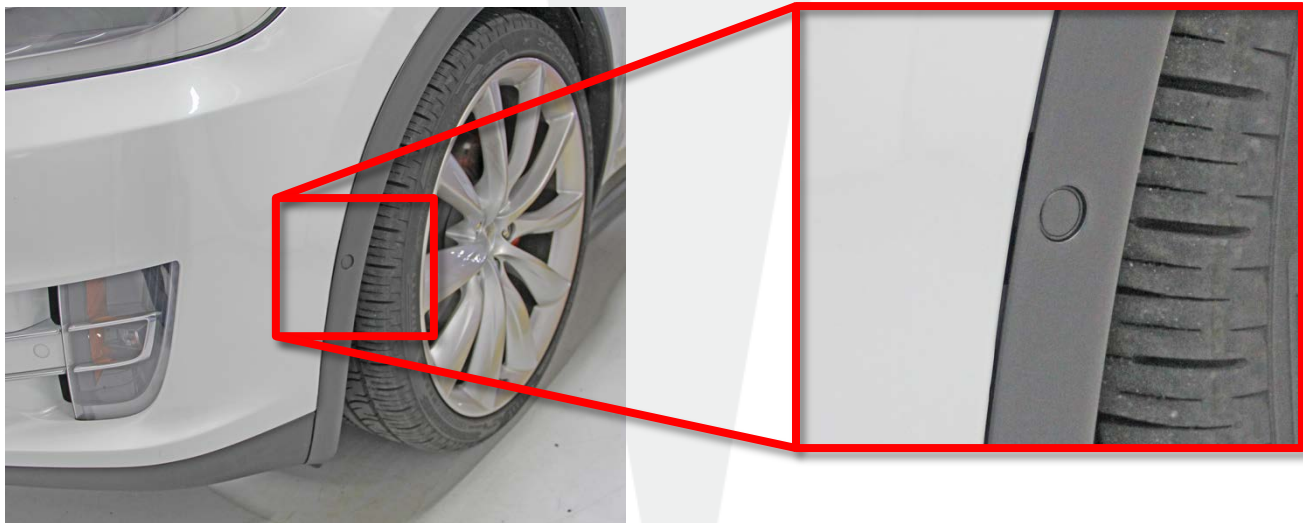


Figure 1

Correction

Upon customer complaint, replace both front fender garnishes.

Correction Description	Correction	Time
SB-16-12-001 Not Applicable	S011612001	0.0
Replace LH And RH Front Fender Garnishes Due To Underflush Parking Sensors	S021612001	0.1

Required Part(s):	Part Number	Description	Quantity
	1035288-99-F	ASSY, FENDER GARNISH FR, LH MDL X	1
	1035289-99-F	ASSY, FENDER GARNISH FR, RH MDL X	1

These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Manual.

Procedure

1. Remove and discard the LH front fender garnish assembly (refer to Service Manual procedure 12201202).

NOTE: The new front fender garnishes come with the parking distance sensor and retaining ring already installed.

2. Ensure that the parking sensor is flush with the new fender garnish.
3. Install the new front fender garnish.
4. Perform steps 1-3 on the RH side of the vehicle.

Affected VIN(s) Affected Model X vehicles built before approximately December 22, 2015.

NOTE: This is a simplified summary of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

For feedback on the accuracy of this document, email ServiceBulletinFeedback@teslamotors.com.