 <b>Tesla, Inc.</b> Service Bulletin		<b><i>Firmware Update for Traffic Aware Cruise Control (TACC)</i></b>	
<b>SB-21-00-002</b> June 26, 2021			
<b>Classification</b>		<b>Section/Group</b>	<b>Mobile Service</b>
Recall Bulletin		00 - Inspection & Service	Can Perform (where permitted)
<b>Model Year</b>	<b>Model</b>	<b>Country/Region</b>	<b>Version</b>
2019 - 2021	Model 3, Model Y	China	All
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			

Recall Bulletin: Recall Bulletins are mandatory service procedures that must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

## Condition

TACC may accidentally be activated under some circumstances.

## Correction

Inspect the firmware version installed on the vehicle and update it to 2021.4.18.5 or later.

Correction Description	Correction	Time
Inspect Vehicle Firmware Version, No Action Required	S012100002	0.05
Inspect Vehicle Firmware Version, Update Firmware	S022100002	0.05

## Procedure

1. On the vehicle touchscreen, touch **Controls** (vehicle icon) > **Software**, and scroll down to display the vehicle firmware version. If firmware version is 2021.4.18.5, discontinue this procedure. Otherwise, continue to next step.
2. Select the clock in the center display, or touch **SOFTWARE UPDATE** (Figure 1).

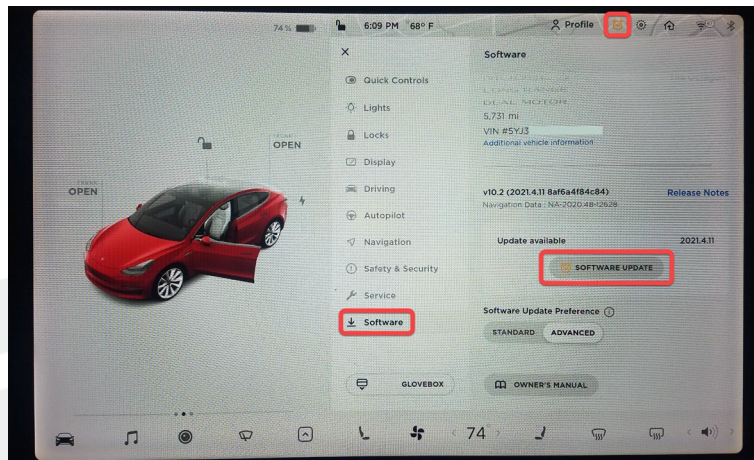


Figure 1

3. In **Software Update** window, touch **INSTALL NOW** to start the update (Figure 2).

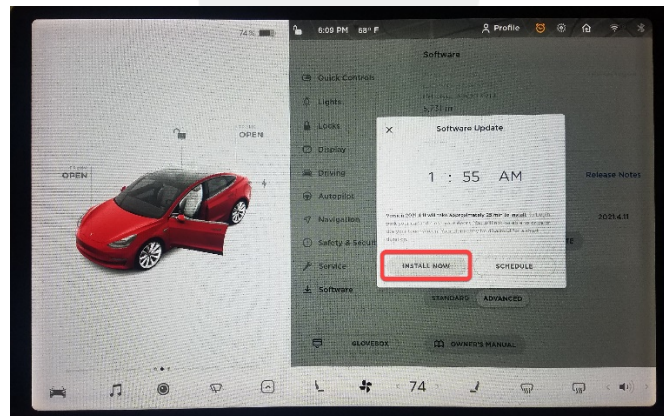


Figure 2

4. Check release notes to confirm whether the firmware is updated to 2021.4.18.5 (or later).